DI-524UP Firmware Release Note

D-Link Firmware: v1.03 Alpha Firmware: v4.0.0b15

Date: 2006/10/17

Fix:

Chinese Web display error on windows 98 IE 6.0

D-Link Firmware: v1.03 Alpha Firmware: v4.0.0b14

Date: 2006/10/16

Fix:

- 1. DPH-300 dect phone ,teltel voice call fail .
- 2. Support raw printer.
- 3. Can not get real product model name of Epson stylus c45.
- 4. Support dlink ddns and the dyndns with custom and static.

D-Link Firmware: v1.02 Alpha Firmware: v4.0.0b13

Date: 2006/05/15

Fix:

- 3. Smartbit test fail issue(ARP timeout issue)
- 4. Add url home is "routers.dlink.com"
- 5. PPTP 12tp connect issue.
- **6.** default ssid is "dlink"

5.Multi-language:zh-tw,en,French,korea,Spanish,Italian,german

D-Link Firmware: v1.02 Alpha Firmware: v4.0.0b12

Date: 2006/03/30

Fix:

7. Smartbit test fail issue(ARP timeout issue)

- 8. Add url home is "routers.dlink.com"
- 9. PPTP 12tp connect issue.
- 10. default ssid is "dlink"

D-Link Firmware: v1.02 Alpha Firmware: v4.0.0b11

Date: 2006/03/07

Fix:

1. 12tp bug

D-Link Firmware: v1.01 Alpha Firmware: v4.0.0b10

Date: 2005/12/26

Fix:

2. WebPages cancel button did not work in "Advance" category.

D-Link Firmware: v1.01 Alpha Firmware: v4.0.0b9

Date: 2005/12/26

Fix:

1. PPTP/L2TP can't get DNS ip from server.

D-Link Firmware: v1.01 Alpha Firmware: v4.0.0b8

Date: 2005/12/23

Fix:

- 1. Add multi-language selection under the menu.
- 2. CD router scaling test item fail.
- 3. SIP ALG did not work properly (Content-Length not be adjusted).
- 4. WAN static ip can't set a legal ip address. (ex. 192.168.0.255/255.255.254.0)
- 5. PPTP/L2TP would hang when WAN receive ip multicast packets if IGMP proxy is

disabled.

D-Link Firmware: v1.01 Alpha Firmware: v4.0.0b7

Date: 2005/11/23

Fix:

- 1. Bigpond connect button in device status web page did not work.
- 2. WAN auto detection did not work.

D-Link Firmware: v1.01 Alpha Firmware: v4.0.0b6

Date: 2005/11/16

Fix:

- 1. Add WAN physical link status information for PC wizard utility.
- 2. UpnP internet connection status window would disappear after open it.
- 3. Bigpond can't login.
- 4. Add web restart page with countdown message.
- 5. Wireless with WPA/PSK auto, the LAN to WLAN broadcast packets can't be received by wireless client.

D-Link Firmware: v1.0.0 Alpha Firmware: v4.0.0b5

Date: 2005/10/19

Fix:

- 1. DONT_TOUCH_TTL fixed.
- 2. Wireless Mass Production ctx command fail.

Feature:

1. Single firmware for multi-language, now supported languages are English and Chinese.

D-Link Firmware: v1.0.0 Alpha Firmware: v4.0.0b4

Date: 2005/10/6

Fix:

- 1. PPPoE manual disconnect then connect, the Internet access fail.
- 2. When enable QoS (MAC,IP,Application), the LAN/WLAN wireless performance become very slow.
- 3. PPPoE dial fail if user name contain '#'.
- 4. Client use WPA+AES or WPA2+TKIP can't connect to AP in WPA/WPA-PSK AUTO mode.
- 5. Wireless station can't access Internet (Affected by DONT_TOUCH_TTL function), we have to remove DONT_TOUCH_TTL feature.

Feature:

1. Add IGMP proxy function.

D-Link Firmware: v1.0.0 Alpha Firmware: v4.0.0b3

Date: 2005/09/20

Fix:

- 1. Print function fail when the "byte count" option is uncheck in windows printer setup.
- 2. Improve web page access speed.
- 3. Change the UDP session timeout from 15 to 1 minute.
- 4. BitComet complain "Add PortMapping fail".
- 5. Topology information show WAN connect down when WAN type is static ip.
- 6. All kind of packets dropped when ip filter protocol option set to both.
- 7. Change policy route maximum entry to 32.
- 8. DHCP client blind accept ACK packets.
- 9. Active session fail.
- 10. Running Emule with Domain block enabled would crash device.
- 11. WPA-PSK pass phrase length longer than 54 bytes, AP function fail.

Features:

- 1. PPTP/L2TP server can be domain name.
- 2. Support TTL don't touch for ISP may set TTL to 1.
- 3. Add, "email to" and email authentication support in Log Email setting.

Customer Firmware: v1.0.0 Alpha Firmware: v4.0.0b2

Date: 2005/07/11

Features:

- 1. Add WCN.
- 2. Add WPA2.
- 3. Shrink firmware size to fit into 2MB.

Customer Firmware: v1.0.0 Alpha Firmware: v4.0.0b1

Date: 2005/06/22

Features:

1.One USB port for printer function and RealTek wireless 8185 on board.

Problems Resolved:

Enhancements: