

ASCOTTM
SUPPLY CORPORATION



TPMS TIRE PRESSURE
MONITORING SYSTEMS
CATALOG

2014

YOUR ONE SOURCE FOR QUALITY
BRAND NAME EQUIPMENT, TOOLS
AND SUPPLIES FOR THE TIRE INDUSTRY

Ascot Supply Corporation

**Programmable
TPMS Sensors**



TPMS as Simple as...

1

**Scan and Remove
Failed Sensor**



2

Simply Copy ID



3


Install and Go



**Multi-Application
TPMS Sensors**



- **Out of the Box Solution** - pre-programmed, ready to use (just like an OE sensor).
- **Snap-In and Clamp-In Valve Options** - valve stems are interchangeable.
- **Works with All Major Scan Tools.**

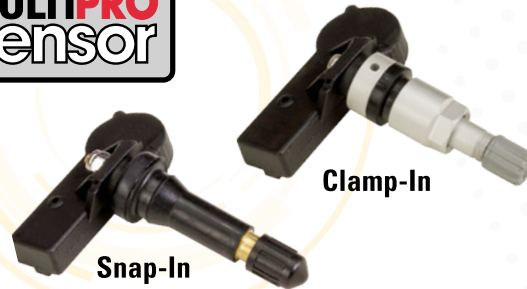

TPMS Tools & Accessories

TPMS Tool Assortment

- Includes all the small TPMS tools necessary for TPMS service.



Grommet Slide

- Durable construction and easy-to-use slide allows for simple grommet removal.
- Hole allows for simple new grommet installation.



Replacement Parts Kits

Group **31**
INCORPORATED

MAKERS OF
Xtra seal

Mobile Application
Lookup



TABLE OF CONTENTS

● TPMS RELEARN CHART	
TPMS Relearn Chart _____	4
● TPMS SENSOR ACTIVATION TOOLS	
Sensor Activation Tools _____	5
● UNIVERSAL TPMS TRANSMITTERS	
EZ-Sensors _____	13
REDI-Sensors _____	14
● OE TPMS TRANSMITTERS	
Schrader TPMS Transmitters _____	16
Dill TPMS Transmitters _____	18
● TPMS TOOLS, ACCESSORIES & KITS	
Smart Sensor Pro+ _____	15
Multi-Application TPMS Sensors _____	21
Tools, Accessories & Kits _____	22
● BANDED TPMS SYSTEMS	
Banded TPMS Systems & Accessories _____	34
● TRAINING & PROMOTIONAL MATERIALS	
Training & Promotional Materials, Cabinets _____	33
● TPMS RETROFIT KITS	
TPMS Retrofit Kits _____	35
● UNIVERSAL TPMS TRANSMITTERS APPLICATION GUIDES	
EZ-Sensor Application Guide _____	36
REDI-Sensor Application Guide _____	45
● SCHRADER APPLICATION GUIDE	
Schrader 2014 TPMS Application Guide _____	48
Manufacturer's Part Numbers _____	155
Numerical Listing: Sensors/Transmitters _____	156
Numerical Listing: Service Packs _____	164
● DILL APPLICATION GUIDE	
Dill 2014 TPMS Application Guide _____	174



TPMS RELEARN CHART

TIA TPMS Relearn Chart

Forget the competitor's TPMS relearn information. The TIA TIRE PRESSURE MONITORING SYSTEM (TPMS) RELEARN CHART serves as a valuable, comprehensive and quick reference guide that technicians can easily navigate through to service any vehicle, foreign and domestic, that is quipped with TPMS.

Your organization won't want to be without one! It will save you time and money the first time you use it.

FEATURES: Information on vehicles equipped with TPMS through Model Year 2009; Laminated Flip Chart designed to provide accurate information on all aspects of TPMS applications, including relearn procedures; Chart is divided into Domestic & Import vehicle sections

CHART PROVIDES THE FOLLOWING INFORMATION:

- **The type of TPMS**, whether direct or indirect
- **Three columns of data that indicate when a system relearn is necessary**, i.e. after a change in air pressure, tire rotation, or tire/sensor replacement
- **A relearn summary:** this includes a reference number that corresponds to the vehicle's procedure for initiating sensor relearn mode. The vehicle relearns are located in the back of the corresponding section, either domestic or import
- **The sensor manufacturer**
- **Replacement part numbers:** OEM sensor part number, Schrader replacement sensor part and service pack numbers, Dill replacement sensor part and kit and band numbers, Continental replacement sensor part and kit and band numbers, and NAPA replacement sensor part and service pack numbers
- **The torque specifications** for the sensor nut, torx bolt, worm gear and lug nuts are listed

469-02013
TIA TPMS
Relearn Chart

Ascot No.	Description
469-02013	2013 TIA TPMS Relearn Chart

Snapshots of what is included in the TIA TPMS Relearn Chart:

DOMESTIC VEHICLES																							
MAKE	MODEL	YEAR	D-Direct Indirect TPM	Relearn Required After:			Relearn Summary	Sensor Manuf.	OEM Sensor Part#	Schrader [®] Sensor Part#	Schrader [®] Service Pack#	Dill Sensor Part#	Dill Kit or Band #	NAPA [®] Sensor Part#	NAPA [®] Service Pack#	Continental Part # (Continental only)		Torque Specifications: Inch lbs. (N.m.)					
				Change Air Pres.	Rotate	Repl Tire/ Sensor										Sensor	Kit or Band#	Sensor Nut	Torx Bolt	Worm Gear	Lug Nut Ft. Lbs. (N.m)		
Buick	Allure	2006	I	✓	✓	✓	GM-2	Schrader		20158	20004		1070K	921011	920125							100(140)	
	Allure	2007	D		✓	✓	GM-6	Siemens	15921013			1047	1050K									100(140)	
										20030			1050K										
										20150	20004		1047	1050K	921011	920125	SES3007	SES4369	80(9)				100(140)
	Allure	2008	D		✓	✓	GM-11	Siemens	15921013				1047	1050K									100(140)
										20030			1050K										
	Allure	2009	D		✓	✓	GM-11	Schrader	26920615	20153	20008	9153	V9300	921021	920145					11.5			100(140)
	Century	1990-05	I	✓	✓	✓	GM-1																100(140)

IMPORT RELEARN

AC-1
Ensure all tires are inflated to the pressure listed on the tire placard. Drive vehicle at speeds above 15 mph for a minimum of 40 seconds. Sensor ID's will be learned automatically.

ALL-1
1. Inflate all tires to pressure listed on tire placard.
2. Hold down RESET button (on end of wiper lever) until DISPLAY TYPE is displayed.
3. Press button on end of wiper lever to select SET.
4. Press RESET button.
5. Press button on end of wiper lever to select TIRE PRESSURE.
6. Press RESET button.
7. Press button on end of wiper lever to select WHEEL CHANGE (SELECT STORE PRESSURES IF RESETTING AIR PRESSURE).
8. Press RESET button. Relearn can take 30 minutes to complete.

BMW-2
Inflate all tires to pressure indicated on tire placard.
If equipped with Drive:
1. Turn ignition to ON position (engine off).
2. Select SETTINGS from iDrive menu.
3. Select VEHICLE.
4. Select TPMS.
5. Select RESET.
If not equipped with Drive:
1. Turn ignition to ON position (engine off).
2. Hold down TIRE PRESSURE WARNING or RUC button (located on instrument panel) until TPMS text is illuminated.
3. Vehicle must be driven to complete relearn.

LEX-3
A properly formatted scan tool is required to learn new sensor IDs when replacing sensors.

LEX-4
Initialization following rotation and tire replacement:
1. Inflate all tires to pressure indicated on tire placard.
2. Apply parking brake and turn ignition to ON position (engine off).
3. Hold down tire pressure warning reset switch until TPMS text is visible 3 times.
4. It will take several minutes for the ECU to receive signals from the sensors and complete initialization.
*A properly formatted scan tool is required to learn new sensor IDs when replacing sensors.

LEX-5
Initialization following rotation and tire replacement.

SENSOR ACTIVATION TOOLS



A. Bartec Wheelrite Tech500 All-In-One TPMS Service Tool w/ OBD and Wireless Connectivity

- Improved hardware performance
- WLAN and Bluetooth wireless communication
- New easier-to-use menu flow
- New ergonomic enclosure
- Model year 2013 coverage
- Extensive OBD coverage, including GM and Ford
- **More intuitive operation:** ANYONE in your shop can operate this tool
- **More TPMS information:** All right there in the palm of your hand
- **More ergonomic:** Easier to operate single-handedly
- **Wireless communication:** No USB connection to PC required
- Comprehensive audit report
- More on-board DTC information



The Bartec Tech500 All-In-One TPMS Service Tool in use.



469-50000
Bartec Tech500
All-In-One TPMS
Service Tool

Ascot No.	Mfg. No.	Description
469-50000	WRT500	Tech500 All-In-One TPMS Service Tool w/ OBD and Wireless Connectivity

B. Bartec Mitsubishi OBDII Relearn Adapter

- Relearns Mitsubishi Lancer, Mirage, Outlander & RVR by connecting to the Tech400+, Tech400SD & Tech500 Tools
- Works with old activation tools if they work on Mitsubishi sensors
- No additional tools or devices required
- Allows for "pressure drop" sensor activation, no expensive accessory devices or other activation tools are needed
- *Kit includes cable and instruction card*



469-00202
Bartec Mitsubishi
OBDII Relearn
Adapter

Ascot No.	Mfg. No.	Description
469-00202	WRT0BD002	Bartec Mitsubishi OBDII Relearn Adapter Kit

C. Bartec Tech200 Base Activation Tool

- Comprehensive TPMS coverage, including 2013 models
- Wireless capability using Bluetooth
- Make-Model-Year menu (MMY)
- Lightweight, ergonomic design
- Clearly arranged 3-button key pad
- Rechargeable battery
- USB port
- Activates and reads all known OE TPM sensors
- MMY makes sure correct sensor is activated, avoids crosstalk
- Integration into TPMS HUB via Bluetooth
- Easy to operate with only 3 keys
- Low cost entry level tool



The Bartec Tech200 Base Activation Tool in use.



469-20001
Bartec Tech200
Base Activation Tool

Ascot No.	Mfg. No.	Description
469-20001	WRT200	Tech200 Base Activation Tool
469-20222	WRT200BT	Tech200 Base Activation Tool with Bluetooth

SENSOR ACTIVATION TOOLS (CONT.)

A



469-46001
Bartec Tech400 Smart
Sensor Programming Fixture


COMING
SOON!

A. Bartec Tech400 Smart Sensor Programming Fixture

- Integrated design, fit and function
- Combines at-the-wheel programming with industry leading OBD function
- Validates the programmed sensor prior to installation
- Intuitive and easy to use programming method
- Works on all CUB variant sensors
- All backed by the very best in class TPMS Technical Support team

Ascot No.	Mfg. No.	Description
469-46001	WRT400SDADP001	Bartec Tech400 Smart Sensor Programming Fixture

B

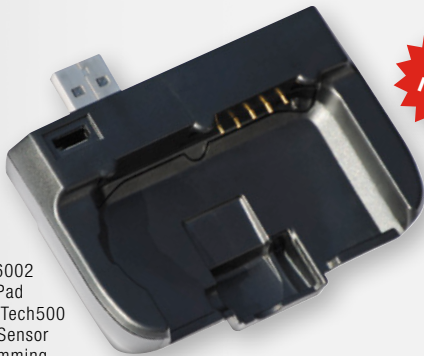

469-56002
TPMS Pad
Bartec Tech500
Smart Sensor
Programming
Fixture

NEW
ITEM!

B. Bartec Tech500 Smart Sensor Programming Fixture

The CUB Programming fixture, when added to the Tech500 tool will give the user the ability to program ANY of the Cubelec programmable sensors.

- Combines at the wheel programming with the very best in TPMS OBDII vehicle coverage
- **Product Validation:** As soon as the sensor is programmed, the Tech500 validates the sensor per the Bartec Application Specification
- Easy to understand and use, the tool intuitively walks the technician through the steps
- Works on all Cubelec variant sensors
- Backed by the Bartec TPMS Technical Support Team

Ascot No.	Mfg. No.	Description
469-56002	WRT500CPF002	Tech500 Smart Sensor Programming Fixture

C



469-50001
TPMS Pad

C. TPMS Pad

- Make-Model-Year look up (MMY)
- 2013 Model Year Coverage
- Easy to use software
- Direct reading from sensor for quick programming
- Connects to PC or LAPTOP using the standard USB cable
- Internet is NOT required
- Ideal for busy shops, frees up your TPMS activation tool
- No batteries are required
- No need to key in the TPMS ID
- No need to type in the VIN

Ascot No.	Mfg. No.	Description
469-50001	TPMS Pad	TPMS Pad

D



469-50002
TPMS Hub

D. TPMS Hub

- Application driven
- Centralized point for all things TPMS
- Runs the Programming Pad
- Runs the new updater application
- Optional web connectivity for added function

Ascot No.	Mfg. No.	Description
469-50002	TPMS Hub	TPMS Hub

SENSOR ACTIVATION TOOLS (CONT.)

E. Bartec Wheelrite Tech400SD TPMS Tool

- **Best Coverage:** Activate and Decode ALL known TPMS sensors
- **Accurate Repairs:** Use Make, Model, Year Look-up for accurate repairs, no guessing!
- **Easy Reference:** Displays replacement part number right on the tool
- **Better Diagnostics:** Indicates if proper sensor is installed.
- **Easy Three-Step Process:** Programs Sensor ID's through the OBD
- **On-Board Relearn procedures:** Easy reference means faster repair
- **Removable SD Card:** Update without computer or internet
- **Improved tactile feel and operation:** Raised button key pad
- **UHF Signal Detection:** checks signal of key fobs (RKE)!



The Bartec Tech400SD TPMS Tool in use.



469-40111
Bartec Wheelrite
Tech400SD



469-40112
Tech400SD
Total TPMS Kit



469-40011
One Year
Software
Update

469-40022
Two Year
Software
Update

469-40033
Two Year
Software
Update

Ascot No.	Mfg. No.	Description
469-40111	WRT400SD	Bartec Tech400SD TPMS Tool
469-40112	WRT400SDTK	Tech400SD Total TPMS Kit INCLUDES: Tech400SD Tool Kit, Mechanical Tool Kit, and Training Kit
469-40011	WRTSUL1	One Year Software Update
469-40022	WRTSUL2	Two Year Software Update
469-40033	WRTSUL3	Three Year Software Update

F. Bartec Programming Fixture

- Designed for use with the Bartec Tech400 TPMS reprogramming tool in conjunction with the EZ-Sensor
- The use of the fixture allows for the EZ-Sensor to rest securely in the correct position for relearning
- Is also included in the 469-40010 Bartec EZ-Sensor starter kit as standard procedure

Ascot No.	Mfg. No.	Description
469-40035	WRTEZS-STK35	Bartec Programming Fixture



469-40035
Bartec
Programming
Fixture

E

F

SENSOR ACTIVATION TOOLS (CONT.)





469-30002
Bartec Wheelrite
Tech300SD

A. Bartec Wheelrite Tech300SD

- Replaces the Tech300+
- More compact than the Tech400+
- Rechargeable battery
- **SD Card updates:** No computer needed
- **Optional OBD Connector:** Either in kit or sold separate
- *Functions similar to Tech400+*
- Can program EZ-Sensor

Screenshots:

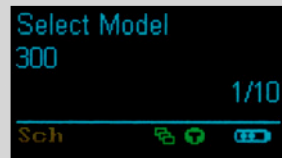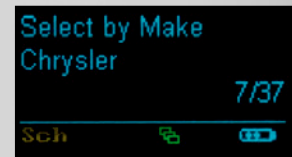

A



469-30005
Tech300SD
Upgrade Kit

Ascot No.	Mfg. No.	Description
469-30003	WRT300PSD	Bartec Wheelrite Tech300SD Kit. Includes: Carrying case, relearn magnet, USB cable & user guide
469-30004	WRT300PSDC	Bartec Wheelrite Tech300SD Combo Kit. INCLUDES: Tech300SD Tool Kit, OBD COMS, and Cable
469-30005	WRT300POBD	Tech300SD Upgrade Kit. OBD connector for Tech300SD
469-33001	WRT300PSDSUL1	1 Year Software Update License Certificate (Tech300PSDC)
469-33002	WRT300PSDSUL2	2 Year Software Update License Certificate (Tech300PSDC)
469-33003	WRT300PSDSUL3	3 Year Software Update License Certificate (Tech300PSDC)

BARTEC WHEELRITE TECH300SD KITS



469-30003
Bartec Wheelrite
Tech300SD Kit



469-30004
Bartec Wheelrite
Tech300SD Combo Kit

SENSOR ACTIVATION TOOLS (CONT.)

B. Bartec EZ-Sensor Starter Kits

- Designed to provide all of the necessary startup information for EZ-Sensor users

Ascot No.	Mfg. No.	Description
469-40010	WRTEZS-STK10	Bartec EZ-Sensor Starter Kit The starter kit comes complete with the following tools: <ul style="list-style-type: none"> ▪ Training DVD ▪ Application Chart ▪ User Guide ▪ Quick Start Guide ▪ Programming Fixture
469-40015	WRTEZS-STK15	Bartec EZ-Sensor Starter Kit - 2 EZ-Sensors and 2 Aluminum Stems The starter kit comes complete with the following tools: <ul style="list-style-type: none"> ▪ Training DVD ▪ Application Chart ▪ User Guide ▪ Quick Start Guide ▪ Programming Fixture ▪ EZ-Sensor Activation Certificate ▪ 2 EZ-Sensors and 2 Aluminum Replacement Stems Included
469-40020	WRTEZS-STK20	Bartec EZ-Sensor Starter Kit - 4 EZ-Sensors and 4 Aluminum Stems The starter kit comes complete with the following tools: <ul style="list-style-type: none"> ▪ Training DVD ▪ Application Chart ▪ User Guide ▪ Quick Start Guide ▪ Programming Fixture ▪ EZ-Sensor Activation Certificate ▪ 4 EZ-Sensors and 4 Aluminum Replacement Stems Included



Bartec EZ-Sensor Starter Kits

C. Toyota Loop Reset Tool

- Resets TPMS warning light when stuck in loop
- Plugs into OBD II connection and hold button
- No pin jumping required with the WRTRST50
- Accurate and fast

Ascot No.	Mfg. No.	Description
469-00450	WRTRST50	Toyota Loop Reset Tool



469-00450
Toyota Loop Reset Tool

D. Mitsubishi TPMS Reset Tool

- Stand alone, one touch TPMS relearn module
- Enables Mitsubishi Lancer, Outlander & Mirage TPMS learn mode
- Fully updatable via computer
- *Compatible with all TPMS trigger tools capable of triggering Mitsubishi sensors*



Ascot No.	Mfg. No.	Description
469-05701	MitsuReset	Mitsubishi TPMS Reset Tool



469-05701
Mitsubishi TPMS Reset Tool

E. Nissan Reset Tool

- Designed to extinguish the Tire Pressure Warning Light on 2003 & newer Nissan vehicles with TPM Reset Connector

Ascot No.	Mfg. No.	Description
469-71985	71985	Nissan Reset Tool



469-71985
Nissan Reset Tool

B

C

D

E

SENSOR ACTIVATION TOOLS (CONT.)

A



469-03834
Tire Pressure Monitoring
System Reset Tool



A. Tire Pressure Monitoring System Reset Tool

- The OTC TPR is a fast and simple to use stand alone TPMS activation tool
- Works on all known TPMS sensors
- Bright graphic display and simple navigation buttons enable vehicle selection for fast activation
- Automatically adjusts activation output power to eliminate cross activation of near sensors
- Register new sensor ID's on Asian vehicles
- Use the TPR to activate and decode sensor ID's and transmit them to the Genisys wirelessly
- Bluetooth wireless communication adapter included
- Quick reference reset procedures can be quickly accessed on the Genisys
- *Compatible with the entire Genisys family of scan tools*
- **Includes:** TPR handheld, DB25 wireless adapter, carry case, registration card, user manual for TPR and Genisys® interface

Ascot No.	Mfg. No.	Description
469-03834	OTC-3834	Tire Pressure Monitoring System Reset Tool

B



469-03835
Tire Pressure Monitoring
System Reset Tool Master Kit



B. Tire Pressure Monitoring System Reset Tool Master Kit

- Fast simple programming using OTC TPR Tool
- Eliminates the need to perform relearn procedures when replacing sensors
- No scan tool required for programming
- Replaces over 90% of current TPMS sensors!
- Save money & fit the right part
- Fast simple assembly to the wheel rim
- **Includes:** TPR handheld, DB25 wireless adapter, carry case, registration card, user manual for TPR, and Genisys interface, activation magnet, valve stem torque wrench, valve nut torque wrench, digital tire pressure gauge, TPMS Poster, TPMS flip charts, 11mm socket, 12mm socket, and torque tool

Ascot No.	Mfg. No.	Description
469-03835	OTC-3835	Tire Pressure Monitoring System Reset Tool Master Kit



SENSOR ACTIVATION TOOLS (CONT.)

C. TPR Tool with EZ-Sensor™ Programming

- Fast, simple programming using OTC TPR Tool
- Eliminates the need to perform relearn procedures when replacing sensors
- No scan tool required for programming
- EZ-Sensor replaces over 90% of current TPMS sensors!
- Save money & fit the right part
- Fast, simple assembly to the wheel rim
- **Includes:** EZ-Sensor™ programming cradle, EZ-Sensor™ User Guide, Quick Start Guide, USB Cable, EZ-Sensor™ Application Chart, EZ-Sensor™ Training Video, Software Activation Certificate, Six months of updates at www.tpmsupdates.com

Ascot No.	Mfg. No.	Description
469-13834	OTC-3834EZ	TPR Tool with EZ-Sensor™ Programming



469-13834
TPR Tool with EZ-Sensor™ Programming

D. Genisys EVO® USA 2012 Kit with Tire Pressure Reset Tool

- **Includes:** Genisys EVO featuring the NEW System 5.0 with Code-Assist™ experienced-based Confirmed Fixes™ from Identifix®, NEW USA 2011 Domestic / Asian with ABS and European 2010 software including Pathfinder, Repair-Trac®, Fast fixes™ information, InfoTech Component Information software, Automated System Test™, OBD II Smart Cable, USA Domestic and ABS/Airbag OEM vehicle cables (for GM, Ford, Chrysler, Jeep, Saturn), manuals, and carrying case
- **Tire Pressure Reset tool kit includes:** TPR handheld, DB25 wireless adapter, registration card, user manual for TPR and Genisys interface
- **NOTE:** OEM cables may be required for certain vehicle system functions. Additional OEM cables are available individually or in convenient kits: Asian OEM Cable Kit 3421-94 and European OEM Cable Kit 3421-75.

Ascot No.	Mfg. No.	Description
351-03874	OTC-3874TPR	Genisys EVO® USA 2012 Kit with Tire Pressure Reset Tool



351-03874
Genisys EVO® USA 2012 Kit with Tire Pressure Reset Tool



C

D

SENSOR ACTIVATION TOOLS (CONT.)

A. Ateq VT55 OBDII TPMS Tool Kit

- Decodes and displays TPM sensor DATA (ID, Pressure, TPM Battery Status, Temperature, G-Force)
- Relearn procedures build on board
- Part number lookup
- Compatible with all OEM, Universal and programmable sensors
- Key fob tester
- RF detection
- Toyota, Scion, Lexus ECU unlock
- Updatable (Through PC / SD Card)
- Multilingual
- DTC retriever
- Audit report
- Kit includes the following:** VT55 diagnostic tool, OBDII module, RJ45 cable, USB cable UPDATE/Print, carrying pouch, relearn magnet, wall charger, user guide, software CD

Ascot No.	Mfg. No.	Description
469-05501	VT55OBDII	Ateq VT55 OBDII TPMS Tool Kit

B. Ateq VT56 OBDII TPMS Tool Kit

- Full color 4" screen
- Icon driven intuitive learning
- Part number lookup
- OBD II for ECU reset
- Dated history file
- Programs for all popular programmable sensors
- OBD II position
- Key fob tester
- RF signal tester
- Help screens
- WIFI connection to PC
- WIFI updates
- Bluetooth connection for printing
- Barcode scanner for vehicle identification
- Docking cradle with thermal printer
- Update via USB, WIFI & SD card
- TPMS DTC retriever
- US/European/Asian vehicles
- Full relearn procedures
- Kit includes the following:** VT56 diagnostic tool, OBDII interface connector, docking station with thermal printer (optional), OBDII to VT56 ethernet cable, USB PC cable, power adapter, Update software, Quickstart user manual, Ateq hard kit carry case

Ascot No.	Mfg. No.	Description
469-05601	VT56OBDII	Ateq VT56 OBDII TPMS Tool Kit

C. TPMS Transmitter Check Box

- Identify a difference between gauge and your vehicle dash reading
- Helps eliminate possible transmitter defects or failures before mounting and inflating transmitter on wheel
- Portable and easy to use
- An ideal device to ensure quality service
- Designed for use with all styles of direct TPMS transmitters
- Equipped with a regulator and gauge to ensure proper functionality

Ascot No.	Mfg. No.	Description
469-03200	OCB	TPMS Transmitter Check Box

A



469-05501
Ateq VT55 OBDII TPMS Tool Kit

B



469-05601
Ateq VT56 OBDII TPMS Tool Kit

C



469-03200
TPMS
Transmitter
Check Box

UNIVERSAL TPMS TRANSMITTERS: EZ-SENSORS



A. EZ-Sensor Programmable TPMS Sensors

- Designed to eliminate multiple sensors required for TPMS work
- **Applications:** Covers most GM, Chrysler, Honda, Nissan, Toyota, Lexus, Scion, Ford, Lincoln, & Mercury vehicles and some Mitsubishi, Subaru & Suzuki vehicles
- Fully programmable
- 33200 EZ-Sensor features Wireless Auto Locate or WAL that allows the vehicle's TPMS system to locate and identify each TPMS sensor's specific location
- *Compatible with Bartec, Schrader and SPX/OTC programming tools*
- *Replacement aluminum valve stem*

Ascot No.	Mfg. No.	Description
461-33000	33000	EZ-Sensor 315 MHz Programmable TPMS Sensor
461-33200	33200	EZ-Sensor 433 MHz Programmable TPMS Sensor w/ Wireless Auto Locate Feature

B. EZ-Sensor Replacement Aluminum Valve Stem

- Use Schrader Service Pack 20014

Ascot No.	Mfg. No.	Description
469-34000	34000	Replacement Aluminum Valve Stem

C. Replacement Snap-In Valve for Schrader Snap-In Transmitters

- Rubber stem & attaching screw for Schrader snap-in transmitters
- Cap & core included
- Requires T-10 Torx Tool for assembly/disassembly

Ascot No.	Mfg. No.	Description	Qty./Box
469-20018	20018	Replacement Snap-In Valve for Schrader 20153 Transmitter	50

D. EZ Tire TPMS Sensor Kit

- 2 part numbers (315 MHz to start) covering nearly 90% of the market – just like EZ-sensor™
- Schrader patented technology offers a truly programmable solution
- **Performs identically to the original OEM-equivalent sensor**
- Comes “blank” and is fully programmable to the selected Make/Model/Year
- Re-programmable multiple times
- A fast and efficient EZ-install reduces cost of servicing TPMS-equipped vehicles
- Fully programmable using many existing scan/programming tools
- **The EZ-tire kit contains:** 4 overmolded sensor units, 4 rubber housing mounts, 4 two-piece mounting tools, 1 container of adhesive (5g), 1 installation guide



461-55315
EZ Tire TPMS
Sensor Kit

Ascot No.	Mfg. No.	Description
461-55315	550315	315 MHz EZ Tire TPMS Sensor Kit

EZ-SENSOR PROGRAMMABLE TPMS SENSORS



NEW ITEM!



469-34000
Replacement
Aluminum
Valve Stem



469-20018
Replacement
Snap-In Valve for
Schrader 20153
Transmitter



A

B

C

REDI-Sensor™

UNIVERSAL TPMS TRANSMITTERS: REDI-SENSORS



461-07011
REDI-Sensor Universal
Transmitter, Snap-In Style



461-07001; 461-07004
REDI-Sensor Universal
Transmitter, Clamp-In Style



461-07003
315MHz REDI-Sensor
Universal Transmitter
(Clamp-In Style)



A small sampling of existing major TPMS scan tools that are compatible with the REDI-Sensor Universal Transmitter.

A. REDI-Sensor Universal Transmitter

- Installs right out of the box
- No programming required, saving you 8-10 minutes per vehicle
- Reduces replacement sensor inventory
- Adjustable valve stem design
- Fits over 90% of the market**
- No additional training required
- All REDI-Sensors are available in a rubber stem format

Ascot No.	Mfg. No.	Description
461-07001	7001HP	315MHz REDI-Sensor Universal Transmitter (Clamp-In Style)
461-07002	7002	REDI-Sensor for Honda, Hyundai, Kia, Lexus, Toyota & Scion
461-07004	7004	433MHz REDI-Sensor Universal Transmitter (Clamp-In Style)
461-07011	7001HP-R	315MHz REDI-Sensor Universal Transmitter (Snap-In Style)

B. 315MHz REDI-Sensor Universal Transmitter (Clamp-In Style)

- Installs right out of the box
- No additional training required
- Adjustable valve stem design
- Fits Volkswagen, Mercedes-Benz, Audi, Lexus, Volvo, Toyota, Nissan, Infiniti, Chevrolet, GMC, Hummer, Isuzu, and Subaru

Ascot No.	Mfg. No.	Description
461-07003	7003	315MHz REDI-Sensor Universal Transmitter (Clamp-In Style)

NEW ITEM!

WORKS WITH EXISTING MAJOR TPMS SCAN TOOLS:

If a shop has the tools to handle OE sensors, it's ready for REDI-Sensor. Unlike other sensors that require the purchase of specialized tools and software upgrades, no additional purchases, training or investments are needed with REDI-Sensor.


It works with all major TPMS scan tools, including ATEQ, Bartec, OTC and T.I.P.S. With REDI-Sensor, technicians can use the OE scan tool procedures for TPMS service - no new service routines are required.

FASTER HUNT MODE:

REDI-Sensor saves valuable time during the vehicle relearn process, when using trigger tools that incorporate a hunt mode. REDI-Sensor uses an "intelligent design" to wake faster and deliver positive results sooner. This prevents the relearn process from timing out, which eliminates the need to redo the procedure.

BUILT TO DELIVER LONG-LIFE RELIABILITY:

Waterproof design resists tire air moisture

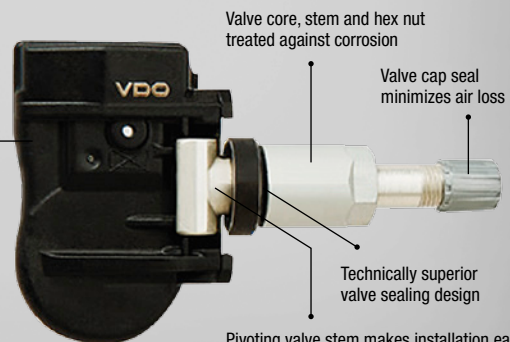

UNIVERSAL TPMS TRANSMITTERS: REDI-SENSOR ACCESSORIES

REDI-Sensor™

A. REDI-Sensor Valve Stems

Ascot No.	Mfg. No.	Description	Qty./Box
469-00770	VS-70	REDI-Sensor Replacement Valve Stem w/ All Components	20
469-00771	VS-70B	REDI-Sensor Valve with Black Anodized Nut and Black Cap	20
469-00772	VS-70S	REDI-Sensor Valve Stem with Cap and Core Assembled	20

B. Dill Aluminum Replacement TPMS Stems

- Metal Replacement Clamp-In Valve for GM, Ford, Dodge Ram, Subaru & Suzuki
- Made from anodized aluminum
- T-10 screw included
- Packaged 20 per box

Ascot No.	Mfg. No.	Description
469-00925	VS-925A	Dill Aluminum Replacement TPMS Stem
469-01925	VS-925B	Dill Aluminum Replacement TPMS Stem (Black)
469-02925	VS-925C	Dill Aluminum Replacement TPMS Stem (Chrome Plated)

C. Rubber TPMS Snap-In Replacement Valves

- Rubber stem & attaching screw for snap-in transmitter
- Cap & core included
- Requires T-10 Torx Tool for assembly/disassembly

Ascot No.	Mfg. No.	Description	Qty./Box
469-00090	VS-90	Rubber Valve Stem Kit for New Dodge and GM Transmitters	25
469-00950	VS-950	Rubber Snap-In Replacement Valve for GM & Ford Transmitters	25
469-00065	VS-65	Rubber Snap-In Stem for Dodge Jeep w/ Square Brass End	25
469-01010	VS-1010	Rubber Snap-In Stem for Hyundai Santa Fe	25
469-09305	VS-930	Dill Rubber Snap-In Replacement Valve for GM Transmitters	25

D. Replacement Rubber Valve & Screw for 7001HP-R REDI-Sensor

Ascot No.	Mfg. No.	Description	Qty./Box
469-00080	VS-80	Repl. Rubber Valve & Screw for 7001HP-R REDI-Sensor	25

E. TPMS Kit for REDI-Sensor

Ascot No.	Mfg. No.	Description
469-07000	7000K	TPMS Kit for REDI-Sensor
469-07020	7020K	TPMS Replacement Component Kit for REDI-Sensor




REDI-SENSOR VALVE STEMS



DILL ALUMINUM REPLACEMENT TPMS STEMS



RUBBER TPMS SNAP-IN REPLACEMENT VALVES

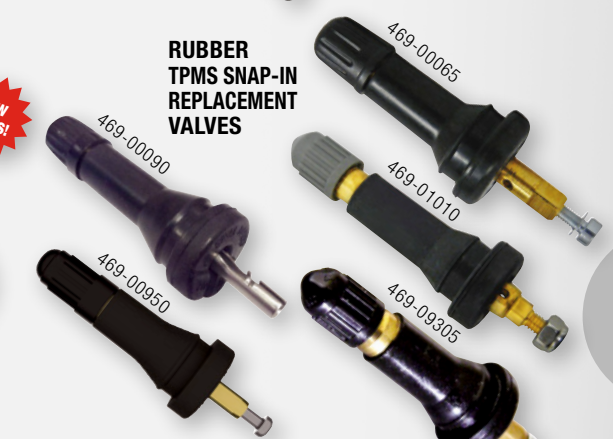

469-00080 Replacement Rubber Valve & Screw for 7001HP-R REDI-Sensor

A

B

C

D

NEW ITEMS!

NEW ITEMS!

NEW ITEM!

NEW ITEM!



SCHRADER TPMS TRANSMITTERS

Schrader TPMS Transmitters

- Includes: Transmitter, grommet, nut, cap & core



461-20064
Nissan Replacement
Transmitter



461-20099
Dodge Sprinter Van 2007-2009
Replacement Transmitter



461-20335
Chrysler Siemens
Replacement Transmitter

Ascot No.	Mfg. No.	O.E. No.	Description
461-20028	20028	5208-8990AC	Chrysler Repl. Transmitter
461-20034	20034	MN103081	Mitsubishi Repl. Transmitter
461-20064	20064	40700-CD001	Nissan Repl. Transmitter
461-20069	20069	40700-CK002	Nissan Repl. Transmitter For Vehicles With Steel Wheels
461-20076	20076	25758220	GM 2006 Cadillac & Corvette Repl. Transmitter
461-20077	20077	4D0907275C	Audi, Bentley, Ferrari, MB, Porsche & VW Repl. Transmitter
461-20078	20078	4F0907275B	Audi, Bentley, Porsche & VW Repl. Transmitter
461-20079	20079	4D0907275A	Audi, BMW, MB Porsche & VW Repl. Transmitter
461-20080	20080	36118378682	BMW Repl. Transmitter
461-20081	20081	28103-AG00A	Subaru Repl. Transmitter
461-20082	20082	96484045	Daewoo Repl. Transmitter
461-20083	20083	36236781847	BMW, Mini, Porsche & Rolls Royce Repl. Transmitter
461-20084	20084	224551	Ferrari, Porsche & VW Repl. Transmitter
461-20085	20085	52933-4D200	Hyundai/Kia Repl. Transmitter
461-20086	20086	52933-2G200	Hyundai/Kia Repl. Transmitter
461-20087	20087	4313054J20	Suzuki Repl. Transmitter
461-20088	20088	1K0907253D & E	Audi & VW Repl. Transmitter
461-20089	20089	68038945AA	Dodge Sprinter Van 2007-2009 Repl. Transmitter
461-20090	20090	XR855950 & C2C25519	Jaguar & Land Rover Repl. Transmitter
461-20091	20091	LR018860	Jaguar & Land Rover Repl. Transmitter
461-20092	20092	529332M000	Kia Repl. Transmitter
461-20093	20093	GN3A-37-140B	Mazda Repl. Transmitter
461-20094	20094	25407917	Mercedes Repl. Transmitter
461-20095	20095	25408017	Mercedes Repl. Transmitter
461-20096	20096	4L2T-1A150-BA	Ford Small Truck Repl. Transmitter
461-20097	20097	31280297	Volvo Repl. Transmitter
461-20098	20098	42753-STK-A04	Acura, Honda Repl. Transmitter
461-20099	20099	42752SWA306	Honda Repl. Transmitter
461-20100	20100	42753-TP6-A82	Honda 2010 Crosstour Repl. Transmitter
461-20103	20103	4F0-907-275D	Beru Repl. Transmitter Only
461-20107	20107	15114379	GM Large Truck Repl. Transmitter
461-20115	20115	15136883	GM 2004 Large SUV Repl. Transmitter
461-20116	20116	25774005	GM Small Truck Repl. Transmitter
461-20117	20117	25773946	GM Cadillac & Corvette Repl. Transmitter
461-20131	20131	15122618	Hummer Repl. Transmitter
461-20135	20135	5L1Z-1A150-AA	Ford Large Truck Repl. Transmitter
461-20153	20153	70503153	GM Snap-In Type Repl. Transmitter - Complete Unit
461-20156	20156	8651700	Volvo Repl. Transmitter
461-20158	20158	15268606, 10394110	GM 2006 Repl. Transmitter
461-20159	20159	13227143	Saab Repl. Transmitter
461-20161	20161	40700-CK-001	Nissan Repl. Transmitter For Vehicles With Alloy Wheels
461-20315	20315	9L3Z1189A	Ford 09/10 Snap-In Style Repl. Transmitter Complete Unit
461-20335	20335	04727392AD, 5127-335AB, 5127-335AD, SE57243	Chrysler Siemens Repl. Transmitter
461-20398	20398	56029398AB	Chrysler/Jeep Repl. Transmitter
461-20720	20720	42756TK4 A01	Acura Repl. Transmitter
461-28004	28004	04815132AB	Chrysler Prowler Repl. Transmitter

Schrader TPMS Transmitters continue on the next page ➔



SCHRADER TPMS TRANSMITTERS (CONT.)

Ascot No.	Mfg. No.	O.E. No.	Description
461-28006	28006	10438853	97-00 Corvette Repl. Transmitter
461-28078	28078	24437708	Saab Repl. Transmitter
461-28081	28081	36106790054	BMW Repl. Transmitter
461-28082	28082	36146752128	BMW, Land Rover Repl. Transmitter
461-28087	28087	99760602120	Porsche Repl. Transmitter
461-28096	28096	4250A225	Mitsubishi Repl. Transmitter
461-28129	28129	4250A030	Mitsubishi Repl. Transmitter
461-28167	28167	40700JA01A	Nissan Repl. Transmitter O.E. 40700-JA01A
461-28203	28203	28103AG01A	Subaru Snap-In Repl. Transmitter OE 28103AG01A
461-28204	28204	40700JA01B	Nissan Repl. Transmitter O.E. 40700-JA01B
461-28206	28206	20922900	GM/Chevy Repl. Transmitter
461-28210	28210	40700JK00B	Nissan/Infiniti Repl. Transmitter
461-28214	28214	45421518	Mercedes Gen Alpha WALA Repl. Transmitter
461-28291	28291	56029400AB	Chrysler Repl. Transmitter
461-28300	28300	426070C010	Toyota Repl. Transmitter
461-28305	28305	426070C020	Toyota Repl. Transmitter
461-28308	28308	56053036AA	Chrysler Snap-In Repl. Transmitter
461-28310	28310	4260724010	Lexus Repl. Transmitter
461-28315	28315	4260724020	Lexus Repl. Transmitter
461-28320	28320	4260724030	Lexus Repl. Transmitter
461-28325	28325	426724040	Lexus Repl. Transmitter
461-28335	28335	426724040	Lexus & Toyota Repl. Transmitter
461-28342	28342	40700 1PA0A	Nissan Repl. Transmitter
461-28345	28345	4260735010	Lexus & Toyota Repl. Transmitter
461-28355	28355	42607AD020	Toyota Repl. Transmitter
461-28360	28360	4260706011	Toyota Repl. Transmitter
461-28362	28362	31200923	Vovlo Repl. Transmitter
461-28365	28365	4260733011	Lexus, Scion, Toyota Repl. Transmitter
461-28370	28370	4260733021	Lexus & Toyota Repl. Transmitter
461-28380	28380	42607AD010	Toyota Repl. Transmitter
461-28385	28385	6F2Z1A189A	Ford Banded Repl. Transmitter
461-28390	28390	7L1Z1A189A	High-Pressure Ford Banded Repl. Transmitter
461-28395	28395	8C2Z1A189A	Ford Banded Repl. Transmitter
461-28423	28423	20964159	Camaro ZL1 Repl. Transmitter
461-28434	28434	56029319AC	Chrysler Snap-In Repl. Transmitter
461-28461	28461	56029319AC, 68137699AA	Chrysler Snap-In Repl. Transmitter
461-28505	28505	52933-2V000	Hyundai Snap-In Repl. Transmitter
461-28586	28586	68193586AA	Dodge Snap-In Repl. Transmitter
461-28670	28670	426070C050	Toyota Repl. Transmitter
461-28720	28720	42753SNAA83	Honda Acura Repl. Transmitter
461-28849	28849	529332F000	Hyundai Kia Repl. Transmitter
461-28981	28981	56029398AB	Acura, Honda Repl. Transmitter
461-28982	28982	06421-S9V-A01	Honda Repl. Transmitter
461-28983	28983	958104D100	Hyundai Repl. Transmitter

**NEW
ITEMS!**

**NEW
ITEM!**



461-20398
Chrysler/Jeep
Replacement Transmitter



461-28081
BMW Replacement
Transmitter



461-28308
Chrysler Snap-In
Replacement Transmitter



DILL TPMS TRANSMITTERS

A. Dill TPMS Transmitters

- Includes: Transmitter, grommet, nut, cap & core

461-01048
Lear Ford
Banded
Transmitter



461-11048
High Pressure
Ford Banded
Transmitter



461-01051
Siemens Chrysler
Replacement
Transmitter



461-01057
Entire Acura/Honda
Replacement Transmitter



Ascot No.	Mfg. No.	O.E. No.	Description
461-01027	1027	36236779490	Lear BMW Repl. Transmitter
461-01028	1028	529334D200	Lear Hyundai/Kia Repl. Transmitter
461-01029	1029	529332F000	Entire Kia Spectra/Rio Repl. Transmitter
461-01041	1041	Check VIN	Volkswagen Repl. Transmitter w/ O-Ring Nut
461-01042	1042	68006771AA	Dodge Sprinter Repl. Transmitter
461-01043	1043	68001698AA	Siemens 2008 Chrysler Repl. Transmitter
461-01044	1044	30666931, 6G92-1A159-BB	2007-2008 Volvo Repl. Transmitter
461-01045	1045	LR032833	2008-2011 Land Rover Replacement Transmitter - 315 MHz
461-01046	1046	Check VIN	Siemens Land Rover/Jaguar Repl. Transmitter - 433 MHz
461-01047	1047	10394110	Siemens 2007-2008 Clamp-In Repl. Transmitter
461-01048	1048	6F221Z189A	Lear Ford Banded Repl. Transmitter
461-01049	1049	Check VIN	Siemens Mercedes Repl. Transmitter - 433 MHz
461-01051	1051	4250A225	Siemens Chrysler Repl. Transmitter
461-01052	1052	Check VIN	Siemens 2004 Chrysler Repl. Transmitter
461-01053	1053	Check VIN	Siemens Volkswagen Repl. Transmitter
461-01054	1054	Check VIN	Siemens Mercedes Repl. Transmitter
461-01055	1055	Check VIN	Siemens Land Rover/Jaguar Repl. Transmitter
461-01056	1056	GN3A-37-140B	Siemens Mazda Repl. Transmitter
461-01057	1057	06421-S3V-A02	Entire Acura/Honda Repl. Transmitter
461-01058	1058	0642SCVA00	Entire Hyundai/Kia Repl. Transmitter
461-01059	1059	06421S9VA01	Entire Honda Repl. Transmitter
461-01068	1068	59233-2G200	Hyundai/Kia Repl. Transmitter
461-01203	1203	42607-0C010/AD010	Toyota Repl. Transmitter
461-01204	1204A	42607-33021	Aftermarket Pacific/Toyota Repl. Transmitter
461-01205	1205	42607-35010	Toyota Older 4Runner, Lexus GX-470 Repl. Transmitter
461-01207	1207	42607-0C040/0C060	Toyota Replacement Transmitter
461-01208	1208	42753-SWA-316	Honda Accord/CRV/Fit Repl. Transmitter
461-01209	1209	42753-STK-A04	Honda Pilot/Some Acura Repl. Transmitter
461-01212	1212	42753-SNA-A83	Honda Civic Repl. Transmitter
461-01214	1214	42753-TK4-A01	Honda/Acura Repl. Transmitter
461-01216	1216	40700-1LA0A, 40700-1LA0B, 40700-1LA0C	Nissan Repl. Transmitter
461-01217	1217-WH	42607-24010	Lexus SC 430 White Replacement Transmitter
461-01218	1218	42607-06020	2012 Toyota Camry, Yari Replacement Transmitter
461-01219	1219	42753-SZA-A12	2009-2012 Honda Pilot w/ Steel Wheels Replacement Transmitter
461-02112	2112	6004985	Tesla Replacement Transmitter
461-05507	5507	52933-2M000, 52933-2L500, 52933-2L700	Hyundai/Kia Repl. Transmitter
461-05511	5511	42753-TP6-A82, 42753-TP6-A82-M1	Honda/Acura Repl. Transmitter
461-05512	5512	42753-TX4-A51	2013 Acura RDX Replacement Transmitter
461-05513	5513	42753-TX6-A81	2013 Acura ILX Replacement Transmitter
461-05555	5555	4070-3AN0A	Nissan Replacement Transmitter
461-05556	5556	40700-3JA0A	2013 Nissan Altima/Pathfinder Replacement Transmitter
461-05557	5557	40700-3AN1A	Nissan Replacement Transmitter
461-05775	5775	68193586AA	2013 Dodge Dart/Cadillac ATS Replacement Transmitter

**NEW
ITEM!**



DILL TPMS TRANSMITTERS (CONT.)

3 NEW ITEMS!

Ascot No.	Mfg. No.	O.E. No.	Description
461-06815	6815	68157568AB	2014 Dodge Ram/Jeep Grand Cherokee Replacement Transmitter
461-06825	6825	68239725AA	Snap-In Rubber Stem and Sensor for Inner Dual on Dodge Ram
461-06829	6829	68239729AA	Clamp-In Stem and Sensor for Outer Alloy on Dodge Ram
461-08004	8004	4815132AB, 4815132	Chrysler/Dodge/Jeep Repl. Transmitter
461-08006	8006	10438853	1997-2000 Corvette Repl. Transmitter
461-09001	9001	A0008223306	HUF RDE 003 Repl. Transmitter for Audi/Mercedes - 433MHz
461-09002	9002	36118378682	HUF RDE 002 Repl. Transmitter for BMW 3/5/7 Series - 433 MHz
461-09003	9003	36146752128	HUF RDE 003 Repl. Transmitter for BMW X5/Land Rover - 433MHz
461-09004	9004	A0008223406	HUF RDE 004 Repl. Transmitter for Mercedes
461-09005	9005	7L0907275	HUF RDE 005 Cayenne/Touareg Replacement Transmitter - 433 MHz
461-09007	9007	4F0907275	HUF RDE 007 Repl. Transmitter for Audi A6 - 433 MHz
461-09008	9008	997 606 021 20	Porsche 911 Repl. Transmitter
461-09010	9010	N/A	Prevost/Volvo/Nova Bus & ITEC Truck Replacement Transmitter
461-09011	9011	4F0907275D	2010 Audi Repl. Transmitter
461-09012	9012	3610679 054	2010 BMW, Mini Cooper Repl. Transmitter
461-09013	9013	3AA 907 275-B	2013 Volkswagen CC Replacement Transmitter
461-09017	9017	36 10 6 798 872	2013 BMW 3-Series Replacement Transmitter
461-09204	9204	40700-1AA0D	Nissan Replacement Transmitter
461-09315	9315-625	9L3Z-1A-189A	Ford Replacement Transmitter w/ VS-919 Stem
461-09398	9398	56029398AB	Chrysler Snap-In Replacement Transmitter
461-09481	9481	56029481AB	2012 Jeep Liberty, Wrangler Replacement Transmitter
461-09505	9505	52933-2V000	Hyundai Velostar, Azera Replacement Transmitter
461-11048	1048-HP	8C2Z1A189A	Lear High Pressure Ford Banded Repl. Transmitter
461-11204	1204	42607-33021	Toyota/Lexus Replacement Transmitter
461-11206	1206A	42607-0C050	Aftermarket Pacific/Toyota Repl. Transmitter
461-11217	1217-BL	42607-24020	Lexus SC 430 Blue Replacement Transmitter
461-21217	1217-RD	42607-24030	Lexus SC 430 Red Replacement Transmitter
461-31217	1217-YL	42607-24040	Lexus SC 430 Yellow Replacement Transmitter



461-01204
Aftermarket Pacific/Toyota Replacement Transmitter



461-06815
2014 Dodge Ram/Jeep Grand Cherokee Replacement Transmitter



461-09011
2010 Audi Replacement Transmitter

B. HUF Tire Pressure Monitoring System (TPMS) Transmitters

- Valve insert & transmitter sold separately
- Two-piece design to adapt to rim configurations
- For use with most European vehicles equipped with TPMS. Call for application information.



Ascot No.	Mfg. No.	Description
461-10001	RDE001	Audi, MB Replacement Transmitter
461-10002	RDE002	BMW Replacement Transmitter
461-10003	RDE003	Land Rover Replacement Transmitter

Ascot No.	Mfg. No.	Description
461-10005	RDE005	Select Porsche & VW Transmitter
461-10007	RDE007	Audi A4 Replacement Transmitter

B



SMART SENSOR PRO+



469-17144
Smart Sensor Pro+
Programming/
Scanning Tool

REPLACEMENT SENSORS & STEMS FOR THE SMART SENSOR PRO+



461-17431

469-17438

461-17432

469-17439

461-17433

469-17436

461-17434

A. Smart Sensor Pro+ Programming/Scanning Tool

- Quickly & easily program Smart Sensor “blank” sensors to emulate the protocol
- Program a Smart Sensor in seconds
- Copies the original sensor ID to Smart Sensor
- Recognized by specific vehicles
- Scans OE sensors
- Upgradeable!
- *Replacement sensors and stems available*



The Smart Sensor Pro+ Programming/Scanning Tool with Replacement Sensors* (available separately).

Ascot No.	Mfg. No.	Description
469-17144	17-144	Smart Sensor Pro+ Programming/Scanning Tool

B. Replacement Sensors and Replacement Stems for the Smart Sensor Pro+

- 315 MHz (green) and 433 MHz (brown) are available
- 90% market coverage with 2 sensors
- Easy to use

Ascot No.	Mfg. No.	Description
461-17431	17-43011	315 MHz Smart Sensor Snap-In (Green)
461-17432	17-43012	433 MHz Smart Sensor Snap-In (Brown)
461-17433	17-43013	315 MHz Replacement Sensor (Green)
461-17434	17-43014	433 MHz Replacement Sensor (Brown)
469-17436	17-43016	Replacement Smart Sensor Rubber Stem Snap-In Valve
469-17438	17-43018	Black Replacement Stem
469-17439	17-43019	Aluminum Replacement Stem

A

B



MULTI-APPLICATION TPMS SENSORS

A. Multipro Multi-Protocol TPMS Sensors

- **Out of the box solution:** Pre-programmed, ready to use (just like an OE sensor)
- **Both snap-in and clamp-in valve options:** Valve stems are interchangeable
- Can be triggered, read and relearned with all major TPMS scan tools
- Patented technology
- Validated to meet OE standards

Ascot No.	Mfg. No.	Description
461-17451	17-45001	315 MHz GM Snap-In Multipro-1 Sensor
461-17452	17-45002	315 MHz Ford Snap-In Multipro-2 Sensor
461-17463	17-45003	433 MHz Ford Snap-In Multipro-3 Sensor
461-17454	17-45004	315 MHz Toyota/Nissan Clamp-In Multipro-4 Sensor

Ascot No.	Mfg. No.	Description
461-17455	17-45005	315 MHz Honda Clamp-In Multipro-5 Sensor
461-17456	17-45006	315 MHz Hyundai/Kia Clamp-In Multipro-6 Sensor
469-17498	17-45098	Replacement Snap-In Valve for Multipro Sensor
469-17499	17-45099	Replacement Clamp-In Valve for Multipro Sensor
469-17224	17-20204AK	Replacement Parts Kit for Multipro Sensor



461-17451
315MHz GM Snap-In
Multipro-1 Sensor



461-17454
315MHz Toyota/
Nissan Clamp-In
Multipro-4 Sensor



469-17498
Replacement
Snap-In Valve for
Multipro Sensor



469-17499
Replacement
Clamp-In Valve for
Multipro Sensor

A



TOOLS, ACCESSORIES & KITS

A

SCHRADER TPMS ACCESSORY KITS

469-20020
Replacement
Stem for Chrysler,
Dodge & Jeep
Replacement
Transmitters



A. Schrader Accessory Kits

- The OEM requires that the four sealing components be replaced when re-installing a TPMS sensor. The replacement components are supplied in TPMS accessory kits, which are sensor specific.
- **Each TPMS accessory kit contains:** 1 Nut, 1 Valve Core, 1 Cap, 1 Grommet

B

469-20097
Small Assortment Kit



Ascot No.	Mfg. No.	Description
469-20002	20002	Accessory Kit For Ford Transmitters (Replaces 469-29601 & 469-23501)
469-20003	20003	Accessory Kit For Chrysler Transmitters (Replaces 469-21701 & 469-22801)
469-20004	20004	Accessory Kit For GM Transmitters (Replaces 469-20701 & 469-21601)
469-20005	20005	Accessory Kit For Steel Wheel Nissan Transmitters
469-20006	20006	Accessory Kit For Hummer Transmitters
469-20007	20007	Accessory Kit For Alloy Wheel Nissan Transmitters
469-20009	20009	Accessory Kit for Suzuki Replacement Transmitter
469-20010	20010	Accessory Kit for Prowler Replacement Transmitter
469-20011	20011	Accessory Kit for Subaru Replacement Transmitter
469-20012	20012	Accessory Kit for Corvette Replacement Transmitter
469-20013	20013	Accessory Kit for Dodge Nitro Transmitters
469-20014	20014	Accessory Kit for Nissan Transmitters
469-20015	20015	Accessory Kit for GM/TRW Transmitters
469-20016	20016	Accessory Kit for Mercedes Transmitters
469-20017	20017	Accessory Kit for Volkswagen/Siemens Transmitters
469-20018	20018	Replacement Snap-In Valve, Box of 50
469-20019	20019	Accessory Kit for Honda/Acura Transmitters
469-20020	20020	TPMS Service Pack - Stem Only - Chrysler, Dodge, Jeep
469-20021	20021	Accessory Kit for TRW Transmitters - No Valve
469-20022	20022	Accessory Kit for Hyundai/Kia Transmitters
469-20023	20023	Accessory Kit for Beru Stems - No Valve
469-20030	20030	Accessory Kit for Chrysler/Siemens Transmitters
469-20031	20031	Accessory Kit for Pacific Transmitters
469-20032	20032	Accessory Kit for Toyota/Pacific Transmitters
469-20035	20035	Accessory Kit for TRW Long Valve Transmitters
469-20036	20036	Accessory Kit for TRW Short Valve Transmitters
469-20043	20043	Continental Rubber Snap-In Valve
469-22008	22008	Assembled Chrome Replacement Snap-In Valve for Schrader 20153 Transmitter

B. Schrader Accessory Kit Assortments

- Contains all the parts you will need when servicing tires and wheels that are equipped with Schrader Original Equipment pressure monitoring transmitter valves. All components are individually packaged for easy identification by vehicle application and are stored in a handy plastic box.

469-20597
Master Accessory
Kit Assortment



Ascot No.	Mfg. No.	Description
469-20097	20097	Small Assortment Kit. Includes: 30 Bags (5 ea) Accessory Kits for Each Transmitter Size, 25 Plastic Valve Caps and Core Tool
469-20597	20597	TPMS Master Accessory Kit Assortment. Includes: 8 each of Accessory Kits 20002-20007, 20030-20031, 4 each of Accessory Kits 20035 & 20036, 100 Cores and 25 Plastic Caps
469-20598	20598	TPMS Service Pack Assortment. Includes: 8 each of service packs 20002, 20003, 20004, 20008, 20013, 20014, 20020, 20021, 20023, 20030, 20032 and 20036

TOOLS, ACCESSORIES & KITS (CONT.)

C. Dill TPMS Accessory Kits

Ascot No.	Mfg. No.	Description
469-00035	VS-35	Bent Aluminum Stem for Dodge Applications
469-00065	VS-65	Rubber Snap-In Stem for Dodge Jeep w/ Square Brass End
469-00919	VS-919	For use in light truck applications fitted with rims with a 0.625 diameter rim hole using the Ford, GM, and Chrysler snap in TPMS sensor design
469-00925	VS-925A	Aluminum Metal Replacement Valve for GM Snap-In
469-00950	VS-950	Rubber Snap-In Replacement Valve for GM & Ford Transmitters. Box of 25
469-01010	VS-1010	Rubber Snap-In Stem for Hyundai Santa Fe
469-01030	1030K	Siemens Kit for VW (Fits 1053 Sensor)
469-01031	1031K	VW Kit for Special Wheel Package
469-01040	1040K	Siemens Mercedes Assembled Valve
469-01050	1050K	Siemens Kit for Chrysler
469-01060	1060K	Compatible with Schrader 20001/20002/ 20135AK/20096AK
469-01070	1070K	Compatible with Schrader 20004/20116AK/ 20115AK/20107AK
469-01080	1080K	Compatible with Schrader 20003/20007/ 20117AK/20028AK
469-01077	1077K	Accessory Kit for 8006 Sensor, 97-00 Corvette
469-01090	1090K	Compatible with Beru Sensors
469-01096	1096	Entire Valve (Schrader 20036) for Hyundai, Kia, Honda
469-01097	1097	Entire Valve (Schrader 20035) for Hyundai, Kia, Honda
469-01098	1098K	Dodge Sprinter Replacement Valve
469-01100	1100K	Compatible with Pacific Sensors for Toyota/Lexus
469-01110	1110K	Compatible with Pacific Sensors for Toyota
469-01130	1130K	Compatible with Schrader 20005
469-01416	TP416	Replacement Stem for 1204A/1206A for Toyota
469-02040	2040K	Kit for Honda Civic
469-02045	2045K	Kit for Honda/Acura
469-04925	VS-925P-4	TPMS Plug for Wheels w/ Two Valve Holes
469-09251	VS-925C	Chrome Replacement Valve for GM Snap-In
469-09252	VS-925B	Black Nut/Black Cap Metal Replacement Valve for GM
469-09304	930-SC-4	4-Pack of Chrome Sleeves & Caps That Fit the TPMS Snap-In Valve
469-09305	VS-930	Rubber Snap-In Replacement Valve for GM Transmitters. Box of 25
469-11120	1120K	Compatible with Pacific Sensors for Lexus
469-20025	2000K	Compatible with Entire Sensors
469-20030	2030K	Compatible with Schrader Sensors for Chrysler, Dodge
469-21010	2010K	Compatible with Schrader Sensors for Volvo
469-21020	2020K	Early 2007 GM Kit for Entire Sensors
469-90662	9066-B	Replacement Ball Joint for 9066 Valve Stem

NEW ITEM!

NEW ITEM!

NEW ITEM!

NEW ITEM!

NEW ITEM!



DILL TPMS ACCESSORY KITS



C



TOOLS, ACCESSORIES & KITS (CONT.)



A 469-07100
Dill TPMS
Startup
Assortment



B 469-11215
Complete
Dill Universal
Sensor
Package



C 469-30000
Universal
Master TPMS
Transmitter
Hardware &
Tool Service Set



D 469-07300
Dill TPMS
Replacement
Stem
Assortment

A. Dill TPMS Startup Assortment

- **Contains:** 82 kits and 4 chrome sleeves
- **Tools included:** Torque Screwdriver, Fishing Tool and 4-way TPMS tool

Kit Number	Quantity	Kit Number	Quantity
1030K	4	2010K	4
1050K	6	2020K	4
1060K	6	2030K	4
1070K	6	2040K	4
1080K	6	VS-80	4
1090K	4	VS-950	6
1100K	6	1 Pack Valve Caps	20 per pack
1110K	6	1 Pack Valve Cores	20 per pack
1130K	6	Chrome Sleeves	4
2000K	6		

Ascot No.	Mfg. No.	Description
469-07100	7100	Dill TPMS Master Accessory Assortment

B. Complete Dill Universal Sensor Package

- **Includes:** 12 Universal Sensors, 128 Assorted Service Kits, TPMS Tool Kit (8100)

Ascot No.	Mfg. No.	Description
469-11215	1215	Complete Dill Universal Sensor Package

C. Universal Master TPMS Transmitter Hardware & Tool Service Set

- Versatile 152 piece assortment (15 unique kits)
- Covers over 55 different OEM sensor models and 90% of US vehicles
- **Tools included:** A Sensor Service Tool, Ratcheting Torque Wrench, 2 Deep Sockets, 2 Torque Drivers and bits

Ascot No.	Mfg. No.	Description
469-30000	30000	Universal Master TPMS Set

D. Dill TPMS Replacement Stem Assortment

- **Contains 2 each of the following replacement stems:** 1092, 1093, 1094, 1095, 1096, 1097, 1098 & VS-965
- **Contains 4 each of the following replacement stems:** 1040K, VS-950, VS-1010, 9066K, VS-925A, VS-925B, VS-925C, VS-70

Ascot No.	Mfg. No.	Description
469-07300	7300	Dill TPMS Replaceable Stem Assortment



TOOLS, ACCESSORIES & KITS (CONT.)

E. Complete Replacement Kit for Chrysler/Dodge TPMS Applications

- Complete Replacement Kit includes the following:
Aluminum TPMS Valve Stem w/ Grommet, Valve Nut, Valve Core

Ascot No.	Mfg. No.	Description
469-90660	9066-K	Dill Chrysler TPMS Complete Stem Replacement Kit



469-90660
Dill Chrysler TPMS Complete Stem Replacement Kit

F. Replacement Stem for Chrysler/Dodge TPMS Applications

Ascot No.	Mfg. No.	Description
469-90661	9066-1	Dill Chrysler TPMS Replacement Stem Only



469-90661
Dill Chrysler TPMS Replacement Stem Only

G. Schrader TPMS Valve Caps

Ascot No.	Mfg. No.	Description	Qty./Box
468-00050	20395	Plastic Valve Caps	100
468-20495	20495	Aluminum Valve Caps	100
468-20595	20595	Black TPMS Plastic Sealing Valve Caps for Snap-In Transmitters	100
468-20695	20695	Green TPMS Plastic Sealing Valve Caps for Snap-In Transmitters	100
468-59019	59-0019	Green Nitrogen Indicating Aluminum Valve Cap (100 per bag)	100
468-59021	59-0021	Chrome-Plated Brass Valve Caps	100
468-59023	59-0023	Universal Nitrogen Caps	100



VALVE CAPS

468-00050

468-20495

468-20595

468-59019

468-59021

H. Rubber TPMS Snap-In Replacement Valves

- Rubber stem and attaching screw for snap-in transmitters
- Cap & core included
- Requires T-10 Torx Tool for assembly/disassembly

Ascot No.	Mfg. No.	Description	Qty./Box
469-00950	VS-950	Rubber Snap-In Replacement Valve for GM & Ford Transmitters	25
469-20018	20018	Replacement Snap-in Valve for Schrader transmitters	50



469-20018
Replacement Snap-In Valve for Schrader Transmitters



TOOLS, ACCESSORIES & KITS (CONT.)

AFTERMARKET TPMS ACCESSORY KITS



A. Aftermarket TPMS Accessory Kits



469-17208
GM TPMS Rubber
Snap-in Valve



469-17210
TPMS Parts Kit for
Volvo Applications



469-17211
TPMS Parts Kit for
Subaru Applications

Ascot No.	Mfg. No.	Description
468-17490	17-490T	TPMS High Temp (Red) Valve Core Nickel Plated
468-17491	17-490TY	TPMS High Temp Valve Core, Nickel Plated, YELLOW Band
468-17492	17-492L-1	Long Skirted Black Plastic Cap with Seal for 17-20008
468-17493	17-493NP	Chrome Plated Plastic Cap, Green Top
468-17592	17-492T-1	Gray Plastic TPMS Valve Cap with Red Silicone Seal
468-17593	17-493P	Chrome Plated Plastic Cap
468-17692	17-492LG-1	Long Skirted GREEN Plastic Cap with Seal for 17-20008
469-17107	17-20107AK	TPMS Parts Kit for GM Applications
469-17198	17-20198AK	TPMS Parts Kit for Dodge Sprinter Applications
469-17205	17-20005AK	TPMS Parts Kit for Nissan Applications
469-17206	17-20006AK	TPMS Parts Kit for GMC, Hummer, Isuzu Applications
469-17207	17-20007AK	TPMS Parts Kit for Nissan, Infiniti Applications
469-17208	17-20008	GM TPMS Rubber Snap-In Valve
469-17209	17-20009AK	TPMS Parts Kit for Saab, Suzuki Applications
469-17210	17-20010AK	TPMS Parts Kit for Volvo Applications
469-17211	17-20011AK	TPMS Parts Kit for Subaru Applications
469-17212	17-20012AK	TPMS Parts Kit for Prowler, Corvette Applications
469-17213	17-20013AK	TPMS Parts Kit for Dodge, Jeep, Chrysler Applications
469-17214	17-20014AK	TPMS Parts Kit for Nissan, Infiniti Applications
469-17215	17-20015AK	TPMS Parts Kit for GM with TRW Clamp-In Sensor
469-17216	17-20016AK	TPMS Parts Kit for Mercedes, Smart Applications
469-17218	17-20018	TPMS Ford Rubber Snap-In Valve
469-17221	17-20201AK	TPMS Parts Kit for Chrysler, GM Applications
469-17222	17-20202AK	TPMS Parts Kit for Audi, Mercedes, Volkswagen Applications
469-17223	17-20203AK	TPMS Parts Kit for Audi, Mercedes Application
469-17224	17-20204AK	TPMS Parts Kit for Acura, Honda, Kia Applications
469-17226	17-20206AK	TPMS Parts Kit for Hyundai, Honda, Kia Applications
469-17227	17-20207AK	TPMS Parts Kit for Volkswagen Applications
469-17228	17-20028AK	TPMS Parts Kit for Chrysler, Dodge, Mitsubishi Applications
469-17235	17-20035AK	TPMS Parts Kit for Honda Applications
469-17236	17-20036AK	TPMS Parts Kit for Acura, Honda, Kia Applications
469-17272	17-20720AK	TPMS Parts Kit for Conti OE Sensors & Redi-Sensor
469-17296	17-20096AK	TPMS Parts Kit for Ford Applications
469-17311	17-20211AK	TPMS Parts Kit for Misc. Import Applications
469-17316	17-20216AK	TPMS Parts Kit for Lexus/Toyota Applications
469-17317	17-20217AK	TPMS Parts Kit for Lexus/Toyota Applications
469-17320	17-20020	TPMS Stem Only for Chrysler, Dodge, Mercedes
469-17321	17-20221AK	TPMS Parts Kit for Lexus SC430 Applications
469-17420	17-20020AK	TPMS Parts Kit + Stem for Chrysler, Dodge, Mercedes Applications
469-17539	17-50399	TPMS Snap-In Valve, Hyundai

A

TOOLS, ACCESSORIES & KITS (CONT.)

B. Schrader TPMS Valve Core

- Electroless Nickel-Plated valve core
- All valve caps packaged 100 per box

Ascot No.	Mfg. No.	Description
468-20055	20055	Schrader TPMS Valve Core

C. Beru TPMS Valve Inserts

- Original equipment valve insert for the Beru Tire Safety System
- *Each Insert comes complete with cap, core, grommet & grommet nut*
- Colored bottom to differentiate inserts
- **Applications:** Audi, Bentley, BMW, Ferrari, Land Rover, Maserati, Maybach, Mercedes-Benz, Porsche, Volkswagen
- *Requires TX-20EZ torx tool for assembly/disassembly*

Ascot No.	Mfg. No.	Description
461-59307	59.0342	Green Insert
461-59337	59.0340	Silver Insert
461-59357	59.0346	Orange Insert
461-59387	59.0344	Black Insert
469-15415	15535	Torx Screwdriver

D. Dill TPMS Valve Caps & Cores

- All valve caps and cores packaged 100 per box

Ascot No.	Mfg. No.	Description	Qty./Box
468-01001	100-TP	Electroless Nickel Plated Valve Core	100
468-06300	630N	Plastic TPMS Valve Cap	100
468-00635	635	Plastic Cap for VS-930 TPMS Snap-In Valve	100
468-00650	650	Small Plastic TPMS Valve Cap	100
468-00680	680	N2 Aluminum cap for TPMS	100
468-00690	690	N2 Plastic cap for TPMS	100

E. TPMS Torque Wrenches and Sockets

- Perfect for tightening grommet nut to manufacturer specifications
- Periodic calibration recommended

Ascot No.	Mfg. No.	Description
168-01501	1501MRMH	1/4" Drive 20-150 In./Lbs. Torque Wrench
167-12110	1211D	1/4" Drive x 11 mm x 12 mm Chrome Flip Socket
169-01002	1002E	1/4" Drive x 2" Chrome Extension
168-72100	72100	3/8" Drive, 20 - 200 In./Lbs. Torque Wrench
168-72120	72120	3/8" Drive, 25 - 250 In./Lbs. Torque Wrench
162-27211	27211	3/8" Drive x 11 mm Socket
162-27212	27212	3/8" Drive x 12mm Socket



468-20055
Electroless
Nickel Plated
Valve Cores



**BERU TPMS
VALVE INSERTS**



**DILL TPMS
VALVE CAPS
& CORES**

468-01001
Electroless
Nickel Plated
Valve Core

468-06300
Plastic TPMS
Valve Cap

468-00635
Plastic Cap for
VS-930 TPMS
Snap-In Valve

468-00650
Small Plastic
TPMS Valve Cap



**TPMS TORQUE
WRENCHES
& SOCKETS**

B

C

D

E

TOOLS, ACCESSORIES & KITS (CONT.)

A



469-00044
Valve Core
Torque Tool

A. Valve Core Torque Tool

- Preset torque guarantees correct setting every time on all cores
- Can be used to install and remove cores in standard valves
- Calibrated to 4 in./lbs. of torque
- Meets the Tire & Rim Association (TRA) specifications for installing valve cores on TPMS applications

Ascot No.	Mfg. No.	Description
469-00044	TPMS-4VC	Valve Core Torque Tool

B



469-20140
T-10 Torque Tool

T-10 TORQUE TOOLS

B. T-10 Torque Tools

- Installs replacement snap-in valve to Schrader snap-in transmitters
- Preset to 12 in./lbs.

Ascot No.	Mfg. No.	Description
469-20140	20140	T-10 Torque Tool
469-15415	15415	T-10 Torque Tool w/ Replaceable Tip
469-25415	15415-1	Replacement T-10 Tip

C



469-15415
T-10 Torque Tool
with ReplaceableTip

C. T-20 Torque Tool with Replaceable Tip

- Installs replacement Beru snap-in valves
- Preset to 35 in./lbs.



Ascot No.	Mfg. No.	Description
469-15535	15535	T-20 Torque Tool w/ Replaceable Tip
469-25535	15535-1	Replacement T-20 Tip


D



469-19860
Tire Deflator Set for
TPMS Valve Stems

D. Tire Deflator Set for TPMS Valve Stems

- Simply replace a standard sized valve cap with this handy tool and the special design will depress the pin in the valve core
- Large openings on the sides of the tool allow air to escape quickly from the tire
- Tools are marked so tires can be returned to their original position on the vehicle so TPMS will not need to be reset
- Also saves time since the valve core has not been removed from the sensor
- Set of 4

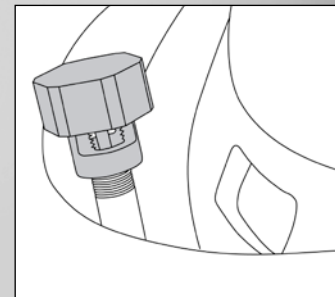


Ascot No.	Mfg. No.	Description
469-19860	19860	Tire Deflator Set for TPMS Valve Stems

TOOLS, ACCESSORIES & KITS (CONT.)

E. Tire Deflator/Valve Core Remover

- Screws on TPMS valve stems to deflate the tire without removing the valve core

Ascot No.	Mfg. No.	Description
469-00021	VT-21	Tire Deflator/Valve Core Remover

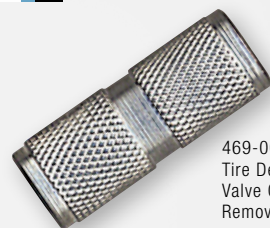

469-00021
Tire Deflator/
Valve Core
Remover

F. Valve Core Tools: Screwdriver Type & Standard Bore Long Valve

- Has a plastic screwdriver handle for better grip and leverage

Ascot No.	Mfg. No.	Description
469-00607	TL-615	Screwdriver Type Valve Core Tool
469-00612	TL-612	Standard Bore Long Valve Core Tool



469-00607
Screwdriver Type
Valve Core Tool

469-00612
Standard Bore
Long Valve
Core Tool

G. Electronic TPMS Torque Wrench

- **Range:** 12-120 in./lbs.
- **Accuracy:** ± 2%
- Green light for power on, red light and buzzer for reaching target signal, red flash for overload signal
- Torque set quickly with unique slide bar on the scale
- Rotate to 90° position to torque and leverage
- Indexing head allows for use straight (screwdriver position) to spin nut down quickly
- Torque limit LED flashes with audible beep
- Power switch with LED indicator
- Uses coin style batteries
- Approximately 8.5" long

Ascot No.	Mfg. No.	Description
168-38325	3833-25	Electronic TPMS Torque Wrench



168-38325
Electronic TPMS
Torque Wrench

H. Speed Torque Tools for TPMS

- Never adjust a TPMS torque wrench again
- Durable and long-lasting
- **No more torque errors:** It is either "Hi" or "Low"
- Ergonomically designed hand grip
- Open cross chamber on the 5565 allows for extra leverage bar



Ascot No.	Mfg. No.	Description
469-05540	5540	TPMS Speed Torque Wrench: Preset at 40 In./Lbs.
469-05565	5565	TPMS Speed Torque Wrench: Preset at 65 In./Lbs.



469-05540
TPMS Speed Torque
Wrench (Preset at
40 In./Lbs.)

469-05565
TPMS Speed Torque
Wrench (Preset at
65 In./Lbs.)

E

F

G

H

TOOLS, ACCESSORIES & KITS (CONT.)

A



469-04700
Grommet Removal Tool



A. Grommet Removal Tool

- Makes grommet and metal washer installation/removal easy and safe

Ascot No.	Mfg. No.	Description
469-04700	4700	Grommet Removal Tool

B



469-20144
Grommet
Installation/
Removal Tool

B. Grommet Installation/Removal Tool

Ascot No.	Mfg. No.	Description
469-20144	20144	Grommet Installation/Removal Tool

C



319-72521
1/4" Socket
Driver

C. 1/4" Socket Driver

- 6" Overall Length, 2-1/2" Shank Length
- Durable screwdriver handle and a chrome vanadium shank
- Ideal for use with the TPMS 11mm x 12mm flip sockets
- **MADE IN THE USA**

Ascot No.	Mfg. No.	Description
319-72521	7252100	1/4" Socket Driver

D



469-20250
Core /Cap
Removal Tool

D. Core/Cap Removal Tool

Ascot No.	Mfg. No.	Description
469-20250	20250	Core/Cap Removal Tool

E



469-08910
TPMS Valve System
Fishing Tool

E. TPMS Valve System Fishing Tool

- Secures TPMS sensor to wheel during demount
- One handle end can be used as a deflator; the other as a core remover
- 3" Overall length

Ascot No.	Mfg. No.	Description
469-08910	08910	TPMS Valve Fishing Tool

TOOLS, ACCESSORIES & KITS (CONT.)

F. Bartec Mechanical Tool Kit

- Valve Core Torque Driver
- T-10 Torque Driver
- T-20 Torque Driver
- 3-Way Fishing Tool
- Grommet Tool
- Torque Wrench
- TPMS Toyota Reset Tool

All fitted in a plastic case

Ascot No.	Mfg. No.	Description
469-10300	WRTMT103	Bartec Mechanical Tool Kit



469-10300
Bartec Mechanical
Tool Kit

G. Dill TPMS Master Tool Kit

- Accurately and quickly install and remove any TPMS component
- **No more torque errors:** Simplest TPMS set available

Contents of kit below:



Dill No.	Type	Description
4700	TPMS Grommet tool	Easily remove and install TPMS valve stem grommets
5540	Speed Torque 40 IN-LB	Fast and accurate TPMS installer for 45 in./lbs. and below Service Kits
5565	Speed Torque 65 IN-LB	Fast and accurate TPMS installer for 46 in./lbs. and above Service Kits
(w/ 5540 & 5565)	Drive Sockets	11mm and 12mm deep well sockets
5414	Valve Core Torque Tool	Installs valve cores to recommended torque (3.5 in./lbs.)
5415	Torque Screwdriver	Torque T-10 screw installation, 12.5 in./lbs. (i.e. VS-950 rubber stem).
5417	Beru Valve Holding Tool	Holds Beru valve in place for easy installation
5535	Torque Screwdriver	Torque T-20 screw installation, 35 in./lbs. (i.e. VS-80 rubber stem)
8910	3-way Fishing Tool	Retains sensor in a secure position, deflates, adjusts the core
NA	T-bar	May be used for extra leverage with the speed torque tools
N/A	Case	Hard plastic case to keep all of your items secure

Ascot No.	Mfg. No.	Description
469-08200	8200	Dill TPMS Master Tool Kit



469-08200
Dill TPMS
Master Tool Kit

H. Digital Tire Inflator Gauge

- Range: 0-175 PSI
- Accurate to +/- 1.2 psi up to 59 psi; +/- 2.3 psi 59-145 psi; 3.6 psi more than 145 psi
- Covered with rubber sleeve for extra comfort and durability
- One button operation
- 3 in 1 function: inflate, deflate and measure tire pressure
- Long-life battery with low battery warning signal— Extra battery included
- Clip-on chuck with swivel hose to prevent kinking

Ascot No.	Mfg. No.	Description
477-00130	H-30	Digital Tire Inflator Gauge (21" Hose)
477-00136	H-30-6	Digital Tire Inflator Gauge (6' Hose): <ul style="list-style-type: none"> ▪ 1-Year warranty ▪ Equivalent to Rema H300532P



Digital Tire
Inflator Gauge
477-00130 (21" Hose)
477-00136 (6' Hose)


F

G

H

BANDED TPMS SYSTEMS & ACCESSORIES

A

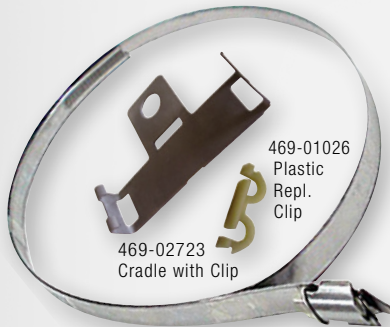

469-01026
Plastic
Repl.
Clip

469-02723
Cradle with Clip

469-01426
Adjustable Band
for Banded
TPMS Sensors

B



461-01048
Lear Ford
Banded
Transmitter

469-05105
Complete Banded
Transmitter Package

C



461-11048
High Pressure
Ford Banded
Transmitter

469-15105
Ford Complete Banded High
Pressure Sensor Package

D



Dill OEM
Replacement Bands
469-19318: 18" Band
469-19320: 20" Band
469-19322: 22" Band

A. TPMS Band Transmitter Accessories

- TPMS Band is adjustable to accommodate 14" - 26" wheels
- Plastic clip included with TPMS Cradle
- For use on vehicles equipped with banded transmitters

Ascot No.	Mfg. No.	Description
469-01426	TPSTRAP	14" - 26" Adjustable Band for Banded TPMS Sensors
469-02723	TPCRADLE	Cradle with Clip for Banded TPMS Sensors
469-01026	1026	Plastic Replacement Clip for TPMS Replacement Cradle

B. Ford Complete Banded Transmitter Package

- Includes:** 461-01048 transmitter, 469-02723 cradle/clip & 469-01426 band
- Equivalent to Dill part no. 5105**
- Replacement transmitter for Ford OE #6F2Z1A189A
- Fits most popular 2006 - 2008 Ford vehicles

Ascot No.	Mfg. No.	Description
469-05105	5105	Complete Banded Transmitter Package

C. Ford Complete Banded High Pressure Sensor Package

- Includes:** 461-11048 transmitter w/ cradle and clip & 469-01426 band
- Equivalent to Dill part no. 5105HP**
- Replacement transmitter for Ford OE # 8C2Z-1A189A
- Applications:** Pre-June Ford F250/350/450 Super Duty Trucks
- Shipped together in a plastic bag

Ascot No.	Mfg. No.	Description
469-15105	5105HP	Ford Complete Banded High Pressure Sensor Package

D. Band Transmitter for Ford

Ascot No.	Mfg. No.	OE Part No.	Description
461-01048	1048	6F2Z1A189A	Lear Ford Banded Transmitter

E. High Pressure Ford Banded Transmitter

Ascot No.	Mfg. No.	OE Part No.	Description
461-11048	1048-HP	8C2Z1A189A	High Pressure Ford Banded Transmitter

F. Dill OEM Replacement Bands

Ascot No.	Mfg. No.	Description
469-19318	1193-18	18" OEM Replacement Band
469-19320	1193-20	20" OEM Replacement Band
469-19322	1193-22	22" OEM Replacement Band

TRAINING & PROMOTIONAL MATERIALS, CABINETS

A. TPMS Training Package

TRAINING PACKAGE INCLUDES:

- 90 minute, in-depth TPMS Training DVD
- Mitchell TPMS Service Guide
- TPMS Course Book (with test & certification application)
- CD Video Demos of each Bartec TPMS Tool

Ascot No.	Mfg. No.	Description
469-11112	WRTRKIT3	TPMS Training Package
469-11113	WRTRKIT4	TPMS Training Package - Spanish Version



469-11112
TPMS Training Package

B. Schrader TPMS Training DVD

- Available in both English and Spanish versions. Call for more details

Ascot No.	Mfg. No.	Description
469-21355	21355	Training DVD - English Version
469-21357	21357	Training DVD - Spanish Version



469-21355
Schrader TPMS Training DVD

C. TPMS Consumer Kit

TPMS CONSUMER KIT INCLUDES:

- Informative Counter Mat
- "How TPMS Works" Tri-Fold (50 pieces)
- "What Every Consumer Should Know" Tri-Fold (50 pieces)
- Tri-Fold Counter Top Display
- 2013 Product Bulletin
- Mouse Pad
- 2' x 3' Wall or Window Poster
- 2' x 8' Hanging Window Banner
- Talking TPMS Reference Book



Ascot No.	Mfg. No.	Description
469-60001	WRTCNK001	TPMS Consumer Kit

469-60001
TPMS Consumer Kit

REPLACEMENT PARTS		
469-60010	WRTCNK0010	TPMS Consumer Kit Refill: "How TPMS Works" Tri-Fold (25/pack)
469-60015	WRTCNK0015	TPMS Consumer Kit Refill: "What Every Consumer Should Know" Tri-Fold (25 pieces per pack)
469-60020	WRTCNK0020	Tri-Fold Countertop Display
469-60025	WRTCNK0025	Single 2' x 3' TPMS Poster
469-60030	WRTCNK0030	Counter Mat
469-60035	WRTCNK0035	Mouse Pad
469-60040	WRTCNK0040	Talking TPMS Instruction Handbook



TPMS Countertop Displays

TRAINING & PROMOTIONAL MATERIALS, CABINETS (CONT.)

A. TPMS Countertop Displays

- Three-dimensional countertop display to help educate consumers on TPMS
- Dummy sensor included as a visual reference
- Display explains in common terms the individual components that are involved in the installation of sensors and why these components should be replaced each time the tire is disassembled
- Provides a photograph of the universal "horseshoe" symbol that indicates the existence of TPMS
- Some assembly required
- Packaged 1 display per box

Ascot No.	Mfg. No.	Description
469-61589	61589	TPMS Countertop Display w/ Dummy Transmitter
469-61599	61599	Spanish TPMS Countertop Display w/ Dummy Transmitter



469-22006
Schrader TPMS
Consumer Brochure



717-00400
Clear Plastic
Brochure Holder

B. TPMS Tri-Fold Consumer Brochure, Brochure Holder

Ascot No.	Mfg. No.	Description
469-22006	469-22006	Schrader TPMS Consumer Brochure
717-00400	W40A	Clear Plastic Brochure Holder

C. Consumer Awareness Counter Mat

Ascot No.	Mfg. No.	Description
469-07011	N/A	Consumer Awareness Counter Mat

D. Dill TPMS Cabinets

- The 5112-A TPMS Kit Cabinet comes with an assortment of service kits that fit the vehicles you see in your shop

Ascot No.	Mfg. No.	Description	Dimensions
469-05112	5112-A	Counter-Top Style TPMS Cabinet w/ Assortment of Service Kits	12" x 15" x 3.5"



469-05112
Counter-Top Style
TPMS Cabinet



TPMS RETROFIT KITS



A. Schrader TPMS Retrofit Kits

- For installation on vehicles not equipped with OE TPMS Systems
- Stand-alone kit includes dash mounted display
- Four wheel mounted transmitters and installation instructions

Ascot No.	Mfg. No.	Description
469-20154	20154	Replacement Sensor for Retrofit Kits
469-20256	20256	Battery Operated
469-20257	20257	Hard-Wired



469-20256
Battery Operated Schrader TPMS Retrofit Kit

B. Dill Trailer TPMS System

- Designed to be installed directly into trailer tires
- Provides accurate trailer tire air pressures and temperatures
- A warning will trigger if pressure falls below the set pressure
- Ability to set baseline pressure to desired PSI level
- Valve options for 0.453", 0.625", and 9.7mm rim holes
- Cigarette lighter adapter or hard-wired options



Transmitters



469-20257
Hard-Wired Schrader TPMS Retrofit Kit



Valve options for 0.453", 0.625", and 7.7mm rim holes



The display on the Dill Trailer TPMS System



469-01508
Dill Trailer TPMS System with Eight Sensors

Ascot No.	Mfg. No.	Description
469-01502	1502-453	Dill Trailer TPMS System With Two Sensors
469-01504	1504-453	Dill Trailer TPMS System With Four Sensors
469-01506	1506-453	Dill Trailer TPMS System with Six Sensors
469-01508	1508-453	Dill Trailer TPMS System with Eight Sensors
469-01510	1510-453	Dill Trailer TPMS System with Ten Sensors

EZ-SENSOR 2014 TPMS APPLICATION GUIDE

■ VEHICLE APPLICATION COVERAGE: Part No. 33000, 33100 & 33200

	Model	Model Year	EZ-Sensor Part #	OE Sensor Part #
Acura	CSX	2008-2011	33000	42753-SNA-A83
		2012	33000	42753-TR0-A81
Audi	A6	2002-2004	33000	4D0 907 275D
	A8	2000-2002	33000	4D0 907 275D
		2003	33000	4D0 907 275D
		2003	33100/33200	4D0 907 275C
		2004-2011	33100/33200	4D0 907 275C
	Allroad	2001-2005	33000	4D0 907 275D
	RS6	2003	33100/33200	4D0 907 275C
	S4	2002-2003	33000	4D0 907 275D
	S8	2000-2002	33000	4D0 907 275D
		2003	33000	4D0 907 275D
2003		33100/33200	4D0 907 275C	
2004-2007		33100/33200	4D0 907 275C	
2008-2009		33100/33200	4D0 907 275C	
Bentley	GT	2003-2004	33100/33200	4D0 907 275C
		2005-2005	33100/33200	4D0 907 275C
BMW	3 Series	2000	33000	36 11 8 378 681
		2001-2002	33000	36 11 8 378 681
		2001-2002	33100/33200	36 11 8 378 682
		2003-2006	33100/33200	36 11 8 378 682
	5 Series	2000-2001	33000	36 11 8 378 681
		2002	33000	36 11 8 378 681
		2002	33100/33200	36 11 8 378 682
		2003-2005	33100/33200	36 11 8 378 682
	7 Series	2000-2001	33000	36 11 8 378 681
		2002-2003	33100/33200	36 11 8 378 682
	M3	2002-2003	33100/33200	36 11 8 378 682
	M5	2002-2003	33100/33200	36 11 8 378 682
	X5	2000-2003	33100/33200	36 14 6 752 128
Buick	Allure	2007	33000	15921013
		2008	33000	15921013
		2009	33000	13586335
		2010-2011	33000	13586335
	Enclave	2008	33000	15921013
		2009-2011	33000	13586335
		2012	33000	13586335
		2013-2014	33000	22853741
	Encore	2013-2014	33000	22854866
	LaCrosse	2007	33000	15921013
		2008	33000	15921013
		2009	33000	13586335
		2010	33000	13586335
2011-2012		33000	13586335	
2013-2014		33000	22854866	

	Model	Model Year	EZ-Sensor Part #	OE Sensor Part #
Buick (cont.)	LeSabre	2007	33000	13586335
		2008-2011	33000	13586335
	Lucerne	2007	33000	13586335
		2008-2011	33000	13586335
	Rainier	2007	33000	13586335
	Regal	2011	33000	13586335
		2012	33000	20925924
		2013-2014	33000	22854866
	Verano	2012	33000	20925924
		2013-2014	33000	22854866
Cadillac	ATS	2014	33000	13581558
	CTS	2008-2011	33000	13586335
		2012	33000	20922900
		2013	33000	22853741
		2014	33000	13581558
	CTS-V	2012-2013	33000	20925924
	DTS	2006	33000	15268606
		2007	33000	13586335
	ELR	2008-2011	33000	13586335
		2014	33000	22854866
		Escalade	2004	33000
	2005-2006		33000	15114379
	2007*		33000	15825475
2007**	33000		13586335	
2008-2012	33000		13586335	
SRX	2013	33000	22853741	
	2014	33000	13581558	
	2007-2009	33000	13586335	
	2010-2011	33000	13586335	
STS	2012	33000	20925924	
	2013	33000	22853741	
	2014	33000	22854866	
	2005-2007	33000	25758220	
	2008	33000	25758220	
	2009*	33000	15268606	
XLR	2009**	33000	13586335	
	2010	33000	13586335	
	2011	33000	13586335	
	2012	33000	13586335	
Chevrolet	XTS	2013-2014	33000	22854866
	Avalanche	2004-2011	33000	25758220
		2013-2014	33000	22854866
		2004	33000	15136883
		2005-2006	33000	15114379
2007*		33000	15825475	
2007**	33000	13586335		
2008-2012	33000	13586335		
2013	33000	22853741		

VEHICLE APPLICATION COVERAGE:
Part No. 33000, 33100 & 33200

EZ-SENSOR 2014 TPMS APPLICATION GUIDE

Model	Model Year	EZ-Sensor Part #	OE Sensor Part #	
Chevrolet (cont.)	Aveo	2007-2011	33000	13586335
	Camaro	2010-2011	33000	13586335
		2012	33000	20922900
		2013-2014	33000	22854866
		Caprice	2013	33000
	Captiva	2012	33000	13586335
	Cobalt	2008	33000	15921013
		2009*	33000	15921013
		2009**	33000	13586335
		2010	33000	13586335
	Colorado	2007-2012	33000	15122618
	Corvette	2005-2009	33000	25758220
		2010-2011	33000	15268606
		2012	33000	20925924
		2013	33000	15268606
		2014	33200	13581560
	Corvette C6	2005-2009	33000	25758220
	Corvette Z06	2005-2009	33000	25758220
		2010-2011	33000	15268606
2012		33000	20925924	
Cruze	2011	33000	13586335	
	2012	33000	20922900	
	2013-2014	33000	22854866	
Equinox	2007	33000	15921013	
	2008-2009	33000	15921013	
	2010-2011	33000	13586335	
	2012	33000	20922900	
	2013-2014	33000	22854866	
Express	2008-2009	33000	15921013	
	2010-2011	33000	13586335	
	2012-2014	33000	13586335	
HHR	2008	33000	15268606	
	2009*	33000	15268606	
	2009**	33000	13586335	
	2010-2011	33000	13586335	
Impala	2006	33000	15268606	
	2007*	33000	15268606	
	2007**	33000	13586335	
	2008-2010	33000	13586335	
	2011-2012	33000	13586335	
	2013	33000	22853741	
	2014	33000	22854866	
Malibu	2008*	33000	15921013	
	2008**	33000	13586335	
	2009	33000	13586335	
	2010-2012	33000	13586335	
2013-2014	33000	22854866		

Model	Model Year	EZ-Sensor Part #	OE Sensor Part #		
Chevrolet (cont.)	Monte Carlo	2006	33000	15268606	
		2007*	33000	15268606	
		2007**	33000	13586335	
	Orlando	2012-2014	33000	13586335	
	Silverado	2004-2004	33000	15136883	
		2005-2006	33000	15114379	
		2007**	33000	13586335	
		2007* (TRW)	33000	15825475	
		2008-2013	33000	13586335	
	2014	33000	13581558		
	Sonic	2012	33000	20922900	
		2013-2014	33000	22854866	
	Spark	2013-2014	33000	20922900	
	SparkEV	2014	33000	22854866	
	Suburban	2004	33000	15136883	
		2005-2006	33000	15114379	
		2007**	33000	13586335	
		2007* (TRW)	33000	15825475	
		2008-2011	33000	13586335	
		2012-2013	33000	13586335	
	2014	33000	13581558		
	Tahoe	2004	33000	15136883	
		2005-2006	33000	15114379	
		2007**	33000	13586335	
		2007* (TRW)	33000	15825475	
		2008-2011	33000	13586335	
		2012-2013	33000	13586335	
	2014	33000	13581558		
	Traverse	2009-2011	33000	13586335	
2012		33000	13586335		
2013-2014		33000	22853741		
Trax	2013-2014	33000	22854866		
Uplander	2008-2009	33000	15268606		
Van	2008-2011	33000	15921013		
	2010-2011	33000	13586335		
	2012	33000	20922900		
	2013-2014	33000	22854866		
Chrysler	300	2005-2006	33000	68001696AB	
		2007	33000	68001696AB	
		2007	33100/33200	68078768AA	
		2008	33100/33200	68078768AA	
		2009-2009	33200	56029400AC	
		2010	33200	56029398AB	
		2011-2014	33200	56029398AB	
		300 SRT	2010-2011	33200	56029400AC
		300M	2002-2004	33100/33200	52088990AD
		Aspen	2007-2007	33000	68001696AB
2008-2011	33000		56029465AB		

*Snap-in **Clamp-in

EZ-SENSOR 2014 TPMS APPLICATION GUIDE

▪ VEHICLE APPLICATION COVERAGE:
Part No. 33000, 33100 & 33200

	Model	Model Year	EZ-Sensor Part #	OE Sensor Part #
Chrysler (cont.)	Concorde	2002-2004	33100/33200	52088990AD
	Crossfire	2004-2004	33100/33200	52088990AD
		2005-2011 (Conti Sensor)	33000	68001696AB
		2005-2011 (SCH Sensor)	33100/33200	52088990AD
	Intrepid	2002-2004	33100/33200	52088990AD
	Pacifica	2003-2003	33100/33200	52088990AD
		2004	33100/33200	52088990AD
		2006-2008	33000	68001696AB
	Prowler	2002	33100/33200	52088990AD
	PT Cruiser	2008-2010	33000	68001696AB
	Sebring	2007-2007	33000	68001696AB
		2008-2009	33000	68001696AB
		2008-2009	33100/33200	68078768AA
		2010	33000	68001696AB
	Town & Country	2002-2003	33100/33200	52088990AD
		2006	33000	68001696AB
		2007	33000	68001696AB
2008		33000	68001696AB	
2008		33100/33200	68078768AA	
Voyager	2009-2010	33100/33200	68078768AA	
	2011-2014	33200	56029398AB	
	2002-2003	33100/33200	52088990AD	
	2007-2012	33000	68001696AB	
Dodge	Caliber	2007-2012	33000	68001696AB
	Caravan	2002-2003	33100/33200	52088990AD
		2006	33000	68001696AB
		2007	33000	68001696AB
	Challenger	2008	33200	56029400AC
		2009-2010	33200	56029400AC
		2011-2012	33200	56029400AC
		2013-2014	33200	56029398AB
	Charger	2005-2006	33000	68001696AB
		2007	33000	68001696AB
		2008	33100/33200	68078768AA
		2009	33200	56029400AC
		2010	33200	56029398AB
		2011-2014	33200	56029398AB
	Charger SRT	2009-2010	33200	56029400AC
	Dakota	2008-2010*	33000	56029319AB
		2008-2010**	33000	56029479AA
2011		33000	56029479AA	
Durango	2007-2008	33000	68001696AB	
	2009-2010	33000	56029465AB	
	2011-2014	33200	56029398AB	
Grand Caravan	2002-2003	33100/33200	52088990AD	
	2006-2006	33000	68001696AB	
	2007	33000	68001696AB	
	2008-2010	33100/33200	68078768AA	
	2011-2014	33200	56029398AB	

	Model	Model Year	EZ-Sensor Part #	OE Sensor Part #	
Dodge (cont.)	Intrepid	2002-2004	33100/33200	52088990AD	
	Journey	2009-2010	33100/33200	68078768AA	
		2011-2014	33200	56029398AB	
	Magnum	2005-2006	33000	68001696AB	
		2007-2007	33000	68001696AB	
		2008	33100/33200	68078768AA	
		2009-2009	33200	56029400AC	
	Nitro	2010-2011	33200	56029398AB	
		2007-2008	33000	68001696AB	
		2009-2012	33000	56029465AB	
	RAM 1500	2008	33000	56029319AB	
		2009-2009	33000	56029319AB	
		2009-2009	33100/33200	68078768AA	
		2010-2013	33200	56029398AB	
	RAM 2500	2010-2013	33200	56029398AB	
	Sprinter	2007-2009	33000	68038945AA	
	Stratus	2007	33000	68001696AB	
Viper	2003-2011	33100/33200	52088990AD		
	2013-2014	33200	56029400AC		
Fiat	500 (ALL)	2011-2014	33200	56029398AB	
		2012	33000	CM5T-1A180-AA	
	C-Max	2013-2014	33000	DE8T-1A180-AA	
		2006-2011	33000	6F2Z-1A189A	
	Crown Victoria	E-150	2007-2009	33000	8C2Z-1A189A
			2010	33000	8C2Z-1A189A
			2010	33000	CM5T-1A180-AA
			2011-2012	33000	CM5T-1A180-AA
		2013-2014	33000	DE8T-1A180-AA	
	E-250	2007-2009	33000	8C2Z-1A189A	
		2010	33000	8C2Z-1A189A	
		2010	33000	CM5T-1A180-AA	
		2011-2012	33000	CM5T-1A180-AA	
	E-350 SD	2013-2014	33000	DE8T-1A180-AA	
		2007-2009	33000	8C2Z-1A189A	
		2010	33000	8C2Z-1A189A	
		2010	33000	CM5T-1A180-AA	
2011-2012		33000	CM5T-1A180-AA		
2013-2014		33000	DE8T-1A180-AA		
Edge	2007-2010	33000	6F2Z-1A189A		
	2007-2010	33000	7L1Z-1A189A		
	2011-2013	33000	CM5T-1A180-AA		
	2013-2014	33000	DE8T-1A180-AA		
	2005-2008	33000	6F2Z-1A189A		
Escape	2009-2012	33000	CM5T-1A180-AA		
	2013	33000	CM5T-1A180-AA		
	2014	33000	DE8T-1A180-AA		
	2005-2008	33000	6F2Z-1A189A		

VEHICLE APPLICATION COVERAGE:
Part No. 33000, 33100 & 33200

EZ-SENSOR 2014 TPMS APPLICATION GUIDE

Model	Model Year	EZ-Sensor Part #	OE Sensor Part #
Exp Sport Trac	2006-2010	33000	6F2Z-1A189A
Expedition	2003-2004	33100/33200	4L2Z-1A150-BA
	2007-2010	33000	6F2Z-1A189A
	2007-2010	33000	7L1Z-1A189A
	2011-2013	33000	CM5T-1A180-AA
	2014	33000	DE8T-1A180-AA
Explorer	2002-2005	33100/33200	4L2Z-1A150-BA
	2006-2010	33000	6F2Z-1A189A
	2011-2012	33000	CM5T-1A180-AA
	2013-2014	33000	DE8T-1A180-AA
F-150	2007-2008	33000	6F2Z-1A189A
	2009-2010	33000	CM5T-1A180-AA
	2011-2012	33000	CM5T-1A180-AA
	2013-2014	33000	DE8T-1A180-AA
F-150 Heavy Duty	2008	33000	8C2Z-1A189A
F-250 SD	2008-2009	33000	8C2Z-1A189A
	2010	33000	8C2Z-1A189A
	2010	33000	CM5T-1A180-AA
	2011-2012	33000	CM5T-1A180-AA
	2013-2014	33000	DE8T-1A180-AA
F-350 SD	2008-2009	33000	8C2Z-1A189A
	2010	33000	8C2Z-1A189A
	2010	33000	CM5T-1A180-AA
	2011-2012	33000	CM5T-1A180-AA
	2013-2014	33000	DE8T-1A180-AA
Fiesta	2011-2012	33000	CM5T-1A180-AA
	2013-2014	33000	DE8T-1A180-AA
Five Hundred	2006-2007	33000	6F2Z-1A189A
Flex	2009-2010	33000	7L1Z-1A189A
	2011-2013	33000	CM5T-1A180-AA
	2013-2014	33000	DE8T-1A180-AA
Focus	2007	33000	6F2Z-1A189A
	2008-2009	33000	7L1Z-1A189A
	2010-2011	33000	CM5T-1A180-AA
	2012-2014	33000	DE8T-1A180-AA
Freestar	2006-2007	33000	6F2Z-1A189A
Fusion	2007-2009	33000	6F2Z-1A189A
	2010-2012	33000	CM5T-1A180-AA
	2013	33000	CM5T-1A180-AA
	2014	33000	DE8T-1A180-AA
Grand Marquis	2007-2011	33000	6F2Z-1A189A
Interceptor Crown Vic	2006-2011	33000	6F2Z-1A189A
Interceptor Explorer	2011-2013	33000	CM5T-1A180-AA
Interceptor Taurus	2011-2013	33000	CM5T-1A180-AA
Mustang	2007-2009	33000	6F2Z-1A189A
	2010-2014	33000	CM5T-1A180-AA

Model	Model Year	EZ-Sensor Part #	OE Sensor Part #	
Ranger	2007-2011	33000	6F2Z-1A189A	
Shelby GT500	2012	33000	CM5T-1A180-AA	
	2013-2014	33100/33200	DR3V-1A180-BA	
	2013-2014	33000	7L1Z-1A189A	
Taurus	2008-2009	33000	7L1Z-1A189A	
	2010***	33000	7L1Z-1A189A	
	2010**	33000	CM5T-1A180-AA	
	2011-2012	33000	CM5T-1A180-AA	
	2013-2014	33000	DE8T-1A180-AA	
Taurus X	2008-2009	33000	7L1Z-1A189A	
Transit	2014	33000	DE8T-1A180-AA	
Transit Connect	2010-2012	33000	CM5T-1A180-AA	
	2013-2014	33000	DE8T-1A180-AA	
Acadia	2007-2008	33000	15921013	
	2009-2011	33000	13586335	
	2012	33000	13586335	
	2013-2014	33000	22853741	
	2013-2014	33000	22853741	
Canyon	2007-2012	33000	15122618	
Savana	2008-2009	33000	15921013	
	2010-2012	33000	13586335	
	2013-2014	33000	22853741	
	2013-2014	33000	22853741	
Sierra All	2004	33000	15136883	
	2005-2006	33000	15114379	
	2007* (SCH Sensor)	33000	15114379	
	2007**	33000	13586335	
	2007* (TRW)	33000	15825475	
	2008-2013	33000	13586335	
Terrain	2014	33000	13581558	
	2010-2012	33000	13586335	
	2013-2014	33000	22854866	
Yukon All	2004	33000	15136883	
	2005-2006	33000	15114379	
	2007**	33000	13586335	
	2007* (TRW)	33000	15825475	
	2008-2013	33000	13586335	
Honda	2014	33000	13581558	
	Accord	2008-2012	33000	42753-SWA-316
	Civic	2008-2011	33000	42753-SNA-A83
		2012-2014	33000	42753-TRO-A81
	CR-V	2007-2011 (Alloy Wheels)	33000	42753-SWA-316
		2007-2011 (Steel Wheels)	33000	42753-SWA-315
	CR-Z	2011-2014	33000	42753-SNA-A83
	Element	2009-2011	33000	42753-SNA-A83
	Fit	2008	33000	42753-SWA-316
		2009-2013	33000	42753-SNA-A83
	Insight	2010-2014	33000	42753-SNA-A83
Odyssey	2011-2014	33000	42753-SNA-A83	
Odyssey Tour	2011-2013	33000	42753-SNA-A83	
S2000	2008-2009	33000	42753-S2A-315	

*Snap-in **Clamp-in

EZ-SENSOR 2014 TPMS APPLICATION GUIDE

▪ VEHICLE APPLICATION COVERAGE:
Part No. 33000, 33100 & 33200

	Model	Model Year	EZ-Sensor Part #	OE Sensor Part #
Hummer	H2	2008-2009	33000	13586335
	H3	2006-2010	33000	15122618
	H3T	2006-2010	33000	15122618
Hyundai	Accent	2008-2011	33000	52933_2F000
		2012-2014	33000	52933-2M000
	Azera	2007-2013	33000	52933-2G200
	Elantra	2007-2010	33000	52933-2G200
	Elantra Touring	2010-2012	33000	52933-2M000
	Equus	2014	33000	52933-A5000
	Genesis Coupe	2010-2012	33000	52933-2M000
	Santa Fe	2008 (Lo Line)	33000	52933-2G200
		2009	33000	52933-2G200
		2010-2012	33000	52933-0W100
		2013-2013	33000	52933-A5000
	Sonata	2008 (FM)	33000	52933_2F000
		2009-2010	33000	52933_2F000
		2011-2013	33000	52933-2M000
	Tucson	2010-2013	33000	52933_2F000
Veracruz	2008 (Lo Line)	33000	52933-2G200	
	2009-2012	33000	52933-2G200	
Infiniti	EX35	2008	33000	40700-CD001
		2009-2010	33000	40700-JK00B
		2010.5-2013	33000	40700-1LA0A
		2010.5-2013	33000	40700-1LA0A
	EX37	2011-2012	33000	40700-1LA0A
		2011-2012	33000	40700-1LA0A
	FX35	2003-2004	33000	40700-CD001
		2005-2008	33000	40700-CD001
		2009-2010	33000	40700-JK00B
		2010.5-2013	33000	40700-1LA0A
		2010.5-2013	33000	40700-1LA0A
	FX37	2013	33000	40700-1LA0A
2013		33000	40700-1LA0A	
FX45	2003-2004	33000	40700-CD001	
	2005-2008	33000	40700-CD001	
FX50	2009-2010	33000	40700-JK00B	
	2010.5-2013	33000	40700-1LA0A	
	2010.5-2013	33000	40700-1LA0A	
G25	2011-2013	33000	40700-1LA0A	
	2011-2013	33000	40700-1LA0A	
G35	2003-2004	33000	40700-CD001	
	2005-2006	33000	40700-CD001	
	2007	33000	40700-JA00C	
	2008	33000	40700-JK00B	
G37	2008-2010	33000	40700-JK00B	
	2010.5-2013	33000	40700-1LA0A	
	2010.5-2013	33000	40700-1LA0A	
M35	2003-2008	33000	40700-CD001	
	2009-2012	33000	40700-JA00C	
M35 H	2012	33000	40700-1LA0A	
	2012	33000	40700-1LA0A	

	Model	Model Year	EZ-Sensor Part #	OE Sensor Part #
Infiniti (cont.)	M37	2011-2013	33000	40700-1LA0A
		2011-2013	33000	40700-1LA0A
	M45	2003-2008	33000	40700-CD001
		2009-2010	33000	40700-JA00C
	M56	2011-2013	33000	40700-1LA0A
		2011-2013	33000	40700-1LA0A
	Q45	2003-2004	33000	40700-CD001
		2005-2006	33000	40700-CD001
	QX4	2003	33000	40700-CD001
	QX56	2004-2004	33000	40700-CK002
		2005-2006 (Alloy Wheels)	33000	40700-CK001
		2005-2006 (Steel Wheels)	33000	40700-CK002
2007		33000	40700-CK002	
2008-2010		33000	40700-JA00C	
2011-2013		33000	40700-1LA0A	
2011-2013		33000	40700-1LA0A	
Isuzu	i-290	2007-2009	33000	15122618
	i-370	2007-2009	33000	15122618
	Rodeo	2004	33100/33200	52088990AD
Jeep	Commander	2006	33000	68001696AB
		2007	33000	56053036AA
		2008-2011	33100/33200	68078768AA
	Compass	2007-2011	33000	68001696AB
		2013	33000	68001696AB
	Grand Cherokee	2002-2004	33100/33200	52088990AD
		2005-2006	33000	68001696AB
		2007	33000	56053036AA
		2008-2010	33100/33200	68078768AA
		2011-2014	33200	56029398AB
Liberty	2002-2004	33100/33200	52088990AD	
	2005-2006	33000	68001696AB	
	2007-2008	33000	68001696AB	
	2009	33000	56029465AB	
	2009	33100/33200	68078768AA	
	2010-2012	33000	56029465AB	
	2010-2012	33000	56029465AB	
	2013-2014	33200	56029398AB	
Patriot	2007-2012	33000	68001696AB	
	Wrangler	2007-2008	33000	68001696AB
		2009	33100/33200	68078768AA
		2009	33000	56029479AA
	2010-2012	33000	56029479AA	
Kia	Borrego	2009-2011	33000	52933_2F000
	Cadenza	2014	33000	52933-A5000
	Forte	2010-2013	33000	52933-2M000
		2006-2010	33000	52933-2G200
	Optima	2011-2013	33000	52933-2M000
		2007-2011	33000	52933_2F000
	Rondo	2006-2011	33000	52933-2G200

VEHICLE APPLICATION COVERAGE:
Part No. 33000, 33100 & 33200

EZ-SENSOR 2014 TPMS APPLICATION GUIDE

	Model	Model Year	EZ-Sensor Part #	OE Sensor Part #
Kia (cont.)	Sedona	2009-2013	33000	52933-2G200
	Sorento	2011-2013	33000	52933-2M000
		2014	33000	52933-A5000
	Soul	2010-2013	33000	52933-2M000
	Spectra	2007-2011	33000	52933_2F000
Sportage	2009-2010	33000	52933_2F000	
	2011-2013	33000	52933_2F000	
Land Rover	LR3	2002-2005	33100/33200	LR031761
	Range Rover	2003-2005	33100/33200	LR031761
Lexus	CT 200H	2011-2013	33000	42607-33021
	ES 300H	2013	33000	42607-06020
	ES 350	2007-2013	33000	42607-33021
	GS 300	2005-2011	33000	42607-33021
	GS 350	2007-2012	33000	42607-33021
		2013	33100/33200	42607-02030
	GS 430	2005	33000	42607-30030
		2006 (Early)	33000	42607-30030
		2006 (Late)	33000	42607-33021
		2007	33000	42607-33021
	GS 450H	2007-2012	33000	42607-33021
	GS 460	2008-2012	33000	42607-33021
		2010-2013	33000	42607-33021
	GX 470	2004-2005	33000	42607-35010
		2006 (Early)	33000	42607-30030
		2006 (Late)	33000	42607-33021
		2007-2009	33000	42607-33021
	IS 250	2006-2013	33000	42607-33021
	IS 300H	2006-2013	33000	42607-33021
	IS 350	2006-2013	33000	42607-33021
	IS C	2006-2012	33000	42607-33021
	IS F	2006-2013	33000	42607-33021
	LFA	2012-2013	33000	42607-33021
	LS 460	2007-2012	33000	42607-33021
		2013	33000	42607-06020
	LS 600H	2008-2013	33000	42607-33021
	LX 470	2005-2007	33000	42607-33021
	LX 570	2008-2012	33000	42607-33021
		2013-2013	33000	42607-33021
	RX 330	2006	33000	42607-33021
	RX 350	2007-2012	33000	42607-33021
	RX 400H	2007-2012	33000	42607-33021
RX 450H	2010-2012	33000	42607-33021	
	2013	33000	42607-33021	
Lincoln	Aviator	2003-2005	33100/33200	4L2Z-1A150-BA
	CUV	2014	33000	DE8T-1A180-AA
	Mark LT	2007-2008	33000	6F2Z-1A189A
		2009	33000	CM5T-1A180-AA
		2013-2014	33000	DE8T-1A180-AA
	MKS	2009-2010	33000	7L1Z-1A189A
		2011-2012	33000	CM5T-1A180-AA
2013-2014		33000	DE8T-1A180-AA	

	Model	Model Year	EZ-Sensor Part #	OE Sensor Part #
Lincoln (cont.)	MKT	2010	33000	7L1Z-1A189A
		2011-2013	33000	CM5T-1A180-AA
		2013-2014	33000	DE8T-1A180-AA
	MKX	2007-2010 (Chrome Wheels)	33000	6F2Z-1A189A
		2007-2010 (w/o Chrome Wheels)	33000	7L1Z-1A189A
		2011-2013	33000	CM5T-1A180-AA
		2013-2014	33000	DE8T-1A180-AA
		2007-2009	33000	6F2Z-1A189A
	MKZ	2010-2013	33000	CM5T-1A180-AA
		2014	33000	DE8T-1A180-AA
Navigator	2003-2004	33100/33200	4L2Z-1A150-BA	
	2007-2010	33000	7L1Z-1A189A	
	2011-2012	33000	CM5T-1A180-AA	
	2013-2014	33000	DE8T-1A180-AA	
Town Car	2006-2011	33000	6F2Z-1A189A	
Maserati	Quattroporte	2004-2008	33100/33200	224549
Maybach	57	2003-2011	33000	A 005 542 24 18
	62	2003-2011	33000	A 005 542 24 18
	57 S	2006-2011	33000	A 005 542 24 18
	62 S	2003-2011	33000	A 005 542 24 18
Landaulet	2009-2011	33000	A 005 542 24 18	
Mazda	B Pickup	2007-2008	33000	6F2Z-1A189A
	Tribute	2006-2008	33000	6F2Z-1A189A
Mercedes-Benz		2009-2011	33000	CM5T-1A180-AA
	C250	2012-2013	33200	A 000 905 7200
	C300	2008-2013	33200	A 000 905 7200
	C350	2008-2013	33200	A 000 905 7200
	C63 AMG	2008-2013	33200	A 000 905 7200
	CL500/CL55 AMG	2000-2006	33000	A 005 542 24 18
	CL500/CL55AMG/CL63AMG	2010-2012	33200	A 000 905 7200
	CL550	2010-2012	33200	A 000 905 7200
	CL600	2010-2012	33200	A 000 905 7200
	CL65 AMG	2010-2012	33200	A 000 905 7200
	CLK350	2006-2009	33200	A 000 905 7200
	CLK500	2006-2006	33200	A 000 905 7200
	CLK55 AMG	2006-2006	33200	A 000 905 7200
	CLK550	2007-2009	33200	A 000 905 7200
	CLK63 AMG	2007-2008	33200	A 000 905 7200
	CLS550	2012	33200	A 000 905 7200
	CLS63 AMG	2012	33200	A 000 905 7200
E350	2010-2012	33200	A 000 905 7200	
E550	2010-2012	33200	A 000 905 7200	
E63 AMG	2010-2012	33200	A 000 905 7200	

*Snap-in **Clamp-in

EZ-SENSOR ²⁰¹⁴ TPMS APPLICATION GUIDE

▪ VEHICLE APPLICATION COVERAGE:
Part No. 33000, 33100 & 33200

Model	Model Year	EZ-Sensor Part #	OE Sensor Part #		
Mercedes-Benz (cont.)	G500	2008	33200	A 000 905 7200	
	G55 AMG	2008-2011	33200	A 000 905 7200	
	G550	2009-2013	33200	A 000 905 7200	
	GL350	2010-2013	33200	A 000 905 7200	
	GL450	2010-2012	33200	A 000 905 7200	
	GL550	2010-2012	33200	A 000 905 7200	
	GL63 AMG	2013	33200	A 000 905 7200	
	GLK350	2010-2013	33200	A 000 905 7200	
	ML350	2010-2012	33200	A 000 905 7200	
	ML450	2010-2011	33200	A 000 905 7200	
	ML550	2010-2012	33200	A 003 540 02 17	
	ML63 AMG	2010-2011	33200	A 000 905 7200	
	R350	2010-2012	33200	A 000 905 7200	
	S350	2012-2013	33200	A 000 905 7200	
	S400	2011-2012	33200	A 000 905 7200	
	S430/S500	2000-2006	33000	A 005 542 24 18	
		2000-2006	33100/33200	A 005 542 23 18	
	S550	2011-2012	33200	A 000 905 7200	
	S600	2011-2012	33200	A 000 905 7200	
	S63 AMG	2010-2012	33200	A 000 905 7200	
	SLK250	2012-2013	33200	A 000 905 7200	
	SLK280	2008	33200	A 000 905 7200	
	SLK300	2009-2011	33200	A 000 905 7200	
	SLK350	2008-2012	33200	A 000 905 7200	
	SLK55 AMG	2008-2010	33200	A 000 905 7200	
	SLS AMG	2011	33200	A 000 905 7200	
	Sprinter 2500	2010-2012	33000	68038945AA	
	Sprinter 3500	2010-2012	33000	68038945AA	
	Mercury	Grand Marquis	2006-2011	33000	6F2Z-1A189A
		Mariner	2006-2008	33000	6F2Z-1A189A
			2009-2011	33000	CM5T-1A180-AA
		Milan	2008-2009	33000	6F2Z-1A189A
			2010-2011	33000	CM5T-1A180-AA
Montego		2006-2007	33000	6F2Z-1A189A	
Monterey		2006-2007	33000	6F2Z-1A189A	
Mountaineer		2002-2005	33100/33200	4L2Z-1A150-BA	
		2006-2010	33000	6F2Z-1A189A	
Sable		2008-2009	33000	7L1Z-1A189A	
Mitsubishi	Eclipse	2006-2007 (Alloy Wheels)	33000	MN103081	
		2006-2007 (Steel Wheels)	33000	4250A030	
		2008-2010	33000	MN103081	
		2011-2012 (Alloy Wheels)	33000	4250B877	
		2011-2012 (Steel Wheels)	33000	4250B875	
	Endeavor	2004-2006	33100/33200	MN103033	
		2007	33000	MN103081	
		2007	33100/33200	MN103033	
		2008-2010	33000	MN103081	
		2011-2012 (Alloy Wheels)	33000	4250B877	
2011-2012 (Steel Wheels)	33000	4250B875			

Model	Model Year	EZ-Sensor Part #	OE Sensor Part #	
Mitsubishi (cont.)	Galant	2004-2006	33100/33200	MN103033
		2007-2009 (Alloy Wheels)	33000	MN103081
		2007-2009 (Steel Wheels)	33000	4250A030
		2010	33000	MN103081
		2011-2013 (Alloy Wheels)	33000	4250B877
	2011-2013 (Steel Wheels)	33000	4250B875	
	Lancer	2008-2010	33000	4250B975
		2011-2014	33000	4250B975
	Mirage	2014	33000	4250B975
	Montero	2003-2006	33000	MN103081
	Outlander	2007-2010	33000	4250B975
		2011-2014	33000	4250B975
	Raider	2008-2009	33000	56029319AB
	RVR	2011-2014	33000	4250B975
	350Z	2003	33000	40700-CD001
2004-2006		33000	40700-CD001	
2007-2008		33000	40700-JA00C	
370Z	2009-2010	33000	40700-JK00C	
	2010.5-2013	33000	40700-1LA0A	
	2010.5-2013	33000	40700-1LA0A	
Altima	2006-2012	33000	40700-1AA0D	
Armada	2005-2006 (Alloy Wheels)	33000	40700-CK001	
	2005-2006 (Steel Wheels)	33000	40700-CK002	
	2007-2008	33000	40700-CK001	
	2009-2013	33000	40700-1AA0D	
Cube	2009	33000	40700-JA00C	
	2010-2010	33000	40700-1AA0C	
	2011-2013 (ikey)	33000	40700-1LA0A	
	2011-2013 (ikey)	33000	40700-1LA0A	
	2011-2013 (non-ikey)	33000	40700-1AA0C	
Frontier	2003-2004	33000	40700-CD001	
	2005-2007 (Alloy Wheels)	33000	40700-CK001	
	2005-2007 (Steel Wheels)	33000	40700-CK002	
	2008 (Alloy Wheels)	33000	40700-CK001	
	2008 (Steel Wheels)	33000	40700-JA00C	
	2009-2013	33000	40700-1AA0D	
	GT-R	2009-2014	33000	40700-JA00C
	Juke	2011-2013 (ikey)	33000	40700-1LA0A
2011-2013 (ikey)		33000	40700-1LA0A	
2011-2013 (non-ikey)		33000	40700-1AA0C	

VEHICLE APPLICATION COVERAGE:
Part No. 33000, 33100 & 33200

EZ-SENSOR 2014 TPMS APPLICATION GUIDE

Model	Model Year	EZ-Sensor Part #	OE Sensor Part #
Leaf	2011-2012	33000	40700-1LA0A
	2011-2012	33000	40700-1LA0A
Maxima	2006	33000	40700-CK001
	2007 (Alloy Wheels)	33000	40700-CK001
	2007 (Steel Wheels)	33000	40700-1AA0D
	2008-2013	33000	40700-1AA0D
Maxima GCC	2013	33100/33200	40700-1AY0A
Murano	2003-2006	33000	40700-CD001
	2007-2009	33000	40700-1AA0D
	2010-2012	33000	40700-1AA0C
Pathfinder	2003	33000	40700-CD001
	2004 (Alloy Wheels)	33000	40700-CD001
	2004 (Steel Wheels)	33000	40700-CK002
	2005-2006	33000	40700-CK001
	2007-2012	33000	40700-1AA0D
	Quest	2004-2004	33000
	2005-2007 (Alloy Wheels)	33000	40700-CK001
	2005-2007 (Steel Wheels)	33000	40700-CK002
	2008-2009	33000	40700-1AA0D
	2011-2013	33000	40700-1LA0A
	2011-2013	33000	40700-1LA0A
Rogue	2008-2013	33000	40700-JA00C
Sentra	2007-2008 (Alloy Wheels)	33000	40700-CK001
	2007-2008 (Steel Wheels)	33000	40700-1AA0D
	2009-2012	33000	40700-1AA0D
Titan	2004	33000	40700-CK002
	2005-2007 (Alloy Wheels)	33000	40700-CK001
	2005-2007 (Steel Wheels)	33000	40700-CK002
	2008 (Alloy Wheels)	33000	40700-CD001
	2008 (Steel Wheels)	33000	40700-1AA0D
	2009-2013	33000	40700-1AA0D
Versa	2007-2008 (Alloy Wheels)	33000	40700-CK001
	2007-2008 (Steel Wheels)	33000	40700-1AA0D
	2009-2011	33000	40700-1AA0D
	2012	33000	40700-1AA0C
Xterra	2003-2004	33000	40700-CD001
	2005	33000	40700-CK001
	2006 (Alloy Wheels)	33000	40700-CK001
	2006 (Steel Wheels)	33000	40700-CK002
	2007-2013	33000	40700-1AA0D

Nissan (cont.)

Model	Model Year	EZ-Sensor Part #	OE Sensor Part #	
Pontiac	G3	2009-2010	33000	13586335
	G5	2008	33000	15921013
		2009-2010	33000	13586335
	G6	2008*	33000	15921013
		2008**	33000	13586335
		2009-2010	33000	13586335
	G8	2008-2009	33000	13586335
	Grand Prix	2007	33000	15921013
		2008*	33000	15921013
		2008**	33000	13586335
	Montana	2008	33000	15268606
Solstice	2008-2010	33000	15921013	
Torrent	2007-2009	33000	10394110	
Vibe	2008-2010	33000	88974915	
Wave	2008-2009	33000	13586335	
Porsche	911	2005-2012	33100/33200	99760602101
	Boxster	2005-2011	33100/33200	99760602101
	Carrera	2004-2011	33100/33200	99760602101
	Cayenne	2002-2006	33100/33200	99760602101
	Cayman	2006-2011	33100/33200	99760602101
Saturn	Astra	2010	33000	13586335
	Aura	2007	33000	15921013
		2008*	33000	15921013
		2008**	33000	13586335
		2009-2010	33000	13586335
	Lambda	2007-2008	33000	15268606
	Outlook	2007-2008	33000	15921013
		2009-2010	33000	13586335
Sky	2008-2009	33000	15921013	
Vue	2007-2010	33000	13586335	
Scion	FR-S	2013	33000	42607-06020
	iQ	2012-2013	33000	42607-33011
	tC	2006-2014	33000	42607-33011
	xB	2007-2013	33000	42607-33011
	xD	2008-2013	33000	42607-33011
Smart	Fortwo (SCH Sensor)	2008	33200	A 003 540 02 17
		2009-2012	33200	A 003 540 02 17
Subaru	B9 Tribeca	2006-2011	33000	28103AG00A
	BRZ	2013-2014	33000	42607-06020
	Forester	2008-2013	33000	28103AG01C
	Impreza	2008-2013	33000	28103AG01C
	Legacy	2004-2007	33000	28103AG00A
		2008-2014	33000	28103AG01C
	Outback	2004-2007	33000	28103AG00A
2008-2014		33000	28103AG01C	
Tribeca	2008-2014	33000	28103AG01C	
XV Crosstrek	2013	33000	28103AG01C	

*Snap-in **Clamp-in

EZ-SENSOR ²⁰¹⁴ TPMS APPLICATION GUIDE

▪ VEHICLE APPLICATION COVERAGE:
Part No. 33000, 33100 & 33200

	Model	Model Year	EZ-Sensor Part #	OE Sensor Part #	Model	Model Year	EZ-Sensor Part #	OE Sensor Part #
Suzuki	Equator	2009-2013	33000	43211-82Z00	RAV4 EV	2012	33000	42607-06011
	Forenza	2007-2008	33000	43130-85Z03	Sequoia	2004-2007 (Alloy Wheels)	33000	42607-0C020
	Grand Vitara	2007-2013	33000	43130-54J21		2004-2007 (Steel Wheels)	33000	42607-0C010
	Reno	2007-2008	33000	43130-85Z00		2008 (Alloy Wheels)	33000	42607-08010
	SX-4	2007-2013	33000	43130-54J21		2008 (Steel Wheels)	33000	42607-0C060
	XL-7	2005-2006	33000	43130-54J21		2009-2013	33000	42607-08010
		2007-2011	33000	43130-78J00		Sienna	2006-2014	33000
4Runner	2004-2005	33000	42607-35010	Solara	2006-2011	33000	42607-06011	
	2006 (Early)	33000	42607-35010	Tacoma	2005 (Alloy Wheels)	33000	42607-AD020	
	2006 (Late)	33000	42607-33011		2005 (Steel Wheels)	33000	42607-04010	
	2007-2012	33000	42607-33011		2006 (Early) (Alloy Wheels)	33000	42607-AD020	
	2013	33000	42607-33021		2006 (Late) (Alloy Wheels)	33000	42607-06011	
2012-2014	33000	42607-06020	2006 (Steel Wheels)		33000	42607-04010		
Avalon	2007-2012	33000	42607-06011	2007-2013 (Alloy Wheels)	33000	42607-06011		
	2013-2014	33000	42607-06020	2007-2013 (Steel Wheels)	33000	42607-04010		
Camry	2007-2011 (Mfg in Japan)	33000	42607-33011	Tundra	2005 (Alloy Wheels)	33000	42607-0C020	
	2007-2011 (Mfg in USA)	33000	42607-06011		2005 (Steel Wheels)	33000	42607-0C010	
	2012-2014	33000	42607-06020		2006 (Pacific) (Alloy Wheels)	33000	42607-0C020	
Camry Hybrid	2008-2011	33000	42607-33011		2006 (Pacific) (Steel Wheels)	33000	42607-0C010	
	2014	33000	42607-06020		2006 (TRW) (Alloy Wheels)	33000	42607-08010	
Corolla	2007-2013 (Mfg in Japan)	33000	42607-33011	2006 (TRW) (Steel Wheels)	33000	42607-0C060		
	2007-2013 (Mfg in USA)	33000	42607-06011	2007-2014 (Alloy Wheels)	33000	42607-08010		
	2014	33000	42607-06020	2007-2014 (Steel Wheels)	33000	42607-0C060		
FJ Cruiser	2008-2012	33000	42607-33011	Venza	2009-2013	33000	42607-06011	
	2013	33000	42607-33011	Yaris	2008-2011	33000	42607-33011	
Highlander	2007-2012	33000	42607-33011		2012	33000	42607-06020	
	2013	33000	42607-06011		2013	33000	42607-06011	
Highlander Hybrid	2008-2012	33000	42607-33011	Phaeton	2002-2006	33100/33200	4D0 907 275C	
	2014	33000	42607-33011		Touareg	2002-2006	33100/33200	7L0 907 275B
Land Cruiser	2005-2005	33000	42607-33011	VPG		MV-1	2012-2013	33000
	2006-2006	33000	42607-33021					
	2007 (Early)	33000	42607-33021					
	2007 (Late)	33000	42607-33011					
	2008-2011	33000	42607-33011					
Matrix	2007-2013 (Mfg in Japan)	33000	42607-33011					
	2007-2013 (Mfg in USA)	33000	42607-06011					
	2013	33000	42607-33011					
Prius	2005-2013	33000	42607-33011					
Prius C	2012	33000	42607-52020					
	2014-2014	33000	42607-52020					
Prius V	2012	33000	42607-33011					
RAV4	2006-2006	33000	42607-33011					
	2007-2012	33000	42607-33021					

*Snap-in **Clamp-in

Application guides subject to change without notice. Please refer to the manufacturer's websites for the most up-to-date application data.

REDI-SENSOR 2014 TPMS APPLICATION GUIDE

■ VEHICLE APPLICATION COVERAGE: Part No. 7001HP, 7001HPR, 7002, 7003 & 7004

Model	REDI-Sensor #	Dill Sensor #	OE Sensor #		
Buick, Cadillac, Chevrolet, GMC, Hummer, Isuzu, Mazda, Pontiac, Saab, Saturn, Suzuki	7001HP	1047	10394110		
		9158	15921013		
			15268606		
			15825475		
			20964159		
			20925924		
			43130-78J00		
			43130-78J10		
			43130-78J21		
			7001HPR	9153	25920615
					12768826
		25799331*			
		15922396			
	15202272				
	20923680				
	15123145				
	15254101				
	20922900				
	20922901				
	22854866				
	13586335				
	13581558				
	13589255				
	92186507				
	25789964				
	25809220				
	22959744				
	22853741				
	43130-85Z00				
	43130-85Z01				
	43130-85Z03				
	7001HP	1056	FE01-37-140A		
			GN3A-37-140A		
			GN3A-37-140B		
GS1D-37-140					
BHA4-37-140					
BBP3-37-140B					
BBM2-37-140B					
9116			25774006**		
		25763677			
		25774007			
		15163068			
9076		25758220			
		25758221			
		25740352			
		10306573			
		10354988			

Model	REDI-Sensor #	Dill Sensor #	OE Sensor #
Chrysler, Dodge, Jeep, Mitsubishi, Suzuki	7001HP	1051	68001696AA
		9066	68001696AB
			56053030AA
			56053030AB
			56053030AC
			56053066AA
			56053036AA
			5139640AA
			56029465AA
			56029465AB
			56029465AC
		5142340AA	
		425 0A 225	
		425 0B 668	
		425 0B 975	
		43130-57L00	
		68078861AA	
		(56029526AA)	
	1052	5127335AA-AF	
		4727392AA-AE	
	7001HPR	9154	56029319AA-AC
			68137699AA
	9308	56029479AA-AB	
	7001HPR	9315	9L3Z-1A189-AA-AF
9L3T-1A180-AA-AF			
9L3Z-1A189-A			
9L3T-1A150-BD			
DR3Z-1A189-A			
ZZDA-37-140			
SP000437			
DE8T-1A180-AA			
BB5Z-1A-189A			
CM5T-1A180-AA			
CM5T-1A150-AA			
7001HP			9135
	5L1Z-1A150-AB		
	5L7T-1A150-AA		
7001HPR	1048	6F2Z-1A189A	
		6F2A-1A176AE	
		6L2T-1A150-AA	
		6F2T-1A150AE	
		ZZC2-37-14X	
		ZZC1-37-140	
7001HPR	1048-HP	7L1Z-1A189A	
		8C2Z-1A189-A	
8C2T-1A150-BA			

*Aveo-5 not Included. **Must drive vehicle following relearn procedure.
7001HP/HPR replaces 164 OEM part numbers, 21 Dill.

Application guides subject to change without notice. Please refer to the manufacturer's websites for the most up-to-date application data.

REDI-SENSOR 2014 TPMS APPLICATION GUIDE

VEHICLE APPLICATION COVERAGE:
Part No. 7001HP, 7001HPR, 7002, 7003 & 7004

Model	REDI-Sensor #	Dill Sensor #	OE Sensor #	Model	REDI-Sensor #	Dill Sensor #	OE Sensor #						
Hyundai, KIA	7001HP	5507	52933-2L500	Chrysler, Dodge, Isuzu, Jeep, Mitsubishi, VW	7004	1043	68001698AA-AB						
			52933-2M000				7B0 907 253						
			52933-2M500				7B0 907 253A						
			52933-2M550				7B0 907 253C						
			52933-3N000				56029359AA-AC						
			52933-A5000				56029527AA						
			52933-2L700				56053031AA-AE						
Mitsubishi	7001HP	9034	MN103081				Ford, Lincoln, Mazda, Mercury, Volvo	7004	9096	4L2Z-1A150-BA			
			90518281							4L2T-1A150-BA			
			425 0B 877							31302096			
		9069	425 0A 030							31302096-0			
			425 0B 875							8G92-1A159-AB			
Nissan, Infiniti	7001HP	9204	40700-JK00B							Acura, Honda	7002	1212	42753-SNA-A81
			40700-JK00A										42753-SNA-A83
			40700-JA00C	42753-SNA-A82									
			40700-JA01B	42753-TRO-A81									
			40700-JA02B	42753-TR3-A81									
			40700-JA00B	42753-TP6-A82									
			40700-JA01A	42753-TP6-A82-M1									
			40700-1AA0B	42753-TX6-A81									
			40700-1AA0C	42753-SWA-315									
			40700-1AA0D	42753-SWA-316									
			40700-1AA0E	42753-SWA-A03									
			40700-JA01C	42753-SWA-A04									
			40700-JK01A	42753-SWA-A53									
			40700-JK00E	42753-SWA-A54									
			40700-JK00C	42753-SWA-305									
			Jaguar, Land Rover	7001HP	1055	C2Z15017	42753-SWA-306	42753-S2A-305					
						LRO 18860	42753-S2A-315						
						RQH 500460	06421-SCV-A00						
						RQH 500461							
C2C41656													
C2C40476													
LRO 10533													
LRO 21936													
Jaguar, Land Rover	7001HP	1055	C2Z15017										
			LRO 18860										
			RQH 500460										
			RQH 500461										
			C2C41656										
C2C40476													
LRO 10533													
LRO 21936													

■ VEHICLE APPLICATION COVERAGE:
 Part No. 7001HP, 7001HPR, 7002, 7003 & 7004

REDI-SENSOR 2014 TPMS APPLICATION GUIDE

Model	REDI-Sensor #	Dill Sensor #	OE Sensor #	Model	REDI-Sensor #	Dill Sensor #	OE Sensor #						
Acura, Honda (cont.)	7002	1210	06421-SCV-A01	VW	7003	1041	1K0 907 253E						
			06421-SCV-305				1K0 907 253A						
			42753-SHJ-A82				1K0 907 253D						
			42753-SHJ-306				1K0 907 255A						
	1K0 907 255C												
	1K0 907 255D												
Hyundai, KIA	7002	1029	52933-2F000		Mercedes-Benz	7003	1054	002 540 5417					
			1058					52933-3E000	002 540 6617				
								42933-2E000	002 540 6817				
								52933-1FA00	002 540 7917				
		1068	52933-1F000	004 542 5618									
			52933-1G000	004 542 1518									
			52933-0W100	002 540 9417									
			52933-2G200	004 542 9718									
			52933-2G000										
		—	52933-3L100										
		—	52933-3X200										
		—	52933-3X300										
		Lexus, Scion, Toyota	7002	1203	42607-0C010	Nissan, Infiniti	7003	1216	40700-1LA0A				
42607-AD010	40700-1LA0B												
42607-04010	40700-1LA0C												
1204	42607-33021			40700-1LA0D									
	1205			42607-30030	40700-1LA0E								
				42607-33011									
				42607-06011									
				42607-0C020									
				42607-0E011									
	42607-AD020												
	42607-75010												
	42607-34020												
	42607-35010												
42607-35030													
42607-02010													
42607-06010													
42607-33010													
42607-33020													
42607-52010													
1206	42607-0C030												
1207	42607-0C040												
	42607-0C050												
	42607-0C060												
	42607-0C070												
	42607-0C080												
	42607-08010												
Buick, Cadillac, Chevrolet, GMC	7003			9107	15114379	Toyota, Lexus, Scion	7003	1218	42607-30060				
					15163069				42607-30070				
		15102575	42607-06020										
		9131	42607-52020										
			15122618	42607-52030									
			20927604	SU003-00754									
Volvo	7003	9156	312009230	Buick, Cadillac, Chevrolet, GMC	7003				9107	15114379			
			31200923							15163069			
			313020960							15102575			
			307483540							15122618			
			86517000			20927604							
			8651700										
			307489910										
			30748991										
			Subaru			7003	9081	28103AG00A		Volvo	7003	9156	312009230
								28103AG00B					31200923
9203	28103AG01A	313020960											
	28103AG01B	307483540											
	28103AG01C	86517000											
	28103SA001	8651700											
28103SA002	307489910												

7002 replaces 60 OEM part numbers, 14 Dill. 7003 replaces 45 OEM part numbers, 10 Dill.

Application guides subject to change without notice. Please refer to the manufacturer's websites for the most up-to-date application data.

SCHRADER 2014 TPMS APPLICATION GUIDE

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.
2014				
ILX	Sensor	-		
	Service Pack	-		
ILX Hybrid	Sensor	-		
	Service Pack	-		
MDX, RDX	Sensor	-	28128 ^{††}	71, 8
RLX	Sensor	-		
TSX	Sensor	-	20098	35, 4
2013				
ILX	Sensor [†]	-		
	Service Pack	-		
ILX Hybrid	Sensor	-		
	Service Pack	-		
MDX	Sensor	-	20098 [♦]	35, 4
RDX	Sensor	-	28128 ^{††}	71, 8
TL	Sensor	-	20720	35, 4
	Service Pack	-	20019	35, 4
TSX	Sensor	-	20098	35, 4
ZDX	Sensor	-	20720	35, 4
	Service Pack	-	20019	35, 4
2012				
CSX	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
MDX, RDX	Sensor	-	20098	35, 4
	Sensor	-	20098	35, 4
RL	Sensor	-	28981	35, 4
	Service Pack	Includes Valve	20036	35, 4
TL	Sensor	-	20720	35, 4
	Service Pack	-	20019	35, 4
TSX	Sensor	-	20098	35, 4
ZDX	Sensor	-	20720	35, 4
	Service Pack	-	20019	35, 4
2011				
CSX	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.
2011 (cont.)				
CSX (cont.)	Sensor	-	28720	35, 4
	Service Pack	-	20019	35, 4
MDX, RDX	Sensor	-	20098	35, 4
	Sensor	-	20098	35, 4
RL	Sensor	-	28981	35, 4
	Service Pack	Includes Valve	20036	35, 4
TL	Sensor	-	20720	35, 4
	Service Pack	-	20019	35, 4
TSX	Sensor	-	20098	35, 4
ZDX	Sensor	-	20720	35, 4
	Service Pack	-	20019	35, 4
2010				
CSX	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
	Sensor	-	28720	35, 4
	Service Pack	-	20019	35, 4
MDX, RDX	Sensor	-	20098	35, 4
	Sensor	-	20098	35, 4
RL	Sensor	-	28981	35, 4
	Service Pack	Includes Valve	20036	35, 4
TL	Sensor	-	20720	35, 4
	Service Pack	-	20019	35, 4
TSX	Sensor	-	20098	35, 4
ZDX	Sensor	-	20720	35, 4
	Service Pack	-	20019	35, 4
2009				
CSX	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
	Sensor	-	28720	35, 4
	Service Pack	-	20019	35, 4
MDX, RDX	Sensor	-	20098	35, 4
	Sensor	-	20098	35, 4
RL	Sensor	-	28981	35, 4
	Service Pack	Includes Valve	20036	35, 4
TL	Sensor	-	20720	35, 4
	Service Pack	-	20019	35, 4
TSX	Sensor	-	20098	35, 4

* Programming Tool Required † Continental Sensor †† Continental TG1C Sensor ♦ Pacific Sensor

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2008					2011 (cont.)					
CSX	EZ-Sensor	-	33000*	11.5, 1.3	Q5	Sensor	-	20088	71, 8	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	-	20017	71, 8	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	Q7	Sensor	Includes Transmitter Only	20077	35, 4	
	Sensor	-	28720	35, 4		Service Pack	Does Not Include Valve	20023	35, 4	
	Service Pack	-	20019	35, 4		Service Pack	W/43mm Silver Insert	20037	35, 4	
	MDX, RDX	Sensor	-	20098		35, 4	Service Pack	W/48mm Green Insert	20038	35, 4
Sensor		-	20098	35, 4		Service Pack	W/49mm Black Insert	20039	35, 4	
RL, TL	Sensor	-	28981	35, 4		Service Pack	W/51mm Orange Insert	20040	35, 4	
	Service Pack	Includes Valve	20036	35, 4	R8	Sensor	-	20103	35, 4	
TSX	Sensor	-	20098	35, 4		Service Pack	Does Not Include Valve	20023	35, 4	
	2007					Service Pack	W/43mm Silver Insert	20037	35, 4	
MDX, RDX	Sensor	-	20098	35, 4		Service Pack	W/48mm Green Insert	20038	35, 4	
	Sensor	-	20098	35, 4		Service Pack	W/49mm Black Insert	20039	35, 4	
RL, TL	Sensor	-	28981	35, 4		Service Pack	W/51mm Orange Insert	20040	35, 4	
	Service Pack	Includes Valve	20036	35, 4	S4, S5	Sensor	-	20088	71, 8	
TSX	Sensor	-	20098	35, 4		Service Pack	-	20017	71, 8	
	2006-2005					S6	Sensor	Includes Transmitter Only	20077	35, 4
MDX, RL, TL	Sensor	-	28981	35, 4	Service Pack		Does Not Include Valve	20023	35, 4	
	Service Pack	Includes Valve	20036	35, 4	Service Pack		W/43mm Silver Insert	20037	35, 4	
2004					Service Pack		W/48mm Green Insert	20038	35, 4	
MDX	Sensor	-	28981	35, 4	Service Pack		W/49mm Black Insert	20039	35, 4	
	Service Pack	Includes Valve	20036	35, 4	Service Pack		W/51mm Orange Insert	20040	35, 4	
2014					TT	Sensor	-	20088	71, 8	
R8	Sensor	Includes Transmitter Only				Service Pack	-	20017	71, 8	
	Service Pack	Does Not Include Valve	20023	35, 4		2010				
	Service Pack	W/43mm Silver Insert	20037	35, 4		A3, A4, A5	Sensor	-	20088	71, 8
	Service Pack	W/48mm Green Insert	20038	35, 4			Service Pack	-	20017	71, 8
	Service Pack	W/49mm Black Insert	20039	35, 4		A6	Sensor	Includes Transmitter Only	20103	35, 4
	Service Pack	W/51mm Orange Insert	20040	35, 4	Service Pack		Does Not Include Valve	20023	35, 4	
2012					Service Pack		W/43mm Silver Insert	20037	35, 4	
A3, A4, A5, Q5	Sensor	-	20088	71, 8	Service Pack		W/48mm Green Insert	20038	35, 4	
	Service Pack	-	20017	71, 8	Service Pack		W/49mm Black Insert	20039	35, 4	
Q7, R8	Sensor	Includes Transmitter Only	20103	35, 4	Service Pack		W/51mm Orange Insert	20040	35, 4	
	Service Pack	Does Not Include Valve	20023	35, 4	A8	Sensor	Includes Transmitter Only	20077	35, 4	
	Service Pack	W/43mm Silver Insert	20037	35, 4		Service Pack	Does Not Include Valve	20023	35, 4	
	Service Pack	W/48mm Green Insert	20038	35, 4		Service Pack	W/43mm Silver Insert	20037	35, 4	
	Service Pack	W/49mm Black Insert	20039	35, 4		Service Pack	W/48mm Green Insert	20038	35, 4	
	Service Pack	W/51mm Orange Insert	20040	35, 4		Service Pack	W/49mm Black Insert	20039	35, 4	
S5	Sensor	-	20088	71, 8		Service Pack	W/51mm Orange Insert	20040	35, 4	
	Service Pack	-	20017	71, 8	Q5	Sensor	-	20088	71, 8	
2011						Service Pack	-	20017	71, 8	
A3, A4, A5	Sensor	-	20088	71, 8	Q7, R8	Sensor	Includes Transmitter Only	20103	35, 4	
	Service Pack	-	20017	71, 8		Service Pack	Does Not Include Valve	20023	35, 4	
A6	Sensor	Includes Transmitter Only	20077	35, 4		Service Pack	W/43mm Silver Insert	20037	35, 4	
	Service Pack	Does Not Include Valve	20023	35, 4		Service Pack	W/48mm Green Insert	20038	35, 4	
	Service Pack	W/43mm Silver Insert	20037	35, 4		Service Pack	W/49mm Black Insert	20039	35, 4	
	Service Pack	W/48mm Green Insert	20038	35, 4		Service Pack	W/51mm Orange Insert	20040	35, 4	
	Service Pack	W/49mm Black Insert	20039	35, 4	S4, S5	Sensor	-	20088	71, 8	
	Service Pack	W/51mm Orange Insert	20040	35, 4		Service Pack	-	20017	71, 8	

* Programming Tool Required

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2010 (cont.)					2008					
S6	Sensor	Includes Transmitter Only	20103	35, 4	A3	Sensor	-	20088	71, 8	
	Service Pack	Does Not Include Valve	20023	35, 4		Service Pack	-	20017	71, 8	
	Service Pack	W/43mm Silver Insert	20037	35, 4	A4	Sensor	Includes Transmitter Only	20078	35, 4	
	Service Pack	W/48mm Green Insert	20038	35, 4		Service Pack	Does Not Include Valve	20023	35, 4	
	Service Pack	W/49mm Black Insert	20039	35, 4		Service Pack	W/43mm Silver Insert	20037	35, 4	
	Service Pack	W/51mm Orange Insert	20040	35, 4		Service Pack	W/48mm Green Insert	20038	35, 4	
Service Pack	W/49mm Black Insert	20039	35, 4	Service Pack		W/49mm Black Insert	20039	35, 4		
Service Pack	W/51mm Orange Insert	20040	35, 4	Service Pack		W/51mm Orange Insert	20040	35, 4		
TT	Sensor	-	20088	71, 8	A5	Sensor	-	20088	71, 8	
	Service Pack	-	20017	71, 8		Service Pack	-	20017	71, 8	
2009					2007					
A3, A4, A5	Sensor	-	20088	71, 8	A6	Sensor	Includes Transmitter Only	20078	35, 4	
	Service Pack	-	20017	71, 8		Service Pack	Does Not Include Valve	20023	35, 4	
A6	Sensor	Includes Transmitter Only; Exc. Quattro	20078	35, 4		Service Pack	W/43mm Silver Insert	20037	35, 4	
	Sensor	Includes Transmitter Only; Quattro	20103	35, 4		Service Pack	W/48mm Green Insert	20038	35, 4	
	Service Pack	Does Not Include Valve	20023	35, 4		Service Pack	W/49mm Black Insert	20039	35, 4	
	Service Pack	W/43mm Silver Insert	20037	35, 4		Service Pack	W/51mm Orange Insert	20040	35, 4	
	Service Pack	W/48mm Green Insert	20038	35, 4	A8	Sensor	Includes Transmitter Only	20077	35, 4	
	Service Pack	W/49mm Black Insert	20039	35, 4		Service Pack	Does Not Include Valve	20023	35, 4	
Service Pack	W/51mm Orange Insert	20040	35, 4	Service Pack		W/43mm Silver Insert	20037	35, 4		
A8	Sensor	Includes Transmitter Only	20077	35, 4		Service Pack	W/48mm Green Insert	20038	35, 4	
	Service Pack	Does Not Include Valve	20023	35, 4		Service Pack	W/49mm Black Insert	20039	35, 4	
	Service Pack	W/43mm Silver Insert	20037	35, 4		Service Pack	W/51mm Orange Insert	20040	35, 4	
	Service Pack	W/48mm Green Insert	20038	35, 4	Q7, R8, RS4, S4	Sensor	Includes Transmitter Only	20078	35, 4	
	Service Pack	W/49mm Black Insert	20039	35, 4		Service Pack	Does Not Include Valve	20023	35, 4	
	Service Pack	W/51mm Orange Insert	20040	35, 4		Service Pack	W/43mm Silver Insert	20037	35, 4	
Q5	Sensor	-	20088	71, 8		Service Pack	W/48mm Green Insert	20038	35, 4	
	Service Pack	-	20017	71, 8		Service Pack	W/49mm Black Insert	20039	35, 4	
	Q7, R8, S4	Sensor	Includes Transmitter Only	20078		35, 4	Service Pack	W/51mm Orange Insert	20040	35, 4
		Service Pack	Does Not Include Valve	20023	35, 4	S5	Sensor	-	20088	71, 8
		Service Pack	W/43mm Silver Insert	20037	35, 4		Service Pack	-	20017	71, 8
		Service Pack	W/48mm Green Insert	20038	35, 4		S6	Sensor	Includes Transmitter Only	20078
Service Pack		W/49mm Black Insert	20039	35, 4	Service Pack			Does Not Include Valve	20023	35, 4
Service Pack		W/51mm Orange Insert	20040	35, 4	Service Pack			W/43mm Silver Insert	20037	35, 4
S5	Sensor	-	20088	71, 8	Service Pack			W/48mm Green Insert	20038	35, 4
	Service Pack	-	20017	71, 8	Service Pack	W/49mm Black Insert		20039	35, 4	
	S6	Sensor	Includes Transmitter Only	20078	35, 4	Service Pack		W/51mm Orange Insert	20040	35, 4
		Service Pack	Does Not Include Valve	20023	35, 4	S8	Sensor	Includes Transmitter Only	20077	35, 4
		Service Pack	W/43mm Silver Insert	20037	35, 4		Service Pack	Does Not Include Valve	20023	35, 4
		Service Pack	W/48mm Green Insert	20038	35, 4		Service Pack	W/43mm Silver Insert	20037	35, 4
Service Pack		W/49mm Black Insert	20039	35, 4	Service Pack		W/48mm Green Insert	20038	35, 4	
Service Pack		W/51mm Orange Insert	20040	35, 4	Service Pack		W/49mm Black Insert	20039	35, 4	
Service Pack	W/51mm Orange Insert	20040	35, 4	Service Pack	W/51mm Orange Insert		20040	35, 4		
S8	Sensor	Includes Transmitter Only	20077	35, 4	TT	Sensor	-	20088	71, 8	
	Service Pack	Does Not Include Valve	20023	35, 4		Service Pack	-	20017	71, 8	
	Service Pack	W/43mm Silver Insert	20037	35, 4	2007					
	Service Pack	W/48mm Green Insert	20038	35, 4	A4, A6	Sensor	Includes Transmitter Only	20078	35, 4	
	Service Pack	W/49mm Black Insert	20039	35, 4		Service Pack	Does Not Include Valve	20023	35, 4	
	Service Pack	W/51mm Orange Insert	20040	35, 4		Service Pack	W/43mm Silver Insert	20037	35, 4	
TT	Sensor	-	20088	71, 8		Service Pack	W/48mm Green Insert	20038	35, 4	
	Service Pack	-	20017	71, 8		Service Pack	W/49mm Black Insert	20039	35, 4	
	Service Pack	-	20017	71, 8		Service Pack	W/51mm Orange Insert	20040	35, 4	
	Service Pack	-	20017	71, 8	Service Pack	-	20017	71, 8		
	Service Pack	-	20017	71, 8	Service Pack	-	20017	71, 8		
	Service Pack	-	20017	71, 8	Service Pack	-	20017	71, 8		

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.
2007 (cont.)					2005 (cont.)				
A8	Sensor	Includes Transmitter Only	20077	35, 4	Allroad Quattro	Sensor	Includes Transmitter Only	20079	35, 4
	Service Pack	Does Not Include Valve	20023	35, 4		Service Pack	Does Not Include Valve	20023	35, 4
	Service Pack	W/43mm Silver Insert	20037	35, 4		Service Pack	W/43mm Silver Insert	20037	35, 4
	Service Pack	W/48mm Green Insert	20038	35, 4		Service Pack	W/48mm Green Insert	20038	35, 4
	Service Pack	W/49mm Black Insert	20039	35, 4		Service Pack	W/49mm Black Insert	20039	35, 4
	Service Pack	W/51mm Orange Insert	20040	35, 4		Service Pack	W/51mm Orange Insert	20040	35, 4
Q7 RS4, S4, S6	Sensor	Includes Transmitter Only	20078	35, 4	S4	Sensor	Includes Transmitter Only	20078	35, 4
	Service Pack	Does Not Include Valve	20023	35, 4		Service Pack	Does Not Include Valve	20023	35, 4
	Service Pack	W/43mm Silver Insert	20037	35, 4		Service Pack	W/43mm Silver Insert	20037	35, 4
	Service Pack	W/48mm Green Insert	20038	35, 4		Service Pack	W/48mm Green Insert	20038	35, 4
	Service Pack	W/49mm Black Insert	20039	35, 4		Service Pack	W/49mm Black Insert	20039	35, 4
	Service Pack	W/51mm Orange Insert	20040	35, 4		Service Pack	W/51mm Orange Insert	20040	35, 4
S8	Sensor	Includes Transmitter Only	20077	35, 4	2004				
	Service Pack	Does Not Include Valve	20023	35, 4	A4	Sensor	Includes Transmitter Only	20078	35, 4
	Service Pack	W/43mm Silver Insert	20037	35, 4		Service Pack	Does Not Include Valve	20023	35, 4
	Service Pack	W/48mm Green Insert	20038	35, 4		Service Pack	W/43mm Silver Insert	20037	35, 4
	Service Pack	W/49mm Black Insert	20039	35, 4		Service Pack	W/48mm Green Insert	20038	35, 4
	Service Pack	W/51mm Orange Insert	20040	35, 4		Service Pack	W/49mm Black Insert	20039	35, 4
Service Pack	W/51mm Orange Insert	20040	35, 4	Service Pack		W/51mm Orange Insert	20040	35, 4	
2006					A8	Sensor	Includes Transmitter Only	20077	35, 4
A4, A6	Sensor	Includes Transmitter Only	20078	35, 4		Service Pack	Does Not Include Valve	20023	35, 4
	Service Pack	Does Not Include Valve	20023	35, 4		Service Pack	W/43mm Silver Insert	20037	35, 4
	Service Pack	W/43mm Silver Insert	20037	35, 4		Service Pack	W/48mm Green Insert	20038	35, 4
	Service Pack	W/48mm Green Insert	20038	35, 4		Service Pack	W/49mm Black Insert	20039	35, 4
	Service Pack	W/49mm Black Insert	20039	35, 4		Service Pack	W/51mm Orange Insert	20040	35, 4
	Service Pack	W/51mm Orange Insert	20040	35, 4	Service Pack	W/51mm Orange Insert	20040	35, 4	
A8	Sensor	Includes Transmitter Only	20077	35, 4	Allroad Quattro	Sensor	Includes Transmitter Only	20079	35, 4
	Service Pack	Does Not Include Valve	20023	35, 4		Service Pack	Does Not Include Valve	20023	35, 4
	Service Pack	W/43mm Silver Insert	20037	35, 4		Service Pack	W/43mm Silver Insert	20037	35, 4
	Service Pack	W/48mm Green Insert	20038	35, 4		Service Pack	W/48mm Green Insert	20038	35, 4
	Service Pack	W/49mm Black Insert	20039	35, 4		Service Pack	W/49mm Black Insert	20039	35, 4
	Service Pack	W/51mm Orange Insert	20040	35, 4		Service Pack	W/51mm Orange Insert	20040	35, 4
S4	Sensor	Includes Transmitter Only	20078	35, 4	S4	Sensor	Includes Transmitter Only	20078	35, 4
	Service Pack	Does Not Include Valve	20023	35, 4		Service Pack	Does Not Include Valve	20023	35, 4
	Service Pack	W/43mm Silver Insert	20037	35, 4		Service Pack	W/43mm Silver Insert	20037	35, 4
	Service Pack	W/48mm Green Insert	20038	35, 4		Service Pack	W/48mm Green Insert	20038	35, 4
	Service Pack	W/49mm Black Insert	20039	35, 4		Service Pack	W/49mm Black Insert	20039	35, 4
	Service Pack	W/51mm Orange Insert	20040	35, 4		Service Pack	W/51mm Orange Insert	20040	35, 4
2005					2003				
A4, A6	Sensor	Includes Transmitter Only	20078	35, 4	A4	Sensor	Includes Transmitter Only	20078	35, 4
	Service Pack	Does Not Include Valve	20023	35, 4		Service Pack	Does Not Include Valve	20023	35, 4
	Service Pack	W/43mm Silver Insert	20037	35, 4		Service Pack	W/43mm Silver Insert	20037	35, 4
	Service Pack	W/48mm Green Insert	20038	35, 4		Service Pack	W/48mm Green Insert	20038	35, 4
	Service Pack	W/49mm Black Insert	20039	35, 4		Service Pack	W/49mm Black Insert	20039	35, 4
	Service Pack	W/51mm Orange Insert	20040	35, 4		Service Pack	W/51mm Orange Insert	20040	35, 4
A8	Sensor	Includes Transmitter Only	20077	35, 4					
	Service Pack	Does Not Include Valve	20023	35, 4					
	Service Pack	W/43mm Silver Insert	20037	35, 4					
	Service Pack	W/48mm Green Insert	20038	35, 4					
	Service Pack	W/49mm Black Insert	20039	35, 4					
	Service Pack	W/51mm Orange Insert	20040	35, 4					

Audi (cont.)

Audi (cont.)

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.
2003 (cont.)					2013				
A8	Sensor	Includes Transmitter Only; Chassis No. 4E3000001 & After	20077	35, 4	Azure, Continental, Mulsanne	Sensor	Includes Transmitter Only	20103	35, 4
	Sensor	Includes Transmitter Only; Chassis No. 4D3004999 & Before	20079	35, 4		Service Pack	Does Not Include Valve	20023	35, 4
	Service Pack	Does Not Include Valve	20023	35, 4		Service Pack	W/43mm Silver Insert	20037	35, 4
	Service Pack	W/43mm Silver Insert	20037	35, 4		Service Pack	W/48mm Green Insert	20038	35, 4
	Service Pack	W/48mm Green Insert	20038	35, 4		Service Pack	W/49mm Black Insert	20039	35, 4
	Service Pack	W/49mm Black Insert	20039	35, 4		Service Pack	W/51mm Orange Insert	20040	35, 4
	Service Pack	W/51mm Orange Insert	20040	35, 4	2012				
	Allroad Quattro	Sensor	Includes Transmitter Only	20079	35, 4	Azure, Continental, Mulsanne	Sensor	Includes Transmitter Only	20103
Service Pack		Does Not Include Valve	20023	35, 4	Service Pack		Does Not Include Valve	20023	35, 4
Service Pack		W/43mm Silver Insert	20037	35, 4	Service Pack		W/43mm Silver Insert	20037	35, 4
Service Pack		W/48mm Green Insert	20038	35, 4	Service Pack		W/48mm Green Insert	20038	35, 4
Service Pack		W/49mm Black Insert	20039	35, 4	Service Pack		W/49mm Black Insert	20039	35, 4
Service Pack		W/51mm Orange Insert	20040	35, 4	Service Pack		W/51mm Orange Insert	20040	35, 4
S8	Sensor	Includes Transmitter Only; Chassis No. 4E3000001 & After	20077	35, 4	2011				
	Sensor	Includes Transmitter Only; Chassis No. 4D3004999 & Before	20079	35, 4	Mulsanne	Sensor	Includes Transmitter Only	20103	35, 4
	Service Pack	Does Not Include Valve	20023	35, 4		Service Pack	Does Not Include Valve	20023	35, 4
	Service Pack	W/43mm Silver Insert	20037	35, 4		Service Pack	W/43mm Silver Insert	20037	35, 4
	Service Pack	W/48mm Green Insert	20038	35, 4		Service Pack	W/48mm Green Insert	20038	35, 4
	Service Pack	W/49mm Black Insert	20039	35, 4		Service Pack	W/49mm Black Insert	20039	35, 4
	Service Pack	W/51mm Orange Insert	20040	35, 4		Service Pack	W/51mm Orange Insert	20040	35, 4
	2002					2010			
A4	Sensor	Includes Transmitter Only	20078	35, 4	Continental	Sensor	Includes Transmitter Only	20078	35, 4
	Service Pack	Does Not Include Valve	20023	35, 4		Service Pack	Does Not Include Valve	20023	35, 4
	Service Pack	W/43mm Silver Insert	20037	35, 4		Service Pack	W/43mm Silver Insert	20037	35, 4
	Service Pack	W/48mm Green Insert	20038	35, 4		Service Pack	W/48mm Green Insert	20038	35, 4
	Service Pack	W/49mm Black Insert	20039	35, 4		Service Pack	W/49mm Black Insert	20039	35, 4
	Service Pack	W/51mm Orange Insert	20040	35, 4		Service Pack	W/51mm Orange Insert	20040	35, 4
A8, Allroad Quattro, S8	Sensor	Includes Transmitter Only	20079	35, 4	2009				
	Service Pack	Does Not Include Valve	20023	35, 4	Azure	Sensor	Includes Transmitter Only	20103	35, 4
	Service Pack	W/43mm Silver Insert	20037	35, 4		Service Pack	Does Not Include Valve	20023	35, 4
	Service Pack	W/48mm Green Insert	20038	35, 4		Service Pack	W/43mm Silver Insert	20037	35, 4
	Service Pack	W/49mm Black Insert	20039	35, 4		Service Pack	W/48mm Green Insert	20038	35, 4
	Service Pack	W/51mm Orange Insert	20040	35, 4		Service Pack	W/49mm Black Insert	20039	35, 4
Service Pack	W/51mm Orange Insert	20040	35, 4	Service Pack		W/51mm Orange Insert	20040	35, 4	
2001					2008				
A8, Allroad Quattro, S8	Sensor	Includes Transmitter Only	20079	35, 4	Azure	Service Pack	Does Not Include Valve	20023	35, 4
	Service Pack	Does Not Include Valve	20023	35, 4		Service Pack	W/43mm Silver Insert	20037	35, 4
	Service Pack	W/43mm Silver Insert	20037	35, 4		Service Pack	W/48mm Green Insert	20038	35, 4
	Service Pack	W/48mm Green Insert	20038	35, 4		Service Pack	W/49mm Black Insert	20039	35, 4
	Service Pack	W/49mm Black Insert	20039	35, 4		Service Pack	W/51mm Orange Insert	20040	35, 4
	Service Pack	W/51mm Orange Insert	20040	35, 4		2008			
2014					2008				
Bentley	Sensor	Includes Transmitter Only	20103	35, 4	Azure	Service Pack	Does Not Include Valve	20023	35, 4
	Service Pack	Does Not Include Valve	20023	35, 4		Service Pack	W/43mm Silver Insert	20037	35, 4
	Service Pack	W/43mm Silver Insert	20037	35, 4		Service Pack	W/48mm Green Insert	20038	35, 4
	Service Pack	W/48mm Green Insert	20038	35, 4		Service Pack	W/49mm Black Insert	20039	35, 4
	Service Pack	W/49mm Black Insert	20039	35, 4		Service Pack	W/51mm Orange Insert	20040	35, 4
	Service Pack	W/51mm Orange Insert	20040	35, 4		2008			

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2008 (cont.)					2013					
Bentley (cont.)	Conti- nental	Sensor	Includes Transmitter Only	20078	35, 4	135I, 135IS, 328I, 335I, 335IS, 528I, 535I, 550I, 640I, 650I, 740I, 740LI, 750I, 750LI, M3, M5, M6, X1, X3, X5, X6, Z4	Sensor	Includes Transmitter Only	28081	31, 3.5
		Service Pack	Does Not Include Valve	20023	35, 4		Service Pack	Does Not Include Valve	20023	31, 3.5
		Service Pack	W/43mm Silver Insert	20037	35, 4		Service Pack	W/43mm Silver Insert	20037	31, 3.5
		Service Pack	W/48mm Green Insert	20038	35, 4		Service Pack	W/48mm Green Insert	20038	31, 3.5
		Service Pack	W/49mm Black Insert	20039	35, 4		Service Pack	W/49mm Black Insert	20039	31, 3.5
		Service Pack	W/51mm Orange Insert	20040	35, 4		Service Pack	W/51mm Orange Insert	20040	31, 3.5
2007					2012					
Bentley (cont.)	Azure	Sensor	Includes Transmitter Only	20103	35, 4	128I, 135I, 328I, 335D, 335I, 335IS, 528I, 535I, 550I, 640I, 650I, 740I, 740LI, 750I, 750LI	Sensor	Includes Transmitter Only	28081	31, 3.5
		Sensor	Includes Transmitter Only	20103	35, 4		Service Pack	Does Not Include Valve	20023	31, 3.5
		Service Pack	Does Not Include Valve	20023	35, 4		Service Pack	W/43mm Silver Insert	20037	31, 3.5
		Service Pack	W/43mm Silver Insert	20037	35, 4		Service Pack	W/48mm Green Insert	20038	31, 3.5
		Service Pack	W/48mm Green Insert	20038	35, 4		Service Pack	W/49mm Black Insert	20039	31, 3.5
		Service Pack	W/49mm Black Insert	20039	35, 4		Service Pack	W/51mm Orange Insert	20040	31, 3.5
Bentley (cont.)	Conti- nental	Sensor	Includes Transmitter Only	20078	35, 4	ActiveE	Sensor	Includes Transmitter Only	28081	31, 3.5
		Service Pack	Does Not Include Valve	20023	35, 4		Sensor	Includes Transmitter Only	28081	31, 3.5
		Service Pack	W/43mm Silver Insert	20037	35, 4		Service Pack	Does Not Include Valve	20023	31, 3.5
		Service Pack	W/48mm Green Insert	20038	35, 4		Service Pack	W/43mm Silver Insert	20037	31, 3.5
		Service Pack	W/49mm Black Insert	20039	35, 4		Service Pack	W/48mm Green Insert	20038	31, 3.5
		Service Pack	W/51mm Orange Insert	20040	35, 4		Service Pack	W/49mm Black Insert	20039	31, 3.5
2006					2011					
Bentley (cont.)	Conti- nental	Sensor	Includes Transmitter Only	20078	35, 4	128I	Sensor	Includes Transmitter Only	20083	31, 3.5
		Service Pack	Does Not Include Valve	20023	35, 4		Service Pack	Does Not Include Valve	20023	31, 3.5
		Service Pack	W/43mm Silver Insert	20037	35, 4		Service Pack	W/43mm Silver Insert	20037	31, 3.5
		Service Pack	W/48mm Green Insert	20038	35, 4		Service Pack	W/48mm Green Insert	20038	31, 3.5
		Service Pack	W/49mm Black Insert	20039	35, 4		Service Pack	W/49mm Black Insert	20039	31, 3.5
		Service Pack	W/51mm Orange Insert	20040	35, 4		Service Pack	W/51mm Orange Insert	20040	31, 3.5
2005-2003					2010					
Bentley (cont.)	Conti- nental	Sensor	Includes Transmitter Only	20077	35, 4	328I, 335D, 335I	Sensor	Includes Transmitter Only	28081	31, 3.5
		Service Pack	Does Not Include Valve	20023	35, 4		Service Pack	Does Not Include Valve	20023	31, 3.5
		Service Pack	W/43mm Silver Insert	20037	35, 4		Service Pack	W/43mm Silver Insert	20037	31, 3.5
		Service Pack	W/48mm Green Insert	20038	35, 4		Service Pack	W/48mm Green Insert	20038	31, 3.5
		Service Pack	W/49mm Black Insert	20039	35, 4		Service Pack	W/49mm Black Insert	20039	31, 3.5
		Service Pack	W/51mm Orange Insert	20040	35, 4		Service Pack	W/51mm Orange Insert	20040	31, 3.5
2014					2009					
BMW	328I, 335I, 335IS	Sensor	Includes Transmitter Only	28126	31, 3.5	535I	Sensor	Includes Transmitter Only		
		Service Pack	Does Not Include Valve	20023	31, 3.5		Service Pack	Does Not Include Valve	20023	31, 3.5
		Service Pack	W/43mm Silver Insert	20037	31, 3.5		Service Pack	W/43mm Silver Insert	20037	31, 3.5
		Service Pack	W/48mm Green Insert	20038	31, 3.5		Service Pack	W/48mm Green Insert	20038	31, 3.5
		Service Pack	W/49mm Black Insert	20039	31, 3.5		Service Pack	W/49mm Black Insert	20039	31, 3.5
		Service Pack	W/51mm Orange Insert	20040	31, 3.5		Service Pack	W/51mm Orange Insert	20040	31, 3.5
	640I, 650I, M6, M6 Gran Coupe, X1, X3, X5, X6, Z4	Sensor	Includes Transmitter Only	28081	31, 3.5	528I, 535I, 550I, 740I, 740LI, 750I, 750LI, 760LI	Sensor	Includes Transmitter Only	28081	31, 3.5
		Service Pack	Does Not Include Valve	20023	31, 3.5		Service Pack	Does Not Include Valve	20023	31, 3.5
		Service Pack	W/43mm Silver Insert	20037	31, 3.5		Service Pack	W/43mm Silver Insert	20037	31, 3.5
		Service Pack	W/48mm Green Insert	20038	31, 3.5		Service Pack	W/48mm Green Insert	20038	31, 3.5
		Service Pack	W/49mm Black Insert	20039	31, 3.5		Service Pack	W/49mm Black Insert	20039	31, 3.5
		Service Pack	W/51mm Orange Insert	20040	31, 3.5		Service Pack	W/51mm Orange Insert	20040	31, 3.5

* Programming Tool Required ** Magnet Required to Activate Sensor

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.
2011 (cont.)					2010 (Cont.)				
Alpina B7	Sensor	Includes Transmitter Only	20080	31, 3.5	M5, M6	Sensor	Includes Transmitter Only	20083	31, 3.5
	Service Pack	Does Not Include Valve	20023	31, 3.5		Service Pack	Does Not Include Valve	20023	31, 3.5
	Service Pack	W/43mm Silver Insert	20037	31, 3.5		Service Pack	W/43mm Silver Insert	20037	31, 3.5
	Service Pack	W/48mm Green Insert	20038	31, 3.5		Service Pack	W/48mm Green Insert	20038	31, 3.5
	Service Pack	W/49mm Black Insert	20039	31, 3.5		Service Pack	W/49mm Black Insert	20039	31, 3.5
	Service Pack	W/51mm Orange Insert	20040	31, 3.5		Service Pack	W/51mm Orange Insert	20040	31, 3.5
M3	Sensor	Includes Transmitter Only	28081	31, 3.5	X3, X5, X6	Sensor	Includes Transmitter Only	20083	35, 4
	Service Pack	Does Not Include Valve	20023	31, 3.5		Service Pack	Does Not Include Valve	20023	35, 4
	Service Pack	W/43mm Silver Insert	20037	31, 3.5		Service Pack	W/43mm Silver Insert	20037	35, 4
	Service Pack	W/48mm Green Insert	20038	31, 3.5		Service Pack	W/48mm Green Insert	20038	35, 4
	Service Pack	W/49mm Black Insert	20039	31, 3.5		Service Pack	W/49mm Black Insert	20039	35, 4
	Service Pack	W/51mm Orange Insert	20040	31, 3.5		Service Pack	W/51mm Orange Insert	20040	35, 4
X3, X5, X6	Sensor	Includes Transmitter Only	20083	35, 4	Z4	Sensor	Includes Transmitter Only	20083	31, 3.5
	Service Pack	Does Not Include Valve	20023	35, 4		Service Pack	Does Not Include Valve	20023	31, 3.5
	Service Pack	W/43mm Silver Insert	20037	35, 4		Service Pack	W/43mm Silver Insert	20037	31, 3.5
	Service Pack	W/48mm Green Insert	20038	35, 4		Service Pack	W/48mm Green Insert	20038	31, 3.5
	Service Pack	W/49mm Black Insert	20039	35, 4		Service Pack	W/49mm Black Insert	20039	31, 3.5
	Service Pack	W/51mm Orange Insert	20040	35, 4		Service Pack	W/51mm Orange Insert	20040	31, 3.5
Z4	Sensor	Includes Transmitter Only	20083	31, 3.5	2009				
	Service Pack	Does Not Include Valve	20023	31, 3.5	128I, 135I, 323I, 328I, 335D, 335I, 528I, 528XI, 535I, 550I, 650I, 750I, 750LI, M3, M5, M6	Sensor	Includes Transmitter Only	20083	31, 3.5
	Service Pack	W/43mm Silver Insert	20037	31, 3.5		Service Pack	Does Not Include Valve	20023	31, 3.5
	Service Pack	W/48mm Green Insert	20038	31, 3.5		Service Pack	W/43mm Silver Insert	20037	31, 3.5
	Service Pack	W/49mm Black Insert	20039	31, 3.5		Service Pack	W/48mm Green Insert	20038	31, 3.5
	Service Pack	W/51mm Orange Insert	20040	31, 3.5		Service Pack	W/49mm Black Insert	20039	31, 3.5
Service Pack	W/51mm Orange Insert	20040	31, 3.5	Service Pack		W/51mm Orange Insert	20040	31, 3.5	
2010					X3, X5, X6	Sensor	Includes Transmitter Only	20083	35, 4
128I, 135I, 323I	Sensor	Includes Transmitter Only	20083	31, 3.5		Service Pack	Does Not Include Valve	20023	35, 4
	Service Pack	Does Not Include Valve	20023	31, 3.5		Service Pack	W/43mm Silver Insert	20037	35, 4
	Service Pack	W/43mm Silver Insert	20037	31, 3.5		Service Pack	W/43mm Silver Insert	20037	35, 4
	Service Pack	W/48mm Green Insert	20038	31, 3.5		Service Pack	W/48mm Green Insert	20038	35, 4
	Service Pack	W/49mm Black Insert	20039	31, 3.5		Service Pack	W/49mm Black Insert	20039	35, 4
	Service Pack	W/51mm Orange Insert	20040	31, 3.5	Service Pack	W/51mm Orange Insert	20040	35, 4	
328I, 335D, 335I, 335XI	Sensor	Includes Transmitter Only	28081	31, 3.5	Z4	Sensor	Includes Transmitter Only	20083	31, 3.5
	Service Pack	Does Not Include Valve	20023	31, 3.5		Service Pack	Does Not Include Valve	20023	31, 3.5
	Service Pack	W/43mm Silver Insert	20037	31, 3.5		Service Pack	W/43mm Silver Insert	20037	31, 3.5
	Service Pack	W/48mm Green Insert	20038	31, 3.5		Service Pack	W/48mm Green Insert	20038	31, 3.5
	Service Pack	W/49mm Black Insert	20039	31, 3.5		Service Pack	W/49mm Black Insert	20039	31, 3.5
	Service Pack	W/51mm Orange Insert	20040	31, 3.5		Service Pack	W/51mm Orange Insert	20040	31, 3.5
528I, 535I, 535XI, 550I, 650I, 750I, 750LI, 760LI	Sensor	Includes Transmitter Only	20083	31, 3.5	2008				
	Service Pack	Does Not Include Valve	20023	31, 3.5	128I, 135I, 323I, 328I, 328XI, 335I, 335XI, 528I, 528XI, 535I, 535XI, 550I, 650I, 750I, 750LI, 760LI, Alpina B7, M3, M5, M6	Sensor	Includes Transmitter Only	20083	31, 3.5
	Service Pack	W/43mm Silver Insert	20037	31, 3.5		Service Pack	Does Not Include Valve	20023	31, 3.5
	Service Pack	W/48mm Green Insert	20038	31, 3.5		Service Pack	W/43mm Silver Insert	20037	31, 3.5
	Service Pack	W/49mm Black Insert	20039	31, 3.5		Service Pack	W/48mm Green Insert	20038	31, 3.5
	Service Pack	W/51mm Orange Insert	20040	31, 3.5		Service Pack	W/49mm Black Insert	20039	31, 3.5
Service Pack	W/51mm Orange Insert	20040	31, 3.5	Service Pack		W/51mm Orange Insert	20040	31, 3.5	
M3	Sensor	Includes Transmitter Only	28081	31, 3.5					
	Service Pack	Does Not Include Valve	20023	31, 3.5					
	Service Pack	W/43mm Silver Insert	20037	31, 3.5					
	Service Pack	W/48mm Green Insert	20038	31, 3.5					
	Service Pack	W/49mm Black Insert	20039	31, 3.5					
	Service Pack	W/51mm Orange Insert	20040	31, 3.5					

SCHRADER 2014 TPMS APPLICATION GUIDE

▪ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2008 (cont.)					2006 (cont.)					
X3, X5, X6	Sensor	Includes Transmitter Only	20083	35, 4	325CI, 325I, 325XI, 330CI, 330I, 330XI (cont.)	Service Pack	W/48mm Green Insert	20038	31, 3.5	
	Service Pack	Does Not Include Valve	20023	35, 4		Service Pack	W/49mm Black Insert	20039	31, 3.5	
	Service Pack	W/43mm Silver Insert	20037	35, 4		Service Pack	W/51mm Orange Insert	20040	31, 3.5	
	Service Pack	W/48mm Green Insert	20038	35, 4		525I, 525XI, 530I, 530XI, 550I, 650I, 750I, 750LI, 760I, 760LI, M3, M5, M6	Sensor	Includes Transmitter Only	20083	31, 3.5
	Service Pack	W/49mm Black Insert	20039	35, 4			Service Pack	Does Not Include Valve	20023	31, 3.5
	Service Pack	W/51mm Orange Insert	20040	35, 4			Service Pack	W/43mm Silver Insert	20037	31, 3.5
Z4	Sensor	Includes Transmitter Only	20083	31, 3.5	Service Pack		W/48mm Green Insert	20038	31, 3.5	
	Service Pack	Does Not Include Valve	20023	31, 3.5	Service Pack		W/49mm Black Insert	20039	31, 3.5	
	Service Pack	W/43mm Silver Insert	20037	31, 3.5	Service Pack		W/51mm Orange Insert	20040	31, 3.5	
	Service Pack	W/48mm Green Insert	20038	31, 3.5	X3, X5	Sensor	Includes Transmitter Only	20083	35, 4	
	Service Pack	W/49mm Black Insert	20039	31, 3.5		Service Pack	Does Not Include Valve	20023	35, 4	
	Service Pack	W/51mm Orange Insert	20040	31, 3.5		Service Pack	W/43mm Silver Insert	20037	35, 4	
2007						Service Pack	W/48mm Green Insert	20038	35, 4	
323I, 328I, 328XI, 335I, 335XI, 525I, 525XI, 530I, 530XI, 550I, 650I, 750I, 750LI, 760LI, Alpina B7, M5, M6	Sensor	Includes Transmitter Only	20083	31, 3.5		Service Pack	W/49mm Black Insert	20039	35, 4	
	Service Pack	Does Not Include Valve	20023	31, 3.5		Service Pack	W/51mm Orange Insert	20040	35, 4	
	Service Pack	W/43mm Silver Insert	20037	31, 3.5	Z4	Sensor	Includes Transmitter Only	20083	31, 3.5	
	Service Pack	W/48mm Green Insert	20038	31, 3.5		Service Pack	Does Not Include Valve	20023	31, 3.5	
	Service Pack	W/49mm Black Insert	20039	31, 3.5		Service Pack	W/43mm Silver Insert	20037	31, 3.5	
	Service Pack	W/51mm Orange Insert	20040	31, 3.5		Service Pack	W/48mm Green Insert	20038	31, 3.5	
X3, X5	Sensor	Includes Transmitter Only	20083	35, 4		Service Pack	W/49mm Black Insert	20039	31, 3.5	
	Service Pack	Does Not Include Valve	20023	35, 4		Service Pack	W/51mm Orange Insert	20040	31, 3.5	
	Service Pack	W/43mm Silver Insert	20037	35, 4	2005					
	Service Pack	W/48mm Green Insert	20038	35, 4	320I, 325CI, 325I, 325XI, 330CI, 330I, 330XI, 525I, 530I, 545I, 645CI, 745I, 745LI, 760I	Sensor	Includes Transmitter Only	20080	31, 3.5	
	Service Pack	W/49mm Black Insert	20039	35, 4		Service Pack	Does Not Include Valve	20023	31, 3.5	
	Service Pack	W/51mm Orange Insert	20040	35, 4		Service Pack	W/43mm Silver Insert	20037	31, 3.5	
Z4	Sensor	Includes Transmitter Only	20083	31, 3.5		Service Pack	W/48mm Green Insert	20038	31, 3.5	
	Service Pack	Does Not Include Valve	20023	31, 3.5		Service Pack	W/49mm Black Insert	20039	31, 3.5	
	Service Pack	W/43mm Silver Insert	20037	31, 3.5		Service Pack	W/51mm Orange Insert	20040	31, 3.5	
	Service Pack	W/48mm Green Insert	20038	31, 3.5	760LI, M3	Sensor	Includes Transmitter Only	20083	31, 3.5	
	Service Pack	W/49mm Black Insert	20039	31, 3.5		Service Pack	Does Not Include Valve	20023	31, 3.5	
	Service Pack	W/51mm Orange Insert	20040	31, 3.5		Service Pack	W/43mm Silver Insert	20037	31, 3.5	
2006						Service Pack	W/48mm Green Insert	20038	31, 3.5	
323I	Sensor	Includes Transmitter Only; Jun. & Newer	20083	31, 3.5		Service Pack	W/49mm Black Insert	20039	31, 3.5	
	Service Pack	Does Not Include Valve; Jun. & Newer	20023	31, 3.5		Service Pack	W/51mm Orange Insert	20040	31, 3.5	
	Service Pack	W/43mm Silver Insert; Jun. & Newer	20037	31, 3.5	X5	Sensor	Includes Transmitter Only	20083	35, 4	
	Service Pack	W/48mm Green Insert; Jun. & Newer	20038	31, 3.5		Service Pack	Does Not Include Valve	20023	35, 4	
	Service Pack	W/49mm Black Insert; Jun. & Newer	20039	31, 3.5		Service Pack	W/43mm Silver Insert	20037	35, 4	
	Service Pack	W/51mm Orange Insert; Jun. & Newer	20040	31, 3.5		Service Pack	W/48mm Green Insert	20038	35, 4	
325CI, 325I, 325XI, 330CI, 330I, 330XI	Sensor	Includes Transmitter Only	20080	31, 3.5		Service Pack	W/49mm Black Insert	20039	35, 4	
	Service Pack	Does Not Include Valve	20023	31, 3.5		Service Pack	W/51mm Orange Insert	20040	35, 4	
	Service Pack	W/43mm Silver Insert	20037	31, 3.5	Z4	Sensor	Includes Transmitter Only	20083	31, 3.5	
						Service Pack	Does Not Include Valve	20023	31, 3.5	
						Service Pack	W/43mm Silver Insert	20037	31, 3.5	
						Service Pack	W/48mm Green Insert	20038	31, 3.5	
						Service Pack	W/49mm Black Insert	20039	31, 3.5	
						Service Pack	W/51mm Orange Insert	20040	31, 3.5	

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2004					2003 (cont.)					
320I, 325CI, 325I, 325XI, 330CI, 330I, 330XI, 525I, 530I, 540I, 545CI, 745I, 745LI, 760I	Sensor	Includes Transmitter Only	20080	31, 3.5	Z4	Sensor	Includes Transmitter Only	20083	31, 3.5	
	Service Pack	Does Not Include Valve	20023	31, 3.5		Service Pack	Does Not Include Valve	20023	31, 3.5	
	Service Pack	W/43mm Silver Insert	20037	31, 3.5		Service Pack	W/43mm Silver Insert	20037	31, 3.5	
	Service Pack	W/48mm Green Insert	20038	31, 3.5		Service Pack	W/48mm Green Insert	20038	31, 3.5	
	Service Pack	W/49mm Black Insert	20039	31, 3.5		Service Pack	W/49mm Black Insert	20039	31, 3.5	
	Service Pack	W/51mm Orange Insert	20040	31, 3.5		Service Pack	W/51mm Orange Insert	20040	31, 3.5	
	Service Pack	W/51mm Orange Insert	20040	31, 3.5		Service Pack	W/51mm Orange Insert	20040	31, 3.5	
	760LI, M3	Sensor	Includes Transmitter Only	20083	31, 3.5	Z8	Sensor	Includes Transmitter Only; W/433 MHz Sensor	20080	31, 3.5
		Service Pack	Does Not Include Valve	20023	31, 3.5		Service Pack	Does Not Include Valve	20023	31, 3.5
		Service Pack	W/43mm Silver Insert	20037	31, 3.5		Service Pack	W/43mm Silver Insert	20037	31, 3.5
Service Pack		W/48mm Green Insert	20038	31, 3.5	Service Pack		W/48mm Green Insert	20038	31, 3.5	
Service Pack		W/49mm Black Insert	20039	31, 3.5	Service Pack		W/49mm Black Insert	20039	31, 3.5	
Service Pack		W/51mm Orange Insert	20040	31, 3.5	Service Pack		W/51mm Orange Insert	20040	31, 3.5	
X5	Sensor	Includes Transmitter Only	28082	35, 4	2002					
	Service Pack	Does Not Include Valve	20023	35, 4	320I, 325CI, 325I, 325XI, 330CI, 330I, 330XI, 525I, 530I, 540I, 545CI, 745I, 745LI, M3, M5	Sensor	Includes Transmitter Only; W/433 MHz Sensor	20080	31, 3.5	
	Service Pack	W/43mm Silver Insert	20037	35, 4		Service Pack	Does Not Include Valve	20023	31, 3.5	
	Service Pack	W/48mm Green Insert	20038	35, 4		Service Pack	W/43mm Silver Insert	20037	31, 3.5	
	Service Pack	W/49mm Black Insert	20039	35, 4		Service Pack	W/48mm Green Insert	20038	31, 3.5	
	Service Pack	W/51mm Orange Insert	20040	35, 4		Service Pack	W/49mm Black Insert	20039	31, 3.5	
Service Pack	W/51mm Orange Insert	20040	35, 4	Service Pack		W/51mm Orange Insert	20040	31, 3.5		
Z4	Sensor	Includes Transmitter Only	20083	31, 3.5	X5	Sensor	Includes Transmitter Only	28082	35, 4	
	Service Pack	Does Not Include Valve	20023	31, 3.5		Service Pack	Does Not Include Valve	20023	35, 4	
	Service Pack	W/43mm Silver Insert	20037	31, 3.5		Service Pack	W/43mm Silver Insert	20037	35, 4	
	Service Pack	W/48mm Green Insert	20038	31, 3.5		Service Pack	W/48mm Green Insert	20038	35, 4	
	Service Pack	W/49mm Black Insert	20039	31, 3.5		Service Pack	W/49mm Black Insert	20039	35, 4	
	Service Pack	W/51mm Orange Insert	20040	31, 3.5		Service Pack	W/51mm Orange Insert	20040	35, 4	
	Service Pack	W/51mm Orange Insert	20040	31, 3.5		Service Pack	W/51mm Orange Insert	20040	35, 4	
2003					Z3	Service Pack	Does Not Include Valve	20023	31, 3.5	
320I, 325CI, 325I, 325XI, 330CI, 330I, 330XI, 525I, 530I, 540I, 545CI, 745I, 745LI, 760LI, M3	Sensor	Includes Transmitter Only	20080	31, 3.5		Service Pack	W/43mm Silver Insert	20037	31, 3.5	
	Service Pack	Does Not Include Valve	20023	31, 3.5		Service Pack	W/48mm Green Insert	20038	31, 3.5	
	Service Pack	W/43mm Silver Insert	20037	31, 3.5		Service Pack	W/49mm Black Insert	20039	31, 3.5	
	Service Pack	W/48mm Green Insert	20038	31, 3.5		Service Pack	W/51mm Orange Insert	20040	31, 3.5	
	Service Pack	W/49mm Black Insert	20039	31, 3.5		Z8	Service Pack	Does Not Include Valve	20023	31, 3.5
	Service Pack	W/51mm Orange Insert	20040	31, 3.5			Service Pack	W/43mm Silver Insert	20037	31, 3.5
	Service Pack	W/51mm Orange Insert	20040	31, 3.5			Service Pack	W/48mm Green Insert	20038	31, 3.5
	Service Pack	W/51mm Orange Insert	20040	31, 3.5			Service Pack	W/49mm Black Insert	20039	31, 3.5
Service Pack	W/51mm Orange Insert	20040	31, 3.5	Service Pack			W/51mm Orange Insert	20040	31, 3.5	
Service Pack	W/51mm Orange Insert	20040	31, 3.5	2001						
M5	Sensor	Includes Transmitter Only; W/433 MHz Sensor	20080	31, 3.5	320I, 325CI, 325I, 325XI, 330CI, 330I, 330XI, 525I, 530I, 540I, 740I, 740LI, 750LI, M3	Service Pack	Does Not Include Valve	20023	31, 3.5	
	Service Pack	Does Not Include Valve	20023	31, 3.5		Service Pack	W/43mm Silver Insert	20037	31, 3.5	
	Service Pack	W/43mm Silver Insert	20037	31, 3.5		Service Pack	W/48mm Green Insert	20038	31, 3.5	
	Service Pack	W/48mm Green Insert	20038	31, 3.5		Service Pack	W/49mm Black Insert	20039	31, 3.5	
	Service Pack	W/49mm Black Insert	20039	31, 3.5		Service Pack	W/51mm Orange Insert	20040	31, 3.5	
	Service Pack	W/51mm Orange Insert	20040	31, 3.5		Service Pack	W/51mm Orange Insert	20040	31, 3.5	
X5	Sensor	Includes Transmitter Only	28082	35, 4						
	Service Pack	Does Not Include Valve	20023	35, 4						
	Service Pack	W/43mm Silver Insert	20037	35, 4						
	Service Pack	W/48mm Green Insert	20038	35, 4						
	Service Pack	W/49mm Black Insert	20039	35, 4						
	Service Pack	W/51mm Orange Insert	20040	35, 4						

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2001 (cont.)					1999-1997					
M5	Sensor	Includes Transmitter Only; W/433 MHz Sensor	20080	31, 3.5	BMW (cont.)	528i, 540i, 740i, 740iL, 750iL	Service Pack	Does Not Include Valve	20023	31, 3.5
	Service Pack	Does Not Include Valve	20023	31, 3.5		Service Pack	W/43mm Silver Insert	20037	31, 3.5	
	Service Pack	W/43mm Silver Insert	20037	31, 3.5		Service Pack	W/48mm Green Insert	20038	31, 3.5	
	Service Pack	W/48mm Green Insert	20038	31, 3.5		Service Pack	W/49mm Black Insert	20039	31, 3.5	
	Service Pack	W/49mm Black Insert	20039	31, 3.5		Service Pack	W/51mm Orange Insert	20040	31, 3.5	
	Service Pack	W/51mm Orange Insert	20040	31, 3.5	2006					
X5	Sensor	Includes Transmitter Only	28082	35, 4	Veyron	Service Pack	Does Not Include Valve	20023	35, 4	
	Service Pack	Does Not Include Valve	20023	35, 4		Service Pack	W/43mm Silver Insert	20037	35, 4	
	Service Pack	W/43mm Silver Insert	20037	35, 4		Service Pack	W/48mm Green Insert	20038	35, 4	
	Service Pack	W/48mm Green Insert	20038	35, 4		Service Pack	W/49mm Black Insert	20039	35, 4	
	Service Pack	W/49mm Black Insert	20039	35, 4		Service Pack	W/51mm Orange Insert	20040	35, 4	
	Service Pack	W/51mm Orange Insert	20040	35, 4	2014					
Z3	Service Pack	Does Not Include Valve	20023	31, 3.5	Enclave	EZ-Sensor	-	33000*	11.5, 1.3	
	Service Pack	W/43mm Silver Insert	20037	31, 3.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	W/48mm Green Insert	20038	31, 3.5		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Service Pack	W/49mm Black Insert	20039	31, 3.5		Sensor	-	20153	11.5, 1.3	
	Service Pack	W/51mm Orange Insert	20040	31, 3.5		Service Pack	-	20008	11.5, 1.3	
	Z8	Service Pack	Does Not Include Valve	20023	31, 3.5	Encore, LaCrosse, Regal, Verano	EZ-Sensor	-	33000*	11.5, 1.3
Service Pack		W/43mm Silver Insert	20037	31, 3.5	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	
Service Pack		W/48mm Green Insert	20038	31, 3.5	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	
Service Pack		W/49mm Black Insert	20039	31, 3.5	Sensor		-	28206	11.5, 1.3	
Service Pack	W/51mm Orange Insert	20040	31, 3.5	Service Pack	-	20008	11.5, 1.3			
2000					2013					
BMW (cont.)	323Ci, 323i, 328Ci, 328i, 528i, 540i, 740i, 740iL, 750iL	Service Pack	Does Not Include Valve	20023	31, 3.5	Enclave	EZ-Sensor	-	33000*	11.5, 1.3
	Service Pack	W/43mm Silver Insert	20037	31, 3.5	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	
	Service Pack	W/48mm Green Insert	20038	31, 3.5	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	
	Service Pack	W/49mm Black Insert	20039	31, 3.5	Sensor		-	20153	11.5, 1.3	
	Service Pack	W/51mm Orange Insert	20040	31, 3.5	Service Pack		-	20008	11.5, 1.3	
M5	Sensor	Includes Transmitter Only; W/433 MHz Sensor	20080	31, 3.5	Encore, LaCrosse, Regal, Verano	EZ-Sensor	-	33000*	11.5, 1.3	
	Service Pack	Does Not Include Valve	20023	31, 3.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	W/43mm Silver Insert	20037	31, 3.5		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Service Pack	W/48mm Green Insert	20038	31, 3.5		Sensor	-	28206	11.5, 1.3	
	Service Pack	W/49mm Black Insert	20039	31, 3.5		Service Pack	-	20008	11.5, 1.3	
	Service Pack	W/51mm Orange Insert	20040	31, 3.5	2012					
X5	Sensor	Includes Transmitter Only	28082	35, 4	Enclave	EZ-Sensor	-	33000*	11.5, 1.3	
	Service Pack	Does Not Include Valve	20023	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	W/43mm Silver Insert	20037	35, 4		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Service Pack	W/48mm Green Insert	20038	35, 4		Sensor	-	20153	11.5, 1.3	
	Service Pack	W/49mm Black Insert	20039	35, 4		Service Pack	-	20008	11.5, 1.3	
	Service Pack	W/51mm Orange Insert	20040	35, 4	LaCrosse, Regal, Verano	EZ-Sensor	-	33000*	11.5, 1.3	
Z3, Z8	Service Pack	Does Not Include Valve	20023	31, 3.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	W/43mm Silver Insert	20037	31, 3.5		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Service Pack	W/48mm Green Insert	20038	31, 3.5		Sensor	-	28206	11.5, 1.3	
	Service Pack	W/49mm Black Insert	20039	31, 3.5	Service Pack	-	20008	11.5, 1.3		
	Service Pack	W/51mm Orange Insert	20040	31, 3.5	2011					
						Enclave	EZ-Sensor	-	33000*	11.5, 1.3
					EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	
					EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	
					Sensor		-	20153	11.5, 1.3	
					Service Pack		-	20008	11.5, 1.3	

* Programming Tool Required

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2011					2009					
Enclave	EZ-Sensor	-	33000*	11.5, 1.3	Allure, Enclave, Lacrosse, Lucerne	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
	Sensor	-	20153	11.5, 1.3		Sensor	-	20153	11.5, 1.3	
	Service Pack	-	20008	11.5, 1.3		Service Pack	-	20008	11.5, 1.3	
LaCrosse	EZ-Sensor	-	33000*	11.5, 1.3	2008					
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Allure, Enclave, Lacrosse	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Sensor	-	28206	11.5, 1.3		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
	Service Pack	-	20008	11.5, 1.3		Sensor	-	20158	62, 7	
				Service Pack		W/Schrader Sensor	20004	62, 7		
Lucerne	EZ-Sensor	-	33000*	11.5, 1.3	Service Pack	W/Siemens Sensor	20030	80, 9		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Lucerne	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Sensor	-	20153	11.5, 1.3		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
	Service Pack	-	20008	11.5, 1.3		Sensor	-	20153	11.5, 1.3	
				Service Pack		-	20008	11.5, 1.3		
Regal	EZ-Sensor	-	33000*	11.5, 1.3	2007					
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Allure, Lacrosse	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Sensor	-	28206	11.5, 1.3		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
	Service Pack	-	20008	11.5, 1.3		Sensor	-	20158	62, 7	
				Service Pack		W/Schrader Sensor	20004	62, 7		
2010					Service Pack	W/Siemens Sensor	20030	80, 9		
Allure	EZ-Sensor	-	33000*	11.5, 1.3	LeSabre, Lucerne	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
	Sensor	-	28206	11.5, 1.3		Sensor	-	20153	11.5, 1.3	
	Service Pack	-	20008	11.5, 1.3		Service Pack	-	20008	11.5, 1.3	
Enclave	EZ-Sensor	-	33000*	11.5, 1.3	Raimier	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
	Sensor	-	20153	11.5, 1.3		Sensor	OEM Part No. 25774006	20116	62, 7	
	Service Pack	-	20008	11.5, 1.3		Service Pack	-	20004	62, 7	
Lacrosse	EZ-Sensor	-	33000*	11.5, 1.3	2014					
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	ATS	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Sensor	-	28206	11.5, 1.3		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
	Service Pack	-	20008	11.5, 1.3		Sensor	-	28206 ¹	11.5, 1.3	
				Service Pack		-	20008	11.5, 1.3		
Lucerne	EZ-Sensor	-	33000*	11.5, 1.3	ATS-V	Sensor	-	28423	62, 7	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	-	20004	62, 7	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7						
	Sensor	-	20153	11.5, 1.3						
	Service Pack	-	20008	11.5, 1.3						

* Programming Tool Required ¹ Schrader OE Sensor

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.
2014 (cont.)					2013 (cont.)				
CTS	EZ-Sensor	-	33000*	11.5, 1.3	Escalade	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	-	28206	11.5, 1.3		Sensor	-	20153	11.5, 1.3
	Service Pack	-	20008	11.5, 1.3		Service Pack	-	20008	11.5, 1.3
CTS - V	EZ-Sensor	When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000	33000*	11.5, 1.3	SRX, XTS	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	-	28423 [†]	62, 7		Sensor	-	28206	11.5, 1.3
	Service Pack	-	20004	62, 7		Service Pack	-	20008	11.5, 1.3
ELR, Escalade, SRX, XTS	EZ-Sensor	-	33000*	11.5, 1.3	2012				
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	CTS	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Sensor	-	28206 [†]	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Service Pack	-	20008	11.5, 1.3		Sensor	OEM Part No. 25920615; Exc. CTS V	20153	11.5, 1.3
				Service Pack		OEM Part No. 15268606; CTS V; W/315 MHz Sensor	20004	62, 7	
2013					CTS - V	Service Pack	OEM Part No. 25920615; Exc. CTS V	20008	11.5, 1.3
ATS	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor	When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	-	28206 ^{††}	11.5, 1.3		Sensor	OEM Part No. 15268606; CTS V; W/315 MHz Sensor	20158	62, 7
	Service Pack	-	20008	11.5, 1.3	Service Pack	OEM Part No. 15268606; CTS V; W/315 MHz Sensor	20004	62, 7	
CTS	EZ-Sensor	-	33000*	11.5, 1.3	Escalade	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	OEM Part No. 25920615; Exc. CTS V	20153	11.5, 1.3		Sensor	-	20153	11.5, 1.3
	Service Pack	OEM Part No. 15268606; CTS V; W/315 MHz Sensor	20004	62, 7		Service Pack	-	20008	11.5, 1.3
CTS - V	EZ-Sensor	When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000	33000*	11.5, 1.3	SRX	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	OEM Part No. 15268606; CTS V; W/315 MHz Sensor	20158	62, 7		Sensor	-	28206	11.5, 1.3
	Service Pack	OEM Part No. 15268606; CTS V; W/315 MHz Sensor	20004	62, 7		Service Pack	-	20008	11.5, 1.3

* Programming Tool Required † Schrader OE Sensor (ELR only) †† Continental OE Sensor

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2011-2010					2009 (cont.)					
CTS	EZ-Sensor	-	33000*	11.5, 1.3	CTS - V	Sensor	OEM Part No. 15268606; CTS V; W/315 MHz Sensor	20158	62, 7	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	OEM Part No. 15268606; CTS V; W/315 MHz Sensor	20004	62, 7	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	DTS, Escalade, SRX	EZ-Sensor	-	33000*	11.5, 1.3	
	Sensor	OEM Part No. 25920615; Exc. CTS V	20153	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	OEM Part No. 15268606; CTS V; W/315 MHz Sensor	20004	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
	Service Pack	OEM Part No. 25920615; Exc. CTS V	20008	11.5, 1.3		Sensor	-	20153	11.5, 1.3	
CTS - V	Sensor	OEM Part No. 15268606; CTS V; W/315 MHz Sensor	20158	62, 7	Service Pack	-	20008	11.5, 1.3		
	Service Pack	OEM Part No. 15268606; CTS V; W/315 MHz Sensor	20004	62, 7	STS	EZ-Sensor	-	33000*	11.5, 1.3	
DTS	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		Sensor	OEM Part No. 25920615; Exc. STS V	20153	11.5, 1.3	
	Sensor	-	20153	11.5, 1.3	Service Pack	OEM Part No. 25920615; Exc. STS V	20008	11.5, 1.3		
	Service Pack	-	20008	11.5, 1.3	STS - V	Sensor	OEM Part No. 25920615; Exc. STS V	20158	11.5, 1.3	
Escalade	EZ-Sensor	-	33000*	11.5, 1.3		XLR	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	EZ-Sensor Service Pack		Almm. Valve	34000	62, 7	
	Sensor	-	20153	11.5, 1.3	Sensor		OEM Part No. 25758220	20076	62, 7	
SRX	EZ-Sensor	-	33000*	11.5, 1.3	Service Pack		-	20004	62, 7	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	2008					
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	CTS	EZ-Sensor	-	33000*	11.5, 1.3	
	Sensor	-	28206	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	-	20008	11.5, 1.3		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
STS	EZ-Sensor	-	33000*	11.5, 1.3		Sensor	-	20153	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	-	20008	11.5, 1.3	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	DTS	EZ-Sensor	-	33000*	11.5, 1.3	
	Sensor	-	20153	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	-	20008	11.5, 1.3		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
2009	EZ-Sensor	-	33000*	11.5, 1.3		Sensor	-	20153	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	20153	11.5, 1.3	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	Service Pack	-	20008	11.5, 1.3		
	Sensor	OEM Part No. 25920615; Exc. CTS V	20153	11.5, 1.3	Escalade	EZ-Sensor	-	33000*	11.5, 1.3	
	Service Pack	OEM Part No. 15268606; CTS V; W/315 MHz Sensor	20004	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	OEM Part No. 25920615; Exc. CTS V	20008	11.5, 1.3		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
* Programming Tool Required										

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2008 (cont.)					2006					
SRX	EZ-Sensor	-	33000*	11.5, 1.3	CTS	Sensor	OEM Part No. 25774006	20116	62, 7	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	-	20004	62, 7	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	DTS	EZ-Sensor	-	33000*	11.5, 1.3	
	Sensor	-	20153	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	-	20008	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Sensor	-	20153	11.5, 1.3		Sensor	-	20158	62, 7	
	STS, XLR	EZ-Sensor	-	33000*	11.5, 1.3	Service Pack	-	20004	62, 7	
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Escalade	EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		Sensor	OEM Part No. 25758220	20076	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
Service Pack		-	20004	62, 7	Sensor		-	20107	62, 7	
Sensor	-	20153	11.5, 1.3	Service Pack	-		20004	62, 7		
2007					SRX	Sensor	OEM Part No. 25774006	20116	62, 7	
CTS	Sensor	OEM Part No. 25774006	20116	62, 7		Service Pack	-	20004	62, 7	
	DTS	Service Pack	-	20004	62, 7	STS, XLR	EZ-Sensor	-	33000*	11.5, 1.3
EZ-Sensor		-	33000*	11.5, 1.3	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	
EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		
EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	Sensor	OEM Part No. 25758220	20076	62, 7		
Sensor		-	20153	11.5, 1.3	Service Pack	-	20004	62, 7		
Sensor		-	20153	11.5, 1.3	2005					
Escalade	Service Pack	-	20008	11.5, 1.3	CTS	Sensor	-	20116	62, 7	
	EZ-Sensor	-	33000*	11.5, 1.3		Service Pack	-	20004	62, 7	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Deville	Sensor	-	20117**	62, 7	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	-	20003	62, 7	
	Sensor	Snap-In Style Only; Schrader Sensor; W/ Rubber Valve Stem	20153	11.5, 1.3	Escalade	EZ-Sensor	-	33000*	11.5, 1.3	
	Sensor	Clamp-In Style Only; TRW Sensor; W/Almnm. Valve Stem	20158	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem	20008	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
Service Pack	Clamp-In Style Only; TRW Sensor; W/Almnm. Valve Stem	20015	80, 9	Sensor		-	20107	62, 7		
SRX	Service Pack	-	20004	62, 7	Service Pack	-	20004	62, 7		
	EZ-Sensor	-	33000*	11.5, 1.3	SRX	Sensor	-	20116	62, 7	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	-	20004	62, 7	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	STS, XLR	EZ-Sensor	-	33000*	11.5, 1.3	
	Sensor	-	20153	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	-	20008	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
Sensor	-	20153	11.5, 1.3	Sensor		OEM Part No. 25758220	20076	62, 7		
STS, XLR	Service Pack	-	20004	62, 7	Service Pack	-	20004	62, 7		
	EZ-Sensor	-	33000*	11.5, 1.3	2004					
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	CTS	Sensor	-	20116	62, 7	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	-	20004	62, 7	
	Sensor	OEM Part No. 25758220	20076	62, 7	Deville	Sensor	-	20117**	62, 7	
Service Pack	-	20004	62, 7	Service Pack		-	20003	62, 7		

* Programming Tool Required ** Magnet Required to Activate Sensor

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.		
2004 (cont.)					2014 (cont.)						
Cadillac (cont.)	Escalade	EZ-Sensor	-	33000*	11.5, 1.3	Impala, Malibu	EZ-Sensor	-	33000*	11.5, 1.3	
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
		Sensor	-	20115	62, 7		Sensor	-	28206	11.5, 1.3	
		Service Pack	-	20004	62, 7		Service Pack	-	20008	11.5, 1.3	
		Service Pack	-	20117**	62, 7		Service Pack	-	33000*	11.5, 1.3	
	Seville	Sensor	-	20117**	62, 7	Silverado Series Pickup	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
		Service Pack	-	20003	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	SRX	Sensor	-	20116	62, 7		Sensor	W/Single Rear Wheels	28206	11.5, 1.3	
		Service Pack	-	20004	62, 7		Service Pack	W/Single Rear Wheels	20008	11.5, 1.3	
	XLR	EZ-Sensor	-	33000*	11.5, 1.3		Sonic, Spark	EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	EZ-Sensor Service Pack	Almnm. Valve		34000	62, 7		
Sensor		OEM Part No. 25758220	20076	62, 7	Sensor	-		28206	11.5, 1.3		
Service Pack		-	20004	62, 7	Service Pack	-		20008	11.5, 1.3		
2003-2001					2014						
Deville, Seville	Sensor	-	20117**	62, 7	Camaro	EZ-Sensor	Exc. ZL1	33000*	11.5, 1.3		
	Service Pack	-	20003	62, 7		EZ-Sensor Service Pack	Rubber Valve; Exc. ZL1	20018	11.5, 1.3		
2014						Camaro - ZL1	EZ-Sensor Service Pack	Almnm. Valve; Exc. ZL1	34000	62, 7	
Chevrolet	Camaro	Sensor	Exc. ZL1	28206			11.5, 1.3	Sensor	Exc. ZL1	28206	11.5, 1.3
		Service Pack	Exc. ZL1	20008			11.5, 1.3	Service Pack	Exc. ZL1	20008	11.5, 1.3
		Camaro - ZL1	Sensor	ZL1	28423		62, 7	Sensor	ZL1	28423	62, 7
			Service Pack	ZL1	20004		62, 7	Service Pack	ZL1	20004	62, 7
		Caprice	EZ-Sensor	-	33000*	11.5, 1.3	Caprice Police Sedan	EZ-Sensor	-	33000*	11.5, 1.3
EZ-Sensor Service Pack	Rubber Valve		20018	11.5, 1.3	Service Pack	-					
EZ-Sensor Service Pack	Almnm. Valve		34000	62, 7	Sensor	-					
Corvette	Sensor	433 MHz WAL	20223		Service Pack	-					
	Service Pack	-			Sensor	-					
Cruze, Equinox	EZ-Sensor	-	33000*	11.5, 1.3	Suburban, Tahoe	EZ-Sensor	-	33000*	11.5, 1.3		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		
	Sensor	-	28206	11.5, 1.3		Sensor	-	28206	11.5, 1.3		
	Service Pack	-	20008	11.5, 1.3		Service Pack	-	20008	11.5, 1.3		
	Express	EZ-Sensor	-	33000*	11.5, 1.3	Traverse	EZ-Sensor	-	33000*	11.5, 1.3	
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7		
Sensor		-	20153	11.5, 1.3	Sensor		-	20153	11.5, 1.3		
Service Pack		-	20008	11.5, 1.3	Service Pack		-	20008	11.5, 1.3		
2013					Volt	EZ-Sensor	-	33000*	11.5, 1.3		
Avalanche	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	-	28206	11.5, 1.3		
	Sensor	-	20153	11.5, 1.3		Service Pack	-	20008	11.5, 1.3		
	Service Pack	-	20008	11.5, 1.3							

* Programming Tool Required ** Magnet Required to Activate Sensor

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2013 (cont.)					2013 (cont.)					
Chevrolet (cont.)	Camaro	EZ-Sensor	Exc. ZL1	33000*	11.5, 1.3	Silverado Series Pickup	EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve; Exc. ZL1	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Almnm. Valve; Exc. ZL1	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		Sensor	Exc. ZL1	28206	11.5, 1.3		Sensor	W/Single Rear Wheels	20153	11.5, 1.3
		Service Pack	Exc. ZL1	20008	11.5, 1.3		Service Pack	W/Single Rear Wheels	20008	11.5, 1.3
	Camaro - ZL1	Sensor	ZL1	28423	62, 7	Sonic, Spark	EZ-Sensor	-	33000*	11.5, 1.3
		Service Pack	ZL1	20004	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Caprice	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	28206	11.5, 1.3
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Service Pack	-	20008	11.5, 1.3	
		Sensor	-	20158	62, 7	Suburban, Tahoe, Traverse	EZ-Sensor	-	33000*	11.5, 1.3
		Service Pack	-	20004	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Captiva	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Sensor	-	20153	11.5, 1.3	
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Service Pack	-	20008	11.5, 1.3	
		Sensor	-	20153	11.5, 1.3	Volt	EZ-Sensor	-	33000*	11.5, 1.3
		Service Pack	-	20008	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Corvette	EZ-Sensor	When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Sensor	-	28206	11.5, 1.3	
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Service Pack	-	20008	11.5, 1.3	
		Sensor	-	20158	62, 7	2012				
		Service Pack	-	20004	62, 7	Avalanche, Aveo	EZ-Sensor	-	33000*	11.5, 1.3
	Cruze, Equinox	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	-	20153	11.5, 1.3
		Sensor	-	28206	11.5, 1.3		Service Pack	-	20008	11.5, 1.3
		Service Pack	-	20008	11.5, 1.3	Camaro	EZ-Sensor	Exc. ZL1	33000*	11.5, 1.3
	Express, Impala	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve; Exc. ZL1	20018	11.5, 1.3
EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	EZ-Sensor Service Pack		Almnm. Valve; Exc. ZL1	34000	62, 7	
EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	Sensor		-	28206	11.5, 1.3	
Sensor		-	20153	11.5, 1.3	Sensor		Exc. ZL1	28206	11.5, 1.3	
Service Pack		-	20008	11.5, 1.3	Service Pack	Exc. ZL1	20008	11.5, 1.3		
Malibu	EZ-Sensor	-	33000*	11.5, 1.3	Camaro - ZL1	Sensor	ZL1	28423	62, 7	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	ZL1	20004	62, 7	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Caprice	EZ-Sensor	-	33000*	11.5, 1.3	
	Sensor	-	28206	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	-	20008	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
					Sensor	-	20158	62, 7		
					Service Pack	-	20004	62, 7		

* Programming Tool Required

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.		
2012 (cont.)					2012 (cont.)						
Chevrolet (cont.)	Captiva	EZ-Sensor	-	33000*	11.5, 1.3	Sonic (cont.)	Sensor	-	28206	11.5, 1.3	
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	-	20008	11.5, 1.3	
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Suburban, Tahoe, Traverse	EZ-Sensor	-	33000*	11.5, 1.3
		Sensor	-	20153	11.5, 1.3			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		Service Pack	-	20008	11.5, 1.3			EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		EZ-Sensor	-	33000*	11.5, 1.3			Sensor	-	20153	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Service Pack	-		20008	11.5, 1.3		
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Volt	EZ-Sensor		-	33000*	11.5, 1.3	
	Sensor	-	20131	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
	Service Pack	-	20006	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		
	Colorado	EZ-Sensor	-	33000*		11.5, 1.3	Sensor	-	28206	11.5, 1.3	
		EZ-Sensor Service Pack	Rubber Valve	20018		11.5, 1.3	Service Pack	-	20008	11.5, 1.3	
EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7		2011					
Sensor		-	20158	62, 7	Avalanche, Aveo	EZ-Sensor	-	33000*	11.5, 1.3		
Service Pack		-	20004	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
Corvette, Corvette Z06		EZ-Sensor	When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000	33000*		11.5, 1.3	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	20153	11.5, 1.3		
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	-	20008	11.5, 1.3		
	Sensor	-	20158	62, 7		Camaro	EZ-Sensor	-	33000*	11.5, 1.3	
	Service Pack	-	20004	62, 7	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3		
	Cruze, Equinox	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	Sensor		-	28206	11.5, 1.3		
EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	Service Pack		-	20008	11.5, 1.3		
Sensor		-	28206	11.5, 1.3	Caprice		EZ-Sensor	-	33000*	11.5, 1.3	
Service Pack		-	20008	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
Express, Impala, Malibu		EZ-Sensor	-	33000*		11.5, 1.3	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	20158	62, 7		
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	-	20004	62, 7		
	Sensor	-	20153	11.5, 1.3		Colorado	EZ-Sensor	-	33000*	11.5, 1.3	
	Service Pack	-	20008	11.5, 1.3	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3		
	Orlando	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	Sensor		-	20131	62, 7		
EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	Service Pack		-	20006	62, 7		
Sensor		-	28206	11.5, 1.3	Corvette, Corvette Z06		EZ-Sensor	When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000	33000*	11.5, 1.3	
Service Pack		-	20008	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
Silverado Series Pickup		EZ-Sensor	-	33000*		11.5, 1.3	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	20158	62, 7		
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	-	20004	62, 7		
	Sensor	W/Single Rear Wheels	20153	11.5, 1.3		Sonic	EZ-Sensor	-	33000*	11.5, 1.3	
	Service Pack	W/Single Rear Wheels	20008	11.5, 1.3	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3		
	Sonic	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	Sensor		-	20158	62, 7		
EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	Service Pack		-	20004	62, 7		

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2011 (cont.)					2010 (cont.)					
Chevrolet (cont.)	Cruze, Equinox	EZ-Sensor		33000*	11.5, 1.3	Corvette, Corvette Z06	EZ-Sensor	When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		Sensor	-	28206	11.5, 1.3		Sensor	-	20158	62, 7
		Service Pack	-	20008	11.5, 1.3		Service Pack	-	20004	62, 7
	Express, HHR, Impala, Malibu	EZ-Sensor	-	33000*	11.5, 1.3	Equinox	EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		Sensor	-	20153	11.5, 1.3		Sensor	-	28206	11.5, 1.3
		Service Pack	-	20008	11.5, 1.3		Service Pack	-	20008	11.5, 1.3
	Silverado Series Pickup	EZ-Sensor	-	33000*	11.5, 1.3	Express	EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		Sensor	W/Single Rear Wheels	20153	11.5, 1.3		Sensor	-	20153	11.5, 1.3
		Service Pack	W/Single Rear Wheels	20008	11.5, 1.3		Service Pack	-	20008	11.5, 1.3
	Suburban, Tahoe, Traverse	EZ-Sensor	-	33000*	11.5, 1.3	HHR	EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		Sensor	-	20153	11.5, 1.3		Sensor	-	28206	11.5, 1.3
		Service Pack	-	20008	11.5, 1.3		Service Pack	-	20008	11.5, 1.3
	Volt	EZ-Sensor	-	33000*	11.5, 1.3	Impala	EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		Sensor	-	28206	11.5, 1.3		Sensor	-	20153	11.5, 1.3
Service Pack		-	20008	11.5, 1.3	Service Pack		-	20008	11.5, 1.3	
2010					Chevrolet (cont.)	Malibu	EZ-Sensor	-	33000*	11.5, 1.3
Avalanche, Aveo	EZ-Sensor	-	33000*	11.5, 1.3			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3			EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7			Sensor	-	20153	11.5, 1.3
	Sensor	-	20153	11.5, 1.3			Service Pack	-	20008	11.5, 1.3
	Service Pack	-	20008	11.5, 1.3		Silverado Series Pickup	EZ-Sensor	-	33000*	11.5, 1.3
Camaro, Cobalt	EZ-Sensor	-	33000*	11.5, 1.3			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3			EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7			Sensor	W/Single Rear Wheels	20153	11.5, 1.3
	Sensor	-	28206	11.5, 1.3			Service Pack	W/Single Rear Wheels	20008	11.5, 1.3
	Service Pack	-	20008	11.5, 1.3		Colorado	EZ-Sensor	-	33000*	11.5, 1.3
EZ-Sensor	-	33000*	11.5, 1.3	EZ-Sensor Service Pack			Rubber Valve	20018	11.5, 1.3	
EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	EZ-Sensor Service Pack			Almnm. Valve	34000	62, 7	
EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Sensor			-	20131	62, 7	
Sensor	-	20131	62, 7	Service Pack			-	20006	62, 7	

* Programming Tool Required

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.
2010 (cont.)					2009 (cont.)				
Suburban, Tahoe, Traverse	EZ-Sensor	-	33000*	11.5, 1.3	Equinox, Express (cont.)	Sensor	-	20158	62, 7
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	W/Schrader Sensor	20004	62, 7
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	W/Siemens Sensor	20030	80, 9
	Sensor	-	20153	11.5, 1.3	HHR	EZ-Sensor	-	33000*	11.5, 1.3
	Service Pack	-	20008	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
2009						EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
Avalanche, Aveo	EZ-Sensor	-	33000*	11.5, 1.3		Sensor	Snap-In Style Only; W/Rubber Valve Stem	20153	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	Clamp-In Style Only; W/Almnm. Valve Stem	20158	62, 7
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Service Pack	Clamp-In Style Only; W/Almnm. Valve Stem	20004	80, 9	
	Sensor	-	20153	11.5, 1.3	Service Pack	Snap-In Style Only; W/Rubber Valve Stem	20008	11.5, 1.3	
	Service Pack	-	20008	11.5, 1.3	Impala, Malibu	EZ-Sensor	-	33000*	11.5, 1.3
Cobalt Cobalt	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	-	20153	11.5, 1.3
	Sensor	Snap-In Style Only; W/Rubber Valve Stem	20153	11.5, 1.3		Service Pack	-	20008	11.5, 1.3
	Service Pack	Clamp-In Style Only; W/Almnm. Valve Stem	20004	80, 9	Silverado Series Pickup	EZ-Sensor	-	33000*	11.5, 1.3
Service Pack	Snap-In Style Only; W/Rubber Valve Stem	20008	11.5, 1.3	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	
Colorado	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	W/Single Rear Wheels	20153	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	W/Single Rear Wheels	20008	11.5, 1.3
	Sensor	-	20131	62, 7	Suburban, Tahoe	EZ-Sensor	-	33000*	11.5, 1.3
	Service Pack	-	20006	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
Corvette, Corvette C6	EZ-Sensor	When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	20153	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	-	20008	11.5, 1.3
	Sensor	-	20076	62, 7	Trail- blazer	Sensor	OEM Part No. 25774006	20116	62, 7
	Service Pack	-	20004	62, 7		Service Pack	-	20004	62, 7
Corvette Z06	EZ-Sensor	When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000	33000*	11.5, 1.3	Traverse	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	-	20076	62, 7		Sensor	-	20153	11.5, 1.3
	Service Pack	-	20004	62, 7		Service Pack	-	20008	11.5, 1.3
Equinox, Express	EZ-Sensor	-	33000*	11.5, 1.3	Uplander	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
						Sensor	-	20158	62, 7
						Service Pack	-	20004	62, 7

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2008					2008 (cont.)					
Chevrolet (cont.)	Avalanche, Aveo	EZ-Sensor	-	33000*	11.5, 1.3	Impala (cont.)	Sensor	-	20153	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	-	20008	11.5, 1.3
		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	Malibu	EZ-Sensor	-	33000*	11.5, 1.3
		Sensor	Snap-In Style Only; Schrader Sensor; W/ Rubber Valve Stem	20153	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		Service Pack	-	20008	11.5, 1.3		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
	Cobalt	EZ-Sensor	-	33000*	11.5, 1.3		Sensor	Snap-In Style Only; W/Rubber Valve Stem	20153	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	Clamp-In Style Only; W/Almm. Valve Stem	20158	62, 7
		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	Service Pack	Clamp-In Style Only; W/Almm. Valve Stem	20004	80, 9	
		Sensor	Snap-In Style Only; W/Rubber Valve Stem	20153	11.5, 1.3	Service Pack	Snap-In Style Only; W/Rubber Valve Stem	20008	11.5, 1.3	
		Sensor	Clamp-In Style Only; W/Almm. Valve Stem	20158	62, 7	Silverado Series Pickup	EZ-Sensor	-	33000*	11.5, 1.3
	Service Pack	Clamp-In Style Only; W/Almm. Valve Stem	20004	80, 9	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	
	Service Pack	Snap-In Style Only; W/Rubber Valve Stem	20008	11.5, 1.3	EZ-Sensor Service Pack		Almm. Valve	34000	62, 7	
Colorado	EZ-Sensor	-	33000*	11.5, 1.3	Sensor		W/Single Rear Wheels	20153	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Service Pack		W/Single Rear Wheels	20008	11.5, 1.3	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	Suburban, Tahoe	EZ-Sensor	-	33000*	11.5, 1.3	
	Sensor	-	20131	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	-	20006	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
Corvette, Corvette C6, Corvette Z06	EZ-Sensor	When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000	33000*	11.5, 1.3		Sensor	-	20153	11.5, 1.3	
	EZ-Sensor	-	33000*	11.5, 1.3		Service Pack	-	20008	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Trail-blazer	Sensor	OEM Part No. 25774006	20116	62, 7	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		Service Pack	-	20004	62, 7	
	Sensor	-	20158	62, 7	Uplander	EZ-Sensor	-	33000*	11.5, 1.3	
Service Pack	W/Schrader Sensor	20004	62, 7	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3		
Service Pack	W/Siemens Sensor	20030	80, 9	EZ-Sensor Service Pack		Almm. Valve	34000	62, 7		
Chevrolet (cont.)	Equinox, Express	EZ-Sensor	-	33000*	11.5, 1.3	Sensor	-	20158	62, 7	
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Service Pack	-	20004	62, 7	
		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	2007				
		Sensor	-	20158	62, 7	Avalanche	EZ-Sensor	-	33000*	11.5, 1.3
		Service Pack	W/Schrader Sensor	20004	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Service Pack	W/Siemens Sensor	20030	80, 9	EZ-Sensor Service Pack		Almm. Valve	34000	62, 7	
	HHR	EZ-Sensor	-	33000*	11.5, 1.3		Sensor	Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem	20153	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	Clamp-In Style Only; TRW Sensor; W/Almm. Valve Stem	20158	62, 7
		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		Service Pack	Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem	20008	11.5, 1.3
		Sensor	Snap-In Style Only; W/Rubber Valve Stem	20153	11.5, 1.3		Service Pack	Clamp-In Style Only; TRW Sensor; W/Almm. Valve Stem	20015	80, 9
		Sensor	Clamp-In Style Only; W/Almm. Valve Stem	20158	62, 7		Impala	EZ-Sensor	-	33000*
	Service Pack	Clamp-In Style Only; W/Almm. Valve Stem	20004	80, 9	EZ-Sensor Service Pack			Rubber Valve	20018	11.5, 1.3
Service Pack	Snap-In Style Only; W/Rubber Valve Stem	20008	11.5, 1.3	EZ-Sensor Service Pack	Almm. Valve	34000		62, 7		

* Programming Tool Required

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.
2007 (cont.)					2007 (cont.)				
Aveo	EZ-Sensor	-	33000*	11.5, 1.3	Silverado Series Pickup (cont.)	Service Pack	Snap-In Style Only; Schrader Sensor; W/ Rubber Valve Stem; Exc. Classic	20008	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	Clamp-In Style Only; TRW Sensor; W/Almm. Valve Stem; Exc. Classic	20015	80, 9
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	Suburban, Tahoe	EZ-Sensor	-	33000*	11.5, 1.3
	Sensor	Hatchback	20153	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Service Pack	-	20008	11.5, 1.3		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
Colorado	EZ-Sensor	-	33000*	11.5, 1.3		Sensor	Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem	20153	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	Clamp-In Style Only; TRW Sensor; W/Almm. Valve Stem	20158	62, 7
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	Service Pack	Snap-In Style Only; Schrader Sensor; W/ Rubber Valve Stem	20008	11.5, 1.3	
	Sensor	-	20131	62, 7	Service Pack	Clamp-In Style Only; TRW Sensor; W/Almm. Valve Stem	20015	80, 9	
	Service Pack	-	20006	62, 7	Trail-blazer	Sensor	OEM Part No. 25774006	20116	62, 7
Corvette, Corvette C6, Corvette Z06	EZ-Sensor	When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000	33000*	11.5, 1.3		Service Pack	-	20004	62, 7
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	2006				
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	Avalanche	EZ-Sensor	-	33000*	11.5, 1.3
	Sensor	-	20076	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Service Pack	-	20004	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
Equinox	EZ-Sensor	-	33000*	11.5, 1.3		Sensor	-	20107	62, 7
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	-	20004	62, 7
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	Corvette, Corvette C6, Corvette Z06	EZ-Sensor	When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000	33000*	11.5, 1.3
	Sensor	-	20158	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Service Pack	W/Schrader Sensor	20004	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
Service Pack	W/Siemens Sensor	20030	80, 9	Sensor		-	20076	62, 7	
Service Pack	-	20004	62, 7	Service Pack		-	20004	62, 7	
Impala, Monte Carlo	EZ-Sensor	-	33000*	11.5, 1.3	Impala, Monte Carlo	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
	Sensor	Snap-In Style Only; W/Rubber Valve Stem	20153	11.5, 1.3		Sensor	W/Alloy Wheels	20158	62, 7
	Sensor	Clamp-In Style Only; W/Almm. Valve Stem	20158	62, 7		Service Pack	W/Alloy Wheels	20004	62, 7
Silverado Series Pickup	Service Pack	Clamp-In Style Only; W/Almm. Valve Stem	20004	62, 7	Silverado Series Pickup	EZ-Sensor	-	33000*	11.5, 1.3
	Service Pack	Snap-In Style Only; W/Rubber Valve Stem	20008	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	20107	62, 7
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		Service Pack	-	20004	62, 7
	Sensor	Classic	20107	62, 7	SSR	EZ-Sensor	-	33000*	11.5, 1.3
	Sensor	Snap-In Style Only; Schrader Sensor; W/ Rubber Valve Stem; Exc. Classic	20153	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Sensor	Clamp-In Style Only; TRW Sensor; W/Almm. Valve Stem; Exc. Classic	20158	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
	Service Pack	Classic	20004	62, 7		Sensor	-	20107	62, 7
						Service Pack	-	20004	62, 7

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2006 (cont.)					2003-2001					
Suburban, Tahoe	EZ-Sensor	-	33000*	11.5, 1.3	Chevrolet (cont.)	Corvette, Corvette C5, Corvette Z06	Sensor	-	20117**	62, 7
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	-	20003	62, 7	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	2000-1997					
	Sensor	-	20107	62, 7	Corvette	Sensor	-	28006**	62, 7	
	Service Pack	-	20004	62, 7		Service Pack	-	20012	62, 7	
Trail- blazer	Sensor	OEM Part No. 25774006	20116	62, 7	2014-2013					
	Service Pack	-	20004	62, 7	200	Sensor	-	28308	11.5, 1.3	
2005						300, Town & Country Van	Service Pack	Rubber Valve	20018	11.5, 1.3
Avalanche	EZ-Sensor	-	33000*	11.5, 1.3	EZ-Sensor		-	33200	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		
	Sensor	-	20107	62, 7	Sensor	-	20398	11.5, 1.3		
	Service Pack	-	20004	62, 7	Service Pack	-	20018	11.5, 1.3		
Corvette, Corvette C6, Corvette Z06	EZ-Sensor	When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000	33000*	11.5, 1.3	2012					
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	200	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Sensor	-	20076	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
	Service Pack	-	20004	62, 7		Sensor	Almm. Valve	20066	58, 6.5	
Service Pack	-	20004	62, 7	Sensor		Rubber Valve	28308	11.5, 1.3		
Silverado Series Pickup, Suburban, Tahoe	EZ-Sensor	-	33000*	11.5, 1.3	Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Service Pack	Almm. Valve	20018	11.5, 1.3		
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5		
	Sensor	-	20107	62, 7	300	EZ-Sensor	-	33200	11.5, 1.3	
	Service Pack	-	20004	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
2004						EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
Avalanche	EZ-Sensor	-	33000*	11.5, 1.3		Sensor	W/Rubber Stem Snap-in Sensor	20398	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	W/Rubber Stem Snap-in Sensor	20008	11.5, 1.3	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	Service Pack	W/Metal Stem Clamp-in Sensor; Does Not Include Stem	20016	58, 6.5		
	Sensor	-	20115	62, 7	Service Pack	W/Metal Stem Clamp-in Sensor; Includes Stem Only	20020	58, 6.5		
	Service Pack	-	20004	62, 7	Town & Country Van	EZ-Sensor	-	33200	11.5, 1.3	
Corvette, Corvette C5, Corvette Z06	Sensor	-	20117**	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
Service Pack	-	20003	62, 7	EZ-Sensor Service Pack		Almm. Valve	34000	62, 7		
Silverado Series Pickup, Suburban, Tahoe	EZ-Sensor	-	33000*	11.5, 1.3		Sensor	-	20398	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	-	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7						
	Sensor	-	20115	62, 7						
	Service Pack	-	20004	62, 7						

* Programming Tool Required ** Magnet Required to Activate Sensor

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.
2011					2010 (cont.)				
200	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3	Town & Country Van	EZ-Sensor	W/433 MHz Sensor	33100	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
	Sensor	-	20066	58, 6.5		Sensor	-	28155	58, 6.5
	Sensor	-	28308	11.5, 1.3		Sensor	-	28434	11.5, 1.3
	Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5		Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5
	Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5		Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5
	Service Pack	W/Siemens Sensor	20030	71, 8		Service Pack	W/Siemens Sensor	20030	71, 8
2010					2009				
300, Town & Country Van	EZ-Sensor		33200	11.5, 1.3	300	EZ-Sensor		33200	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
	Sensor	-	20398	11.5, 1.3		Sensor	-	28291	58, 6.5
	Sensor	-	28291	58, 6.5		Service Pack	Does Not Include Stem	20016	58, 6.5
	Service Pack	Does Not Include Stem	20016	58, 6.5		Service Pack	Includes Stem Only	20020	58, 6.5
	Service Pack	Includes Stem Only	20020	58, 6.5		Service Pack	Includes Stem Only	20020	58, 6.5
	Service Pack	-	20008	11.5, 1.3		Service Pack	-	20008	11.5, 1.3
2010					2008				
300	EZ-Sensor		33200	11.5, 1.3	Aspen, PT Cruiser, Sebring	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
	Sensor	-	20398	11.5, 1.3		Sensor	-	20066	58, 6.5
	Sensor	-	28291	58, 6.5		Sensor	-	28308	11.5, 1.3
	Service Pack	Does Not Include Stem	20016	58, 6.5		Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5
	Service Pack	Includes Stem Only	20020	58, 6.5		Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5
	Service Pack	-	20008	11.5, 1.3		Service Pack	W/Siemens Sensor	20030	71, 8
PT Cruiser	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3	Town & Country Van	EZ-Sensor	W/433 MHz Sensor	33100	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
	Sensor	-	20066	58, 6.5		Sensor	-	28155	58, 6.5
	Sensor	-	28308	11.5, 1.3		Sensor	-	28434	11.5, 1.3
	Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5		Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5
	Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5		Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5
	Service Pack	W/Siemens Sensor	20030	71, 8		Service Pack	W/Siemens Sensor	20030	71, 8
Sebring	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3	300	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33100	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	W/Steel Wheels	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
	Sensor	-	20066	58, 6.5		Sensor	-	28155	58, 6.5
	Sensor	-	28308	11.5, 1.3		Sensor	-	28434	11.5, 1.3
	Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5		Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5
	Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5		Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5
	Service Pack	W/Siemens Sensor	20030	71, 8		Service Pack	W/Siemens Sensor	20030	71, 8

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.		
2008 (cont.)					2007						
Chrysler (cont.)	Aspen	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3	300	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3	
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
		Sensor	-	20066	58, 6.5		Sensor	-	20066	58, 6.5	
		Sensor	-	28308	11.5, 1.3		Sensor	-	28155	58, 6.5	
		Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5		Sensor	-	28308	11.5, 1.3	
		Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5		Sensor	-	28434	11.5, 1.3	
		Service Pack	W/Siemens Sensor	20030	71, 8		Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5	
	Crossfire	EZ-Sensor	W/315 MHz Sensor. Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3		Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5	
		EZ-Sensor	W/433 MHz Sensor	33100	11.5, 1.3		Service Pack	W/Siemens Sensor	20030	71, 8	
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Aspen	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		Sensor	-	20028**	35, 4			EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		Service Pack	W/Schrader Sensor	20003	35, 4			Sensor	-	20066	58, 6.5
		Service Pack	W/Siemens Sensor	20030	35, 4			Sensor	-	28308	11.5, 1.3
		Pacifica, PT Cruiser, Sebring	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*			11.5, 1.3	Service Pack	W/Schrader Sensor; Does Not Include Stem	20013
	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	Service Pack		W/Schrader Sensor; Includes Stem Only	20020	58, 6.5	
	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	Service Pack		W/Siemens Sensor	20030	71, 8	
	Sensor		-	20066	58, 6.5	Crossfire	EZ-Sensor	W/315 MHz Sensor. Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3	
	Sensor		-	28308	11.5, 1.3		EZ-Sensor	W/433 MHz Sensor	33100	11.5, 1.3	
	Service Pack		W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack		W/Schrader Sensor; Includes Stem Only	20020	58, 6.5		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Service Pack		W/Siemens Sensor	20030	71, 8		Sensor	-	20028**	35, 4	
	Town & Country Van	EZ-Sensor	W/315 MHz Sensor. Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3		Service Pack	W/Schrader Sensor	20003	35, 4	
		EZ-Sensor	W/433 MHz Sensor	33100	11.5, 1.3		Service Pack	W/Siemens Sensor	20030	35, 4	
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Chrysler (cont.)	Pacifica, Sebring, Town & Country Van	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	EZ-Sensor Service Pack			Rubber Valve	20018	11.5, 1.3
		Sensor	-	20066	58, 6.5	EZ-Sensor Service Pack			Almnm. Valve	34000	62, 7
Sensor		-	28155	58, 6.5	Sensor	-			20066	58, 6.5	
Sensor		-	28308	11.5, 1.3	Sensor	-			28308	11.5, 1.3	
Sensor		-	28434	11.5, 1.3	Service Pack	W/Schrader Sensor; Does Not Include Stem			20013	58, 6.5	
Service Pack		W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5	Service Pack	W/Schrader Sensor; Includes Stem Only			20020	58, 6.5	
Service Pack		W/Schrader Sensor; Includes Stem Only	20020	58, 6.5	Service Pack	W/Siemens Sensor			20030	71, 8	
Service Pack		W/Siemens Sensor	20030	71, 8							

* Programming Tool Required ** Magnet Required to Activate Sensor

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2006					2005 (cont.)					
300	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3	Crossfire (cont.)	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor		20028**	35, 4	
	Sensor	-	20066	58, 6.5		Sensor		20066	58, 6.5	
	Sensor	-	28308	11.5, 1.3		Service Pack		28308	11.5, 1.3	
	Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5		Service Pack		20003	35, 4	
	Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5		Service Pack		20013	58, 6.5	
	Service Pack	W/Siemens Sensor	20030	71, 8		Service Pack		20020	58, 6.5	
	Crossfire	EZ-Sensor	W/315 MHz Sensor. Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3	Pacifica, Town & Country Van	Sensor	-	20335	71, 8
		EZ-Sensor	W/433 MHz Sensor	33100	11.5, 1.3		Service Pack	-	20030	71, 8
EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	2004					
EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	300M	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33100	11.5, 1.3	
Sensor		-	20028**	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
Service Pack		W/Schrader Sensor	20003	35, 4		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
Service Pack		W/Siemens Sensor	20030	35, 4		Sensor	-	20028**	35, 4	
Pacifica, Town & Country Van		EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*		11.5, 1.3	Service Pack	W/Schrader Sensor	20003	35, 4
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	W/Siemens Sensor	20030	35, 4	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Concorde, Crossfire, Intrepid	EZ-Sensor		33100	11.5, 1.3
	Sensor	-	20066	58, 6.5			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Sensor	-	28308	11.5, 1.3	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	
	Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5	Sensor		-	20028**	35, 4	
	Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5	Service Pack		W/Schrader Sensor	20003	35, 4	
	Service Pack	W/Siemens Sensor	20030	71, 8	Service Pack		W/Siemens Sensor	20030	35, 4	
300	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3	Pacifica		EZ-Sensor	W/ 433 MHz sensor. Caution: Pressure by location vehicles not supported by EZ-sensor	33100	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Sensor	-	20066	58, 6.5		Sensor	OEM Part No. 52088990AC	20028**	35, 4	
	Sensor	-	28308	11.5, 1.3		Sensor	OEM Part No. 04727392AD	20335	71, 8	
	Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5		Service Pack	W/Schrader Sensor	20003	35, 4	
	Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5		Service Pack	W/Siemens Sensor	20030	71, 8	
	Service Pack	W/Siemens Sensor	20030	71, 8		Town & Country Van	Sensor	-	20335	71, 8
	Crossfire	EZ-Sensor	W/315 MHz Sensor. Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3		Service Pack	-	20030	71, 8
		EZ-Sensor	W/433 MHz Sensor	33100	11.5, 1.3	2003				
300M	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33100	11.5, 1.3	300M	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33100	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Sensor	-	20028**	35, 4		Sensor	-	20028**	35, 4	
	Service Pack	W/Schrader Sensor	20003	35, 4		Service Pack	W/Schrader Sensor	20003	35, 4	
	Service Pack	W/Siemens Sensor	20030	35, 4		Service Pack	W/Siemens Sensor	20030	35, 4	

* Programming Tool Required ** Magnet Required to Activate Sensor

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2003 (cont.)					2002 (cont.)					
Concorde, Intrepid	EZ-Sensor		33100	11.5, 1.3	Town & Country Van, Voyager (cont.)	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	-	20028**	35, 4	
	Sensor	-	20028**	35, 4		Service Pack	-	20003	35, 4	
	Service Pack	W/Schrader Sensor	20003	35, 4	2001					
	Service Pack	W/Siemens Sensor	20030	35, 4	Prowler	Sensor	-	28004	35, 4	
Pacifica	EZ-Sensor	W/ 433 MHz sensor. Caution: Pressure by location vehicles not supported by EZ-sensor	33100	11.5, 1.3		Service Pack	W/Red Sensor Body	20003	35, 4	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	W/Black Sensor Body	20012	35, 4	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	2014					
	Sensor	OEM Part No. 52088990AC	20028**	35, 4	Avenger	Sensor	-	28308	11.5, 1.3	
	Service Pack	W/Schrader Sensor	20003	35, 4		Service Pack		20018	11.5, 1.3	
	Town & Country Van, Voyager	EZ-Sensor		33100	11.5, 1.3	Challenger	EZ-Sensor		33200	11.5, 1.3
EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	
EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	
Sensor		-	20028**	35, 4	Sensor	W/Rubber Stem Snap-in Sensor	20398	11.5, 1.3		
Service Pack		-	20003	35, 4	Service Pack	W/Rubber Stem Snap-in Sensor	20018	11.5, 1.3		
2002					Charger	EZ-Sensor		33200	11.5, 1.3	
300M	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33100	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	-	20398	11.5, 1.3	
	Sensor	-	20028**	35, 4		Service Pack	-	20018	11.5, 1.3	
	Service Pack	W/Schrader Sensor	20003	35, 4		Dart	Sensor	-	28586 ^{††}	
	Service Pack	W/Siemens Sensor	20030	35, 4			Service Pack	-	20043 [†]	
Concorde, Intrepid	EZ-Sensor		33100	11.5, 1.3		Durango, Grand Caravan	EZ-Sensor		33200	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7			EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	-	20028**	35, 4	Sensor		-	20398	11.5, 1.3	
	Service Pack	W/Schrader Sensor	20003	35, 4	Service Pack	-	20018	11.5, 1.3		
	Service Pack	W/Siemens Sensor	20030	35, 4	Journey	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33200	11.5, 1.3	
Prowler	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33100	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	-	20398	11.5, 1.3	
	Sensor	-	20028**	35, 4	Service Pack	-	20018	11.5, 1.3		
	Service Pack	W/Schrader Sensor	20003	35, 4	Ram Pro- master	Sensor	-			
	Service Pack	W/Siemens Sensor	20030	35, 4		Service Pack	-			
Town & Country Van, Voyager	EZ-Sensor		33100	11.5, 1.3	Ram Series Pickup	Sensor	-	28984	N/A	
						Service Pack	-			
2013					Avenger	Sensor	-	28308	11.5, 1.3	
						Service Pack		20018	11.5, 1.3	

** Magnet Required to Activate Sensor † Continental Rubber Clip-in Valve †† Continental Rubber Valve Sensor

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.		
2013 (cont.)					2012 (cont.)						
Dodge (cont.)	Challenger	EZ-Sensor		33200	11.5, 1.3	Dodge (cont.)	Challenger	EZ-Sensor		33200	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7			EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		Sensor	W/Rubber Stem Snap-in Sensor	20398	11.5, 1.3			Sensor	W/Rubber Stem Snap-in Sensor	20398	11.5, 1.3
		Service Pack	W/Rubber Stem Snap-in Sensor	20018	11.5, 1.3			Sensor	W/Metal Stem Clamp-in Sensor	28291	58, 6.5
	Charger	EZ-Sensor		33200	11.5, 1.3		Service Pack	W/Rubber Stem Snap-in Sensor	20008	11.5, 1.3	
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	W/Metal Stem Clamp-in Sensor; Does Not Include Stem	20016	58, 6.5	
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	W/Metal Stem Clamp-in Sensor; Includes Stem Only	20020	58, 6.5	
		Sensor	-	20398	11.5, 1.3		Charger	EZ-Sensor		33200	11.5, 1.3
		Service Pack	-	20018	11.5, 1.3			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
Dart	Sensor	-	28586 ^{††}		EZ-Sensor Service Pack	Almnm. Valve		34000	62, 7		
	Service Pack	-	20043		Sensor	-		20398	11.5, 1.3		
	Durango, Grand Caravan	EZ-Sensor		33200	11.5, 1.3	Service Pack		-	20018	11.5, 1.3	
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Dart	Sensor	-	28586 ^{††}		
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	-	20043		
Sensor		-	20398	11.5, 1.3	Durango, Grand Caravan	EZ-Sensor		33200	11.5, 1.3		
Service Pack		-	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
Journey	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33200	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	20398	11.5, 1.3		
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	-	20018	11.5, 1.3		
	Sensor	-	20398	11.5, 1.3	Journey	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33200	11.5, 1.3		
	Service Pack	-	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
Ram Series Pickup	EZ-Sensor		33200	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	20398	11.5, 1.3		
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	-	20018	11.5, 1.3		
	Sensor	-	20398	11.5, 1.3	Nitro	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3		
	Service Pack	-	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
2012						EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		
Avenger, Caliber	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3		Sensor	-	20066	58, 6.5		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	28308	11.5, 1.3		
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Service Pack	Does Not Include Stem	20013	58, 6.5			
	Sensor	-	20066	58, 6.5	Service Pack	Includes Stem Only	20020	58, 6.5			
	Sensor	-	28308	11.5, 1.3	Ram 4500HD, Ram Series Pickup	EZ-Sensor		33200	11.5, 1.3		
	Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
	Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		
				Sensor		-	20398	11.5, 1.3			
				Service Pack		-	20018	11.5, 1.3			

* Programming Tool Required †† Continental Rubber Valve Sensor

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.			
2011					2011 (cont.)							
Dodge (cont.)	Avenger, Caliber	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3	Journey (cont.)	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	20398	11.5, 1.3		
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	-	20008	11.5, 1.3		
		Sensor	-	20066	58, 6.5	Magnum	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33100	11.5, 1.3		
		Sensor	-	28308	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
		Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		
		Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5		Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	20398	58, 6.5		
	Challenger	EZ-Sensor		33200	11.5, 1.3		Service Pack		20018	11.5, 1.3		
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Nitro	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3	
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
		Sensor	W/Rubber Stem Snap-in Sensor	20398	11.5, 1.3	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7		
		Sensor	W/Metal Stem Clamp-in Sensor	28291	58, 6.5	Sensor		-	20066	58, 6.5		
		Service Pack	W/Rubber Stem Snap-in Sensor	20008	11.5, 1.3	Sensor		-	28308	11.5, 1.3		
		Service Pack	W/Metal Stem Clamp-in Sensor; Does Not Include Stem	20016	58, 6.5	Service Pack		Does Not Include Stem	20013	58, 6.5		
	Service Pack	W/Metal Stem Clamp-in Sensor; Includes Stem Only	20020	58, 6.5	Service Pack	Includes Stem Only		20020	58, 6.5			
	Charger	EZ-Sensor		33200	11.5, 1.3	Ram Series Pickup	EZ-Sensor		33200	11.5, 1.3		
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		
		Sensor	W/Rubber Stem Snap-in Sensor	20398	11.5, 1.3		Sensor	W/Rubber Stem Snap-in Sensor	20398	11.5, 1.3		
		Service Pack	W/Rubber Stem Snap-in Sensor	20008	11.5, 1.3	Service Pack	W/Rubber Stem Snap-in Sensor	20008	11.5, 1.3			
		Dakota	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3	Viper	EZ-Sensor	When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000	33100	11.5, 1.3	
			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7		
	Sensor		-	28308	58, 6.5	Sensor		-	20028**	35, 4		
	Service Pack		Includes Stem Only	20008	11.5, 1.3	Service Pack		-	20003	35, 4		
	Durango, Grand Caravan		EZ-Sensor		33200	11.5, 1.3		2010				
			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Avenger	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	EZ-Sensor Service Pack	Rubber Valve		20018	11.5, 1.3		
Sensor		-	20398	11.5, 1.3	EZ-Sensor Service Pack	Almnm. Valve	34000		62, 7			
Service Pack		-	20008	11.5, 1.3	Sensor	-	20066		58, 6.5			
Journey	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33200	11.5, 1.3	Sensor	-	28308		11.5, 1.3			
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Service Pack	W/Schrader Sensor; Does Not Include Stem	20013		58, 6.5			
					Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5				

* Programming Tool Required ** Magnet Required to Activate Sensor

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.			
2010 (cont.)					2010 (cont.)							
Dodge (cont.)	Caliber	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3	Grand Caravan (cont.)	Sensor	-	28155	58, 6.5		
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	28434	11.5, 1.3		
		EZ-Sensor Service Pack	Alnm. Valve	34000	62, 7		Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5		
		Sensor	-	20066	58, 6.5		Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5		
		Sensor	-	28308	11.5, 1.3		Service Pack	W/Siemens Sensor	20030	71, 8		
		Dodge (cont.)	Challenger, Charger	Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5	Journey	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33100	11.5, 1.3
				Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
				Service Pack	W/Siemens Sensor	20030	71, 8		EZ-Sensor Service Pack	Alnm. Valve	34000	62, 7
				EZ-Sensor		33200	11.5, 1.3		Sensor	-	20398	11.5, 1.3
				EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	28155	58, 6.5
EZ-Sensor Service Pack	Alnm. Valve			34000	62, 7	Sensor	-		28434	11.5, 1.3		
Sensor	W/Rubber Stem Snap-in Sensor			20398	11.5, 1.3	Service Pack	-		20008	11.5, 1.3		
Sensor	W/Metal Stem Clamp-in Sensor			28291	58, 6.5	Service Pack	W/Schrader Sensor; Does Not Include Stem		20013	58, 6.5		
Service Pack	W/Rubber Stem Snap-in Sensor			20008	11.5, 1.3	Service Pack	W/Schrader Sensor; Includes Stem Only		20020	58, 6.5		
Service Pack	W/Metal Stem Clamp-in Sensor; Does Not Include Stem			20016	58, 6.5	Service Pack	W/Siemens Sensor		20030	71, 8		
Dodge (cont.)	Dakota	Service Pack	W/Metal Stem Clamp-in Sensor; Includes Stem Only	20020	58, 6.5	Magnum	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33100	11.5, 1.3		
		EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Alnm. Valve	34000	62, 7		
		EZ-Sensor Service Pack	Alnm. Valve	34000	62, 7		Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	20398	58, 6.5		
		Sensor	-	28154	58, 6.5		Service Pack		20018	11.5, 1.3		
		Sensor	-	28461	11.5, 1.3		Nitro	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3	
		Service Pack	Does Not Include Stem	20013	58, 6.5			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
		Service Pack	Includes Stem Only	20020	58, 6.5			EZ-Sensor Service Pack	Alnm. Valve	34000	62, 7	
		EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3			Sensor	-	20066	58, 6.5	
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3			Sensor	-	28308	11.5, 1.3	
EZ-Sensor Service Pack	Alnm. Valve	34000	62, 7	Service Pack	Does Not Include Stem	20013		58, 6.5				
Sensor	-	20066	58, 6.5	Service Pack	Includes Stem Only	20020		58, 6.5				
Sensor	-	28308	11.5, 1.3	Ram Series Pickup	EZ-Sensor			33200	11.5, 1.3			
Service Pack	Does Not Include Stem	20013	58, 6.5		EZ-Sensor Service Pack	Rubber Valve		20018	11.5, 1.3			
Service Pack	Includes Stem Only	20020	58, 6.5		EZ-Sensor Service Pack	Alnm. Valve		34000	62, 7			
EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33100	11.5, 1.3		Sensor	W/Rubber Stem Snap-in Sensor	20398	11.5, 1.3				
EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	1500, 2500; W/Metal Stem Clamp-in Sensor	28155	58, 6.5				
EZ-Sensor Service Pack	Alnm. Valve	34000	62, 7		Sensor	W/Rubber Stem Snap-in Sensor	28434	11.5, 1.3				
Dodge (cont.)	Grand Caravan	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33100	11.5, 1.3	Service Pack	W/Rubber Stem Snap-in Sensor	20008	11.5, 1.3			
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3							
		EZ-Sensor Service Pack	Alnm. Valve	34000	62, 7							

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.		
2010 (cont.)					2009 (cont.)						
Ram Series Pickup (cont.)	Service Pack	1500, 2500; W/Metal Stem Clamp-in Sensor; Does Not Include Stem	20013	58, 6.5	Durango	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3		
	Service Pack	1500, 2500; W/Metal Stem Clamp-in Sensor; Includes Stem Only	20020	58, 6.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
Sprinter	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	20066	58, 6.5		
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	-	28308	11.5, 1.3		
	Sensor	-	20089	53, 6		Service Pack	Does Not Include Stem	20013	58, 6.5		
	Service Pack	Includes Valve	20036	53, 6		Service Pack	Includes Stem Only	20020	58, 6.5		
	EZ-Sensor	When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000	33100	11.5, 1.3		Grand Caravan, Journey	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33100	11.5, 1.3	
EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	EZ-Sensor Service Pack			Rubber Valve	20018	11.5, 1.3		
EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	EZ-Sensor Service Pack			Almnm. Valve	34000	62, 7		
Sensor	-	20028**	35, 4	Sensor	-		28155	58, 6.5			
Service Pack	-	20003	35, 4	Sensor	-		28434	11.5, 1.3			
2009					Service Pack		W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5		
Dodge (cont.)	Avenger, Caliber	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3		Service Pack	Includes Stem Only	20020	58, 6.5	
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	W/Siemens Sensor	20030	71, 8	
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Magnum	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33100	11.5, 1.3
		Sensor	-	20066	58, 6.5			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		Sensor	-	28308	11.5, 1.3	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	
		Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5	Sensor		Caution: Pressure by location vehicles not supported by EZ-sensor	28291	58, 6.5	
		Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5	Service Pack		W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5	
		Service Pack	W/Siemens Sensor	20030	71, 8	Service Pack		Does Not Include Stem	20016	58, 6.5	
	Challenger, Charger	EZ-Sensor		33200	11.5, 1.3	Service Pack		W/Siemens Sensor	20030	71, 8	
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Nitro		EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3
EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	EZ-Sensor Service Pack			Rubber Valve	20018	11.5, 1.3	
Sensor		-	28291	58, 6.5	EZ-Sensor Service Pack			Almnm. Valve	34000	62, 7	
Service Pack		Does Not Include Stem	20016	58, 6.5	Sensor		-	20066	58, 6.5		
Service Pack		Includes Stem Only	20020	58, 6.5	Sensor		-	28308	11.5, 1.3		
Dakota	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3	Service Pack		Does Not Include Stem	20013	58, 6.5		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Service Pack		Includes Stem Only	20020	58, 6.5		
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Ram Series Pickup		EZ-Sensor	1500, 2500. Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3	
	Sensor	-	28154	58, 6.5			EZ-Sensor Service Pack	1500, 2500; Rubber Valve	20018	11.5, 1.3	
	Sensor	-	28461	11.5, 1.3			EZ-Sensor Service Pack	1500, 2500; Almnm. Valve	34000	62, 7	
	Service Pack	Does Not Include Stem	20013	58, 6.5		Sensor	1500, 2500	28155	58, 6.5		
	Service Pack	Includes Stem Only	20020	58, 6.5							

* Programming Tool Required ** Magnet Required to Activate Sensor

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.		
2009 (cont.)					2008 (cont.)						
Ram Series Pickup (cont.)	Sensor	1500, 2500	28434	11.5, 1.3	Charger (cont.)	Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5		
	Service Pack	1500, 2500; Does Not Include Stem	20013	58, 6.5		Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5		
	Service Pack	1500, 2500; Includes Stem Only	20020	58, 6.5		Service Pack	W/Siemens Sensor	20030	71, 8		
Sprinter	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3	Dakota	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		
	Sensor	-	20089	53, 6		Sensor	-	28154	58, 6.5		
	Service Pack	Includes Valve	20036	53, 6		Sensor	-	28461	11.5, 1.3		
Viper	EZ-Sensor	When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000	33100	11.5, 1.3	Service Pack	Does Not Include Stem	20013	58, 6.5			
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Service Pack	Includes Stem Only	20020	58, 6.5			
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	Durango	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3		
	Sensor	-	20028**	35, 4	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3			
	Service Pack	-	20003	35, 4	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7			
2008					Dodge (cont.)	Grand Caravan, Magnum	Sensor	-	20066	58, 6.5	
Avenger, Caliber	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3			Sensor	-	28308	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3			Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7			Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5	
	Sensor	-	20066	58, 6.5			Service Pack	W/Siemens Sensor	20030	71, 8	
	Sensor	-	28308	11.5, 1.3			EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33100	11.5, 1.3	
	Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5			EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
Service Pack	W/Siemens Sensor	20030	71, 8	Sensor			-	28155	58, 6.5		
Chal- lenger	EZ-Sensor		33200	11.5, 1.3			Sensor	-	28434	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3			Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7			Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5	
	Sensor	W/433 MHz sensor.	28155	58, 6.5			Service Pack	W/Siemens Sensor	20030	71, 8	
	Sensor	W/433 MHz sensor.	28434	11.5, 1.3			Nitro	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3
	Sensor	-	28291	58, 6.5				EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Service Pack	Does Not Include Stem	20016	58, 6.5	EZ-Sensor Service Pack	Almm. Valve		34000	62, 7		
Service Pack	Includes Stem Only	20020	58, 6.5	Sensor	-	20066		58, 6.5			
Sensor	-	28291	58, 6.5	Sensor	-	28308		11.5, 1.3			
Charger	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33100	11.5, 1.3	Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5			
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5			
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	Service Pack	W/Siemens Sensor	20030	71, 8			
	Sensor	-	28155	58, 6.5							
	Sensor	-	28434	11.5, 1.3							

* Programming Tool Required ** Magnet Required to Activate Sensor

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2008 (cont.)					2007 (cont.)					
Dodge (cont.)	Ram Series Pickup	EZ-Sensor	1500, 2500. Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3	Stratus	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3
		EZ-Sensor Service Pack	1500, 2500; Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	1500, 2500; Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
		Sensor	1500, 2500	28154	58, 6.5		Sensor	-	20066	58, 6.5
		Sensor	1500, 2500	28461	11.5, 1.3		Service Pack	Does Not Include Stem	20013	58, 6.5
		Service Pack	1500, 2500; Does Not Include Stem	20013	58, 6.5		Service Pack	Includes Stem Only	20020	58, 6.5
		Service Pack	1500, 2500; Includes Stem Only	20020	58, 6.5	2006				
	Sprinter	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3	Caravan, Charger, Grand Caravan, Magnum	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
Sensor		-	20089	53, 6	Sensor		-	20066	58, 6.5	
Sensor		-	20028**	35, 4	Sensor		-	28308	11.5, 1.3	
Service Pack		Includes Valve	20036	53, 6	Service Pack		W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5	
Viper	EZ-Sensor	When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000	33100	11.5, 1.3	Service Pack		W/Schrader Sensor; Includes Stem Only	20020	58, 6.5	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Service Pack		W/Schrader Sensor; Includes Stem Only	20020	58, 6.5	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	Service Pack		W/Siemens Sensor	20030	71, 8	
	Sensor	-	20028**	35, 4	Viper		EZ-Sensor	When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000	33100	11.5, 1.3
	Service Pack	-	20003	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	2007					EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
Dodge (cont.)	Caliber, Caravan, Charger, Durango, Grand Caravan, Magnum, Nitro	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*		11.5, 1.3	Sensor	-	20028**	35, 4
		EZ-Sensor Service Pack	Rubber Valve	20018		11.5, 1.3	Service Pack	-	20003	35, 4
		EZ-Sensor Service Pack	Almm. Valve	34000		62, 7	2005			
		Sensor	-	20066	58, 6.5	Caravan	Sensor	-	20335	71, 8
		Sensor	-	28308	11.5, 1.3		Service Pack	-	20030	71, 8
		Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5	Charger	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3
		Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		Service Pack	W/Siemens Sensor	20030	71, 8		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
	Sprinter	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3		Sensor	-	20066	58, 6.5
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	28308	11.5, 1.3
EZ-Sensor Service Pack		Almm. Valve	34000	62, 7	Service Pack		W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5	
Sensor		-	20089	53, 6	Service Pack		W/Schrader Sensor; Includes Stem Only	20020	58, 6.5	
Service Pack		Includes Valve	20036	53, 6	Service Pack		W/Siemens Sensor	20030	71, 8	
Service Pack		Includes Valve	20036	53, 6	Grand Caravan	Sensor	-	20335	71, 8	
						Service Pack	-	20030	71, 8	
					Magnum	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3	
						EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	

* Programming Tool Required ** Magnet Required to Activate Sensor

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.
2005 (cont.)					2009-2006				
Magnum (cont.)	EZ-Sensor Service Pack	Alnm. Valve	34000	62, 7	612 Scaglietti, F430	Sensor	Includes Transmitter Only	20077	35, 4
	Sensor	-	20066	58, 6.5		Service Pack	Does Not Include Valve	20023	35, 4
	Sensor	-	28308	11.5, 1.3		Service Pack	W/43mm Silver Insert	20037	35, 4
	Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5		Service Pack	W/48mm Green Insert	20038	35, 4
	Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5		Service Pack	W/49mm Black Insert	20039	35, 4
	Service Pack	W/Siemens Sensor	20030	71, 8		Service Pack	W/51mm Orange Insert	20040	35, 4
Viper	EZ-Sensor	When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000	33100	11.5, 1.3	2005				
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	575M Maranello, 612 Scaglietti, F430	Sensor	Includes Transmitter Only	20077	35, 4
	EZ-Sensor Service Pack	Alnm. Valve	34000	62, 7		Service Pack	Does Not Include Valve	20023	35, 4
	Sensor	-	20028**	35, 4		Service Pack	W/43mm Silver Insert	20037	35, 4
	Service Pack	-	20003	35, 4		Service Pack	W/48mm Green Insert	20038	35, 4
						Service Pack	W/49mm Black Insert	20039	35, 4
				Service Pack	W/51mm Orange Insert	20040	35, 4		
2004					2004				
Caravan, Grand Caravan	Sensor	-	20335	71, 8	575M Maranello, 612 Scaglietti	Sensor	Includes Transmitter Only	20077	35, 4
	Service Pack	-	20030	71, 8		Service Pack	Does Not Include Valve	20023	35, 4
Intrepid	EZ-Sensor		33100	11.5, 1.3		Service Pack	W/43mm Silver Insert	20037	35, 4
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	W/48mm Green Insert	20038	35, 4
	EZ-Sensor Service Pack	Alnm. Valve	34000	62, 7		Service Pack	W/49mm Black Insert	20039	35, 4
	Sensor	-	20028**	35, 4	Service Pack	W/51mm Orange Insert	20040	35, 4	
	Service Pack	-	20003	35, 4	Enzo	Sensor	Includes Transmitter Only	20084	35, 4
Viper	EZ-Sensor	When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000	33100	11.5, 1.3		Service Pack	Does Not Include Valve	20023	35, 4
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	W/43mm Silver Insert	20037	35, 4
	EZ-Sensor Service Pack	Alnm. Valve	34000	62, 7		Service Pack	W/48mm Green Insert	20038	35, 4
	Sensor	-	20028**	35, 4		Service Pack	W/49mm Black Insert	20039	35, 4
	Service Pack	-	20003	35, 4	Service Pack	W/51mm Orange Insert	20040	35, 4	
2003					2003				
Caravan, Grand Caravan, Intrepid, Viper	EZ-Sensor		33100	11.5, 1.3	575M Maranello	Sensor	Includes Transmitter Only	20077	35, 4
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	Does Not Include Valve	20023	35, 4
	EZ-Sensor Service Pack	Alnm. Valve	34000	62, 7		Service Pack	W/43mm Silver Insert	20037	35, 4
	Sensor	-	20028**	35, 4		Service Pack	W/48mm Green Insert	20038	35, 4
	Service Pack	-	20003	35, 4		Service Pack	W/49mm Black Insert	20039	35, 4
2002					2002				
Caravan, Grand Caravan, Intrepid	EZ-Sensor		33100	11.5, 1.3	550 Maranello, 575 Maranello	Sensor	Includes Transmitter Only	20077	35, 4
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	Does Not Include Valve	20023	35, 4
	EZ-Sensor Service Pack	Alnm. Valve	34000	62, 7		Service Pack	W/43mm Silver Insert	20037	35, 4
	Sensor	-	20028**	35, 4		Service Pack	W/48mm Green Insert	20038	35, 4
	Service Pack	-	20003	35, 4		Service Pack	W/49mm Black Insert	20039	35, 4
2001					2001				
Caravan, Grand Caravan, Intrepid	EZ-Sensor		33100	11.5, 1.3	550 Maranello	Sensor	Includes Transmitter Only	20077	35, 4
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	Does Not Include Valve	20023	35, 4
	EZ-Sensor Service Pack	Alnm. Valve	34000	62, 7		Service Pack	W/43mm Silver Insert	20037	35, 4
	Sensor	-	20028**	35, 4		Service Pack	W/48mm Green Insert	20038	35, 4
	Service Pack	-	20003	35, 4		Service Pack	W/49mm Black Insert	20039	35, 4
				Service Pack	W/51mm Orange Insert	20040	35, 4		

** Magnet Required to Activate Sensor

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.		
2014-2013					2013						
Fiat	500, 500 Arbarth, 500c, 500e, 500L	EZ-Sensor		33200	11.5, 1.3	C-MAX, E Series Van, E350 Super Duty, Edge, Escape, Expedition, Explorer, F Series Pickup, Fiesta, Flex, Focus, Fusion, Mustang	EZ-Sensor	-	33000*	11.5, 1.3	
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
		Sensor	-	20398	11.5, 1.3		Sensor	-	20315	11.5, 1.3	
		Service Pack	-	20018	11.5, 1.3		Service Pack	-	20018	11.5, 1.3	
	2012-2011										
	500, 500L	EZ-Sensor		33200	11.5, 1.3		Police Interceptor Sedan	EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7			EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		Sensor	-	20398	11.5, 1.3			EZ-Sensor	MUST use Aluminum stem kit 34000 before sensor installation	33000*	11.5, 1.3
Service Pack		-	20018	11.5, 1.3	EZ-Sensor Service Pack	Rubber Valve		20018	11.5, 1.3		
2014					Ford (cont.)						
C-MAX, E Series Van	Sensor	-	20315	11.5, 1.3	Shelby GT500	EZ-Sensor		MUST use Aluminum stem kit 34000 before sensor installation	33000*	11.5, 1.3	
	Service Pack	-	20018	11.5, 1.3		EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	
Edge, Escape, Expedition, Explorer, F Series Pickup, Fiesta, Flex	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor		-			
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	-				
	Sensor	-	20315	11.5, 1.3	Super Duty Pickup	EZ-Sensor	-	33000*	11.5, 1.3		
	Service Pack	-	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
Focus	Sensor	-	20315	13, 1.5		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		
	Service Pack	-	20018	11.5, 1.3		Sensor	-	20315	11.5, 1.3		
Fusion, Mustang	EZ-Sensor	-	33000*	11.5, 1.3		Service Pack	-	20018	11.5, 1.3		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Super Duty Van	EZ-Sensor	-	33000*	11.5, 1.3		
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		
	Sensor	-	20315	11.5, 1.3	Taurus	EZ-Sensor	-	33000*	11.5, 1.3		
	Service Pack	-	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
	Shelby GT500	EZ-Sensor	MUST use Aluminum stem kit 34000 before sensor installation	33000*		11.5, 1.3	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3		Sensor	-	20315	11.5, 1.3		
EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7		Service Pack	-	20018	11.5, 1.3		
Sensor		-	20315	11.5, 1.3	Transit Connect	EZ-Sensor	-	33000*	11.5, 1.3		
Service Pack		-	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
Super Duty Pickup	Sensor	-	20315	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		
	Service Pack	-	20018	11.5, 1.3		Sensor	-	20315	11.5, 1.3		
Taurus	EZ-Sensor	-	33000*	11.5, 1.3		Service Pack	-	20018	11.5, 1.3		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Transit	EZ-Sensor	-	33000*	11.5, 1.3		
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
	Sensor	-	20315	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		
	Service Pack	-	20018	11.5, 1.3		Sensor	-	20315	11.5, 1.3		
Transit Connect	Sensor	-	20315	11.5, 1.3		Service Pack	-	20018	11.5, 1.3		
	Service Pack	-	20018	11.5, 1.3	Transit Connect	Sensor	-	20315	11.5, 1.3		
	Sensor	-	20315	11.5, 1.3		Service Pack	-	20018	11.5, 1.3		
	Service Pack	-	20018	11.5, 1.3							
	Service Pack	-	20018	11.5, 1.3							

* Programming Tool Required

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2012					2011 (cont.)					
C-MAX, E Series Van, E350 Super Duty, Edge, Escape, Expedi- tion, Explorer, F Series Pickup, Fiesta, Flex, Focus, Fusion, Mustang	EZ-Sensor	-	33000*	11.5, 1.3	Fiesta, Flex, Focus, Fusion	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Sensor	-	20315	11.5, 1.3		Sensor	-	20315	11.5, 1.3	
	Service Pack	-	20018	11.5, 1.3		Service Pack	-	20018	11.5, 1.3	
	Shelby GT500	EZ-Sensor	MUST use Aluminum stem kit 34000 before sensor installation	33000*	11.5, 1.3	Grand Marquis	EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		Sensor	-				Sensor	-	28385	27, 3
Service Pack		-			Sensor Clip		-	22100	-	
				Sensor Cradle	-		22101	-		
Super Duty Pickup, Taurus, Transit Connect	EZ-Sensor	-	33000*	11.5, 1.3	Sensor Universal Band	Sensor	-	22102	-	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Mustang	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Sensor	-					EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Service Pack	-					Sensor	-	20315	11.5, 1.3
				Service Pack			-	20018	11.5, 1.3	
2011					Ranger	EZ-Sensor	-	33000*	11.5, 1.3	
Crown Victoria	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	-	28385	27, 3	
	Sensor	-	28385	27, 3		Sensor Clip	-	22100	-	
	Sensor Clip	-	22100	-		Sensor Cradle	-	22101	-	
	Sensor Cradle	-	22101	-	Sensor Universal Band	-	22102	-		
	Sensor Universal Band	-	22102	-	Super Duty Pickup, Super Duty Van	EZ-Sensor	-	33000*	11.5, 1.3	
E Series Van, E350 Super Duty, Edge	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	-	20315	11.5, 1.3	
	Sensor	-	20315	11.5, 1.3		Taurus, Transit Connect	EZ-Sensor	-	33000*	11.5, 1.3
	Service Pack		20018	11.5, 1.3	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	
Escape, Expedi- tion, Explorer, F Series Pickup	EZ-Sensor	-	33000*	11.5, 1.3	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Sensor		-	20315	11.5, 1.3	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Service Pack	-	20018	11.5, 1.3		
	Sensor	-	20315	11.5, 1.3	2010					
	Service Pack		20018	11.5, 1.3	Crown Victoria	EZ-Sensor	-	33000*	11.5, 1.3	
Crown Victoria	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	-	28385	27, 3	
	Sensor	-	28385	27, 3		Sensor Clip	-	22100	-	
	Sensor Clip	-	22100	-						

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.		
2010 (cont.)					2010 (cont.)						
Ford (cont.)	Crown Victoria (cont.)	Sensor Cradle	-	22101	-	Explorer, Explorer Sport Trac (cont.)	Sensor	-	28385	27, 3	
		Sensor Universal Band	-	22102	-		Sensor Clip	-	22100	-	
	E Series Van	EZ-Sensor	W/Alloy Wheels	33000*	11.5, 1.3		Sensor Cradle	-	22101	-	
		EZ-Sensor Service Pack	W/Alloy Wheels; Rubber Valve	20018	11.5, 1.3		Sensor Universal Band	-	22102	-	
		EZ-Sensor Service Pack	W/Alloy Wheels; Almm. Valve	34000	62, 7	F Series Pickup	EZ-Sensor	-	33000*	11.5, 1.3	
		Sensor	W/Steel Wheels	20315	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
		Sensor	W/Alloy Wheels	28395	27, 3		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
		Sensor Clip	W/Alloy Wheels	22100	-		Sensor	-	20315	11.5, 1.3	
		Sensor Cradle	W/Alloy Wheels	22101	-	Service Pack	-	20018	11.5, 1.3		
		Sensor Universal Band	W/Alloy Wheels	22102	-	F450 Super Duty, F550 Super Duty	EZ-Sensor	-	33000*	11.5, 1.3	
		Service Pack	W/Steel Wheels	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
		E350 Super Duty	EZ-Sensor	-	33000*		11.5, 1.3	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3		Sensor	-	28395	27, 3	
	EZ-Sensor Service Pack		Almm. Valve	34000	62, 7		Sensor Clip	-	22100	-	
	Sensor	-	20315	11.5, 1.3	Sensor Cradle		-	22101	-		
	Service Pack	-	20018	11.5, 1.3	Sensor Universal Band	-	22102	-			
	Edge	EZ-Sensor	-	33000*	11.5, 1.3	Flex	EZ-Sensor	-	33000*	11.5, 1.3	
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
		Sensor	-	28390	27, 3		Sensor	-	28390	27, 3	
		Sensor Clip	-	22100	-		Sensor Clip	-	22100	-	
		Sensor Cradle	-	22101	-		Sensor Cradle	-	22101	-	
		Sensor Universal Band	-	22102	-		Sensor Universal Band	-	22102	-	
		Escape	EZ-Sensor	-	33000*		11.5, 1.3	Focus, Fusion	EZ-Sensor	-	33000*
			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3
			EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	EZ-Sensor Service Pack		Almm. Valve	34000	62, 7
	Sensor		-	20315	11.5, 1.3	Sensor	-		20315	13, 1.5	
	Service Pack		-	20018	11.5, 1.3	Service Pack	-	20018	11.5, 1.3		
	Expedition	EZ-Sensor	-	33000*	11.5, 1.3	Grand Marquis	EZ-Sensor	-	33000*	11.5, 1.3	
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
		Sensor	-	28390	27, 3		Sensor	-	28385	27, 3	
		Sensor Clip	-	22100	-		Sensor Clip	-	22100	-	
Sensor Cradle		-	22101	-	Sensor Cradle		-	22101	-		
Sensor Universal Band		-	22102	-	Sensor Universal Band	-	22102	-			
Explorer, Explorer Sport Trac		EZ-Sensor	-	33000*	11.5, 1.3						
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3						
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7							

* Programming Tool Required

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2010 (cont.)					2010 (cont.)					
Mustang	EZ-Sensor	-	33000*	11.5, 1.3	Transit Connect	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
	Sensor	-	20315	11.5, 1.3		Sensor	-	20315	11.5, 1.3	
	Service Pack	-	20018	11.5, 1.3		Service Pack	-	20018	11.5, 1.3	
Ranger	EZ-Sensor	-	33000*	11.5, 1.3	2009					
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Crown Victoria	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Sensor	-	28385	27, 3		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
	Sensor Clip	-	22100	-		Sensor	-	28385	27, 3	
	Sensor Cradle	-	22101	-		Sensor Clip	-	22100	-	
	Sensor Universal Band	-	22102	-		Sensor Cradle	-	22101	-	
				Sensor Universal Band		-	22102	-		
Super Duty Pickup	EZ-Sensor	-	33000*	11.5, 1.3	E Series Van, E350 Super Duty	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
	Sensor	-	28395	27, 3		Sensor	-	28395	27, 3	
	Sensor Clip	-	22100	-		Sensor Clip	-	22100	-	
	Sensor Cradle	-	22101	-		Sensor Cradle	-	22101	-	
	Sensor Universal Band	-	22102	-		Sensor Universal Band	-	22102	-	
Super Duty Van	EZ-Sensor	W/Alloy Wheels	33000*	11.5, 1.3	Edge	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	W/Alloy Wheels; Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	W/Alloy Wheels; Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
	Sensor	W/Steel Wheels	20315	11.5, 1.3		Sensor	-	28390	27, 3	
	Sensor	W/Alloy Wheels	28395	27, 3		Sensor Clip	-	22100	-	
	Sensor Clip	W/Alloy Wheels	22100	-		Sensor Cradle	-	22101	-	
	Sensor Cradle	W/Alloy Wheels	22101	-		Sensor Universal Band	-	22102	-	
	Sensor Universal Band	W/Alloy Wheels	22102	-						
	Service Pack	W/Steel Wheels	20018	11.5, 1.3		Escape	EZ-Sensor	-	33000*	11.5, 1.3
							EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
				EZ-Sensor Service Pack	Almm. Valve		34000	62, 7		
				Sensor	-		20315	11.5, 1.3		
				Service Pack	-		20018	11.5, 1.3		
Taurus	EZ-Sensor	Apr. & Older	33000*	11.5, 1.3	Expedition	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Apr. & Older; Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Apr. & Older; Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
	Sensor	May & Newer	20315	11.5, 1.3		Sensor	-	28390	27, 3	
	Sensor	Apr. & Older	28390	27, 3		Sensor Clip	-	22100	-	
	Sensor Clip	Apr. & Older	22100	-		Sensor Cradle	-	22101	-	
	Sensor Cradle	Apr. & Older	22101	-		Sensor Universal Band	-	22102	-	
	Sensor Universal Band	Apr. & Older	22102	-						
	Service Pack	May & Newer	20018	11.5, 1.3						

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2009 (cont.)					2009 (cont.)					
Ford (cont.)	Explorer, Explorer Sport Trac	EZ-Sensor	-	33000*	11.5, 1.3	Super Duty Pickup, Super Duty Van (cont.)	Sensor Cradle	-	22101	-
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor Universal Band	-	22102	-
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Taurus, Taurus X	EZ-Sensor	-	33000*
		Sensor	-	28385	27, 3	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3
		Sensor Clip	-	22100	-	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7
		Sensor Cradle	-	22101	-	Sensor		-	28390	27, 3
		Sensor Universal Band	-	22102	-	Sensor Clip		-	22100	-
	F Series Pickup	EZ-Sensor	-	33000*	11.5, 1.3	Sensor Cradle		-	22101	-
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Sensor Universal Band	-	22102	-	
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	2008				
Sensor		-	20315	11.5, 1.3	Crown Victoria	EZ-Sensor	-	33000*	11.5, 1.3	
Service Pack		-	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
F450 Super Duty		EZ-Sensor	-	33000*		11.5, 1.3	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	28385	27, 3	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor Clip	-	22100	-	
	Sensor	-	28395	27, 3		Sensor Cradle	-	22101	-	
	Sensor Clip	-	22100	-		Sensor Universal Band	-	22102	-	
	Sensor Cradle	-	22101	-	E Series Van, E350 Super Duty	EZ-Sensor	-	33000*	11.5, 1.3	
Sensor Universal Band	-	22102	-	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3		
Flex, Focus	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	28395	27, 3	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor Clip	-	22100	-	
	Sensor	-	28390	27, 3		Sensor Cradle	-	22101	-	
	Sensor Clip	-	22100	-		Sensor Universal Band	-	22102	-	
	Sensor Cradle	-	22101	-	Edge	EZ-Sensor	-	33000*	11.5, 1.3	
Sensor Universal Band	-	22102	-	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3		
Fusion, Grand Marquis, Mustang, Ranger	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	W/Chrome Plated Almnm. Wheels	28385	27, 3	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	W/O Chrome Plated Almnm. Wheels	28390	27, 3	
	Sensor	-	28385	27, 3		Sensor Clip	-	22100	-	
	Sensor Clip	-	22100	-		Sensor Cradle	-	22101	-	
	Sensor Cradle	-	22101	-	Sensor Universal Band	-	22102	-		
Super Duty Pickup, Super Duty Van	EZ-Sensor	-	33000*	11.5, 1.3						
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3						
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7						
	Sensor	-	28395	27, 3						
	Sensor Clip	-	22100	-						

* Programming Tool Required

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2008 (cont.)					2008 (cont.)					
Ford (cont.)	Escape	EZ-Sensor	-	33000*	11.5, 1.3	Focus	EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		Sensor	-	28385	27, 3		Sensor	-	28390	27, 3
		Sensor Clip	-	22100	-		Sensor Clip	-	22100	-
		Sensor Cradle	-	22101	-		Sensor Cradle	-	22101	-
		Sensor Universal Band	-	22102	-		Sensor Universal Band	-	22102	-
	Expedition	EZ-Sensor	-	33000*	11.5, 1.3	Fusion, Grand Marquis, Mustang, Ranger	EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		Sensor	-	28390	27, 3		Sensor	-	28385	27, 3
		Sensor Clip	-	22100	-		Sensor Clip	-	22100	-
		Sensor Cradle	-	22101	-		Sensor Cradle	-	22101	-
		Sensor Universal Band	-	22102	-		Sensor Universal Band	-	22102	-
	Explorer, Explorer Sport Trac	EZ-Sensor	-	33000*	11.5, 1.3	Super Duty Pickup, Super Duty Van	EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		Sensor	-	28385	27, 3		Sensor	-	28395	27, 3
		Sensor Clip	-	22100	-		Sensor Clip	-	22100	-
		Sensor Cradle	-	22101	-		Sensor Cradle	-	22101	-
		Sensor Universal Band	-	22102	-		Sensor Universal Band	-	22102	-
	F Series Pickup	EZ-Sensor	-	33000*	11.5, 1.3	Taurus	EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		Sensor	W/O H.D. Payload Pkg.	28385	27, 3		Sensor	-	28390	27, 3
		Sensor	W/H.D. Payload Pkg.	28395	27, 3		Sensor Clip	-	22100	-
		Sensor Clip	-	22100	-		Sensor Cradle	-	22101	-
		Sensor Cradle	-	22101	-		Sensor Universal Band	-	22102	-
F450 Super Duty	EZ-Sensor	-	33000*	11.5, 1.3	Taurus X	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Sensor	-	28395	27, 3		Sensor	-	28390	27, 3	
	Sensor Clip	-	22100	-		Sensor Clip	-	22100	-	
	Sensor Cradle	-	22101	-		Sensor Cradle	-	22101	-	
	Sensor Universal Band	-	22102	-		Sensor Universal Band	-	22102	-	

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.
2007					2007 (cont.)				
Crown Victoria, E Series Van	EZ-Sensor	-	33000*	11.5, 1.3	Explorer, Explorer Sport Trac, F Series Pickup	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
	Sensor	-	28385	27, 3		Sensor	-	28385	27, 3
	Sensor Clip	-	22100	-		Sensor Clip	-	22100	-
	Sensor Cradle	-	22101	-		Sensor Cradle	-	22101	-
	Sensor Universal Band	-	22102	-		Sensor Universal Band	-	22102	-
E350 Super Duty	EZ-Sensor	-	33000*	11.5, 1.3	Five Hundred	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
	Sensor	-	28395	27, 3		Sensor	-	28390	27, 3
	Sensor Clip	-	22100	-		Sensor Clip	-	22100	-
	Sensor Cradle	-	22101	-		Sensor Cradle	-	22101	-
	Sensor Universal Band	-	22102	-		Sensor Universal Band	-	22102	-
Edge	EZ-Sensor	-	33000*	11.5, 1.3	Focus, Freestar, Fusion, Grand Marquis, Mustang, Ranger	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
	Sensor	W/Chrome Plated Almm. Wheels	28385	27, 3		Sensor	-	28385	27, 3
	Sensor	W/O Chrome Plated Almm. Wheels	28390	27, 3		Sensor Clip	-	22100	-
	Sensor Clip	-	22100	-		Sensor Cradle	-	22101	-
	Sensor Cradle	-	22101	-		Sensor Universal Band	-	22102	-
	Sensor Universal Band	-	22102	-		2006			
Escape	EZ-Sensor	-	33000*	11.5, 1.3	Crown Victoria, Escape	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
	Sensor	-	28385	27, 3		Sensor	-	28385	27, 3
	Sensor Clip	-	22100	-		Sensor Clip	-	22100	-
	Sensor Cradle	-	22101	-		Sensor Cradle	-	22101	-
	Sensor Universal Band	-	22102	-		Sensor Universal Band	-	22102	-
	Expedition	EZ-Sensor	-	33000*	11.5, 1.3	Expedition	Sensor	-	20135**
EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	Service Pack		-	20002	44, 5
EZ-Sensor Service Pack		Almm. Valve	34000	62, 7	Explorer, Explorer Sport Trac	EZ-Sensor	-	33000*	11.5, 1.3
Sensor		-	28390	27, 3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
Sensor Clip		-	22100	-		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
Sensor Cradle		-	22101	-		Sensor	-	28385	27, 3
Sensor Universal Band		-	22102	-		Sensor Clip	-	22100	-
						Sensor Cradle	-	22101	-
				Sensor Universal Band	-	22102	-		

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.
2006 (cont.)					2003				
Five Hundred	EZ-Sensor	-	33000*	11.5, 1.3	Expedition	EZ-Sensor	-	33100	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	-	28390	27, 3		Sensor	-	20096**	44, 5
	Sensor Clip	-	22100	-		Service Pack	-	20002	44, 5
	Sensor Cradle	-	22101	-		Explorer	EZ-Sensor	-	33100
	Sensor Universal Band	-	22102	-	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3
Freestar, Grand Marquis	EZ-Sensor	-	33000*	11.5, 1.3	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Sensor	Exc. Sport	20096**	44, 5	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Service Pack	Exc. Sport	20002	44, 5	
	Sensor	-	28385	27, 3	2002				
	Sensor Clip	-	22100	-	Explorer	EZ-Sensor	-	33100	11.5, 1.3
	Sensor Cradle	-	22101	-		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Sensor Universal Band	-	22102	-		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
2005						Sensor	Exc. Sport	20096**	44, 5
Escape	EZ-Sensor	-	33000*	11.5, 1.3		Service Pack	Exc. Sport	20002	44, 5
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	2008-2007				
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Sprinter	EZ-Sensor	-	33000*	11.5, 1.3
	Sensor	Oct. 3, 2005 & Newer	28385	27, 3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Sensor Clip	-	22100	-		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor Cradle	-	22101	-		Sensor	-	20089	53, 6
	Sensor Universal Band	-	22102	-		Service Pack	Includes Valve	20036	53, 6
Expedition	Sensor	-	20135**	44, 5	2014				
	Service Pack	-	20002	44, 5	Acadia	Sensor	-	20153	11.5, 1.3
Explorer	EZ-Sensor	-	33100	11.5, 1.3		Service Pack	-	20008	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Savana	EZ-Sensor	-	33000*	11.5, 1.3
EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	
Sensor	-	20096**	44, 5	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	
Service Pack	-	20002	44, 5	Sensor		-	20153	11.5, 1.3	
Service Pack	-	20002	44, 5	Service Pack		-	20008	11.5, 1.3	
Freestar	Sensor	W/Almnm. Valve Stem	20135**	44, 5	Sierra Series Pickup	EZ-Sensor	-	33000*	11.5, 1.3
	Service Pack	W/Almnm. Valve Stem	20002	44, 5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
2004						EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
Expedition, Explorer	EZ-Sensor	-	33100	11.5, 1.3		Sensor	W/Single Rear Wheels	20153	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	W/Single Rear Wheels	20008	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Terrain, Yukon	EZ-Sensor	-	33000*	11.5, 1.3
	Sensor	-	20096**	44, 5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Service Pack	-	20002	44, 5	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
Freestar	Sensor	W/Almnm. Valve Stem	20135**	44, 5	Sensor	-	28206	11.5, 1.3	
	Service Pack	W/Almnm. Valve Stem	20002	44, 5	Service Pack	-	20008	11.5, 1.3	

* Programming Tool Required ** Magnet Required to Activate Sensor

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.
2013					2012 (cont.)				
Acadia, Savana	EZ-Sensor	-	33000*	11.5, 1.3	Terrain	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	-	20153	11.5, 1.3		Sensor	-	28206	11.5, 1.3
	Service Pack	-	20008	11.5, 1.3		Service Pack	-	20008	11.5, 1.3
Sierra Series Pickup	EZ-Sensor	-	33000*	11.5, 1.3	Yukon	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	W/Single Rear Wheels	20153	11.5, 1.3		Sensor	-	20153	11.5, 1.3
	Service Pack	W/Single Rear Wheels	20008	11.5, 1.3		Service Pack	-	20008	11.5, 1.3
Terrain	EZ-Sensor	-	33000*	11.5, 1.3	2011-2010				
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Acadia	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Sensor	-	28206	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Service Pack	-	20008	11.5, 1.3		Sensor	-	20153	11.5, 1.3
Service Pack	-	20008	11.5, 1.3	Service Pack		-	20008	11.5, 1.3	
Yukon	EZ-Sensor	-	33000*	11.5, 1.3	Canyon	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	-	20153	11.5, 1.3		Sensor	-	20131	62, 7
	Service Pack	-	20008	11.5, 1.3		Service Pack	-	20006	62, 7
2012					Savana	EZ-Sensor	-	33000*	11.5, 1.3
Acadia	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	-	20153	11.5, 1.3
	Sensor	-	20153	11.5, 1.3		Service Pack	-	20008	11.5, 1.3
	Service Pack	-	20008	11.5, 1.3	Sierra Series Pickup	EZ-Sensor	-	33000*	11.5, 1.3
Canyon	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	W/Single Rear Wheels	20153	11.5, 1.3
	Sensor	-	20131	62, 7		Service Pack	W/Single Rear Wheels	20008	11.5, 1.3
	Service Pack	-	20006	62, 7	Terrain	EZ-Sensor	-	33000*	11.5, 1.3
Savana	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	-	28206	11.5, 1.3
	Sensor	-	20153	11.5, 1.3		Service Pack	-	20008	11.5, 1.3
	Service Pack	-	20008	11.5, 1.3	Yukon	EZ-Sensor	-	33000*	11.5, 1.3
Sierra Series Pickup	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	-	20153	11.5, 1.3
	Sensor	W/Single Rear Wheels	20153	11.5, 1.3		Service Pack	-	20008	11.5, 1.3
	Service Pack	W/Single Rear Wheels	20008	11.5, 1.3					

* Programming Tool Required

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2009					2008 (cont.)					
Acadia	EZ-Sensor	-	33000*	11.5, 1.3	Canyon (cont.)	Sensor	-	20131	62, 7	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	-	20006	62, 7	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Envoy	EZ-Sensor	-	33000*	11.5, 1.3	
	Sensor	-	20153	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	-	20008	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	EZ-Sensor	-	33000*	11.5, 1.3		Sensor	-	20116	62, 7	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	-	20004	62, 7	
	Canyon	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Savana	EZ-Sensor	-	33000*	11.5, 1.3
		Sensor	-	20131	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		Service Pack	-	20006	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
EZ-Sensor		-	33000*	11.5, 1.3	Sensor		-	20158	62, 7	
EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	Service Pack		W/Schrader Sensor	20004	62, 7	
Envoy	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Service Pack	W/Siemens Sensor	20030	80, 9		
	Sensor	-	20116	62, 7	Sierra Series Pickup	EZ-Sensor	-	33000*	11.5, 1.3	
	Service Pack	-	20004	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	W/Single Rear Wheels	20153	11.5, 1.3	
EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Service Pack		W/Single Rear Wheels	20008	11.5, 1.3		
Savana	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Yukon	EZ-Sensor	-	33000*	11.5, 1.3	
	Sensor	-	20158	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	W/Schrader Sensor	20004	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Service Pack	W/Siemens Sensor	20030	80, 9		Sensor	-	20153	11.5, 1.3	
	EZ-Sensor	-	33000*	11.5, 1.3		Service Pack	-	20008	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	2007					
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Acadia	EZ-Sensor	-	33000*	11.5, 1.3	
Sensor	W/Single Rear Wheels	20153	11.5, 1.3	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3		
Service Pack	W/Single Rear Wheels	20008	11.5, 1.3	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7		
EZ-Sensor	-	33000*	11.5, 1.3	Sensor		-	20158	62, 7		
EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Service Pack		W/Schrader Sensor	20004	62, 7		
Yukon	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Service Pack	W/Siemens Sensor	20030	80, 9		
	Sensor	-	20153	11.5, 1.3	Canyon	EZ-Sensor	-	33000*	11.5, 1.3	
	Service Pack	-	20008	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	20131	62, 7	
EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Service Pack		-	20006	62, 7		
2008					Envoy	EZ-Sensor	-	33000*	11.5, 1.3	
Acadia	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	-	20131	62, 7	
	Sensor	-	20158	62, 7		Service Pack	-	20006	62, 7	
	Service Pack	W/Schrader Sensor	20004	62, 7	Canyon	EZ-Sensor	-	33000*	11.5, 1.3	
	Service Pack	W/Siemens Sensor	20030	80, 9		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
EZ-Sensor	-	33000*	11.5, 1.3	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7		
EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Sensor		-	20116	62, 7		
EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Service Pack		-	20004	62, 7		

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2007 (cont.)					2004					
Sierra Series Pickup	EZ-Sensor	-	33000*	11.5, 1.3	Sierra Series Pickup, Yukon	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
	Sensor	Classic	20107	62, 7		Sensor	-	20115	62, 7	
	Sensor	Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem; Exc. Classic	20153	11.5, 1.3		Service Pack	-	20004	62, 7	
	Sensor	Clamp-In Style Only; TRW Sensor; W/Almm. Valve Stem; Exc. Classic	20158	62, 7	2014					
	Service Pack	Classic	20004	62, 7	Civic, CR-Z	EZ-Sensor	-	33000*	11.5, 1.3	
	Service Pack	Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem; Exc. Classic	20008	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	Clamp-In Style Only; TRW Sensor; W/Almm. Valve Stem; Exc. Classic	20015	80, 9		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
						Sensor	-	28720	35, 4	
				Service Pack		-	20019	35, 4		
Yukon	EZ-Sensor	-	33000*	11.5, 1.3	Crosstour	Sensor	-	20100	71, 8	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	-	20032	35, 4	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	Insight	EZ-Sensor	-	33000*	11.5, 1.3	
	Sensor	Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem	20153	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Sensor	Clamp-In Style Only; TRW Sensor; W/Almm. Valve Stem	20158	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
	Service Pack	Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem	20008	11.5, 1.3	Odyssey	Sensor	-	28720	35, 4	
	Service Pack	Clamp-In Style Only; TRW Sensor; W/Almm. Valve Stem	20015	62, 7		Service Pack	-	20019	35, 4	
						Sensor	-	28720	35, 4	
	Envoy	EZ-Sensor	-	33000*	11.5, 1.3	Pilot	Sensor	W/Alloy Wheels	20098	35, 4
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	W/Alloy Wheels	20032	35, 4
EZ-Sensor Service Pack		Almm. Valve	34000	62, 7	Ridgeline	Sensor	-	28981	35, 4	
Sensor		-	20116	62, 7		Service Pack	RT; Includes Valve	20036	35, 4	
Service Pack		-	20004	62, 7	2013					
Sierra Series Pickup, Yukon		EZ-Sensor	-	33000*	11.5, 1.3	Civic	EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
		Sensor	-	20107	62, 7		Sensor	-	28720	35, 4
		Service Pack	-	20004	62, 7		Service Pack	-	20019	35, 4
Sierra Series Pickup, Yukon	EZ-Sensor	-	33000*	11.5, 1.3	CR-V	Sensor	-	20100	35, 4	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	-	20032	35, 4	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	CR-Z	EZ-Sensor	-	33000*	11.5, 1.3	
	Sensor	-	20107	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	-	20004	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
Sierra Series Pickup, Yukon	EZ-Sensor	-	33000*	11.5, 1.3	Crosstour	Sensor	-	28720	35, 4	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	-	20019	35, 4	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		Sensor	-	20100	71, 8	
	Sensor	-	20107	62, 7	Service Pack	-	20032	35, 4		
	Service Pack	-	20004	62, 7	Fit, Insight, Odyssey	EZ-Sensor	-	33000*	11.5, 1.3	
				EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3		
				EZ-Sensor Service Pack		Almm. Valve	34000	62, 7		
				Sensor		-	28720	35, 4		
				Service Pack		-	20019	35, 4		

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.
2013 (cont.)					2011 (cont.)				
Pilot	Sensor	W/Alloy Wheels	20098	35, 4	Civic	EZ-Sensor	-	33000*	11.5, 1.3
	Service Pack	W/Alloy Wheels	20032	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
Ridgeline	Sensor	-	28981	35, 4		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Service Pack	RT; Includes Valve	20036	35, 4		Sensor	-	28720	35, 4
2012						Service Pack	-	20019	35, 4
Accord	EZ-Sensor	Exc. Crosstour	33000*	11.5, 1.3		CR-V	EZ-Sensor	-	33000*
	EZ-Sensor Service Pack	Exc. Crosstour; Rubber Valve	20018	11.5, 1.3	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Exc. Crosstour; Almnm. Valve	34000	62, 7	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Sensor	-	20099	35, 4	Sensor	-	20099	35, 4	
	Service Pack	-	20032	35, 4	Service Pack	-	20032	35, 4	
Civic	EZ-Sensor	-	33000*	11.5, 1.3	CR-Z	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	-	28720	35, 4		Sensor	-	28720	35, 4
	Sensor	-	28720	35, 4		Service Pack	-	20019	35, 4
	Service Pack	-	20019	35, 4		Service Pack	-	20019	35, 4
CR-V	Sensor	-	20100	35, 4	Element, Fit, Insight, Odyssey	EZ-Sensor	-	33000*	11.5, 1.3
	Service Pack	-	20032	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
CR-Z	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	28720	35, 4
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	-	20019	35, 4
	Sensor	-	28720	35, 4		Pilot	Sensor	Exc. LX	20098
	Service Pack	-	20019	35, 4	Service Pack		Exc. LX	20032	35, 4
	Crosstour	EZ-Sensor	-	33000*	11.5, 1.3	Ridgeline	Sensor	RT	28981
EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	Sensor		Exc. RT	28981	35, 4
EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	Service Pack		RT; Includes Valve	20036	35, 4
Sensor		-	20100	71, 8	2010				
Service Pack		-	20032	35, 4	Accord	EZ-Sensor	Exc. Crosstour	33000*	11.5, 1.3
Fit, Insight, Odyssey		EZ-Sensor	-	33000*		11.5, 1.3	EZ-Sensor Service Pack	Exc. Crosstour; Rubber Valve	20018
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Exc. Crosstour; Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	Exc. Crosstour	20099	35, 4
	Sensor	-	28720	35, 4		Sensor	Crosstour	20100	35, 4
	Service Pack	-	20019	35, 4		Service Pack	Exc. Crosstour	20032	35, 4
	Service Pack	-	20019	35, 4	Civic	EZ-Sensor	-	33000*	11.5, 1.3
Pilot	Sensor	W/Alloy Wheels	20098	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Service Pack	W/Alloy Wheels	20032	35, 4		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
Ridgeline	Sensor	-	28981	35, 4		Sensor	-	28720	35, 4
	Service Pack	RT; Includes Valve	20036	35, 4		Service Pack	-	20019	35, 4
2011						CR-V	EZ-Sensor	-	33000*
Accord	EZ-Sensor	Exc. Crosstour	33000*	11.5, 1.3	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Exc. Crosstour; Rubber Valve	20018	11.5, 1.3	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Exc. Crosstour; Almnm. Valve	34000	62, 7	Sensor		-	20099	35, 4
	Sensor	Exc. Crosstour	20099	35, 4	Sensor		Crosstour	20100	35, 4
	Sensor	Crosstour	20100	35, 4	Service Pack		Exc. Crosstour	20032	35, 4
	Service Pack	Exc. Crosstour	20032	35, 4					

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2010 (cont.)					2009 (cont.)					
Element, Fit, Insight	EZ-Sensor	-	33000*	11.5, 1.3	S2000	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Sensor	-	28720	35, 4		Service Pack	-	20032	35, 4	
	Service Pack	-	20019	35, 4	2008					
Odyssey	Sensor	-	28983	31-40, 3.5-4.5	Accord	EZ-Sensor	-	33000*	11.5, 1.3	
	Service Pack	Includes Valve	20036	31-40, 3.5-4.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
Pilot	Sensor	Exc. LX	20098	35, 4		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Service Pack	Exc. LX	20032	35, 4		Sensor	-	20099	35, 4	
Ridgeline	Sensor	RT	28981	35, 4	Service Pack	-	20032	35, 4		
	Sensor	Exc. RT	28981	35, 4	Civic	EZ-Sensor	-	33000*	11.5, 1.3	
	Service Pack	RT; Includes Valve	20036	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
2009						EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
Accord	EZ-Sensor	-	33000*	11.5, 1.3		Sensor	-	28720	35, 4	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Service Pack	-	20019	35, 4		
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	CR-V	EZ-Sensor	-	33000*	11.5, 1.3	
	Sensor	-	20099	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	-	20032	35, 4		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
Service Pack	-	20032	35, 4	Sensor		-	20099	35, 4		
Civic	EZ-Sensor	-	33000*	11.5, 1.3	Service Pack	-	20032	35, 4		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Service Pack	Includes Valve	20036	35, 4		
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Element Fit	EZ-Sensor	-	33000*	11.5, 1.3	
	Sensor	-	28720	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	-	20019	35, 4		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
Service Pack	-	20019	35, 4	Sensor		-	20099	35, 4		
CR-V	EZ-Sensor	-	33000*	11.5, 1.3	Service Pack	-	20032	35, 4		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Pilot	Sensor	-	28981	35, 4	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	Includes Valve	20036	35, 4	
	Sensor	-	20099	35, 4		Ridgeline	Sensor	RTL, RTS, RTX	28981	35, 4
	Service Pack	-	20032	35, 4			Sensor	RT	28982	35, 4
Service Pack	-	20032	35, 4	Service Pack	RT; Includes Valve		20035	35, 4		
Element, Fit	EZ-Sensor	-	33000*	11.5, 1.3	Service Pack	RTL, RTS, RTX; Includes Valve	20036	35, 4		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	S2000	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Sensor	-	28720	35, 4		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Service Pack	-	20019	35, 4		Service Pack	-	20032	35, 4	
Odyssey	Sensor	-	28983	31-40, 3.5-4.5	2007					
	Service Pack	Includes Valve	20036	31-40, 3.5-4.5	CR-V	EZ-Sensor	-	33000*	11.5, 1.3	
Pilot	Sensor	W/Alloy Wheels	20098	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	W/Alloy Wheels	20032	35, 4		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
Ridgeline	Sensor	-	28981	35, 4		Sensor	-	20099	35, 4	
	Service Pack	Includes Valve	20036	35, 4	Service Pack	-	20032	35, 4		

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.		
2007 (cont.)					2008 (cont.)						
Honda (cont.)	Element	Service Pack	Includes Valve	20036	35, 4	Hummer (cont.)	H3, H3T	EZ-Sensor	-	33000*	11.5, 1.3
	Odyssey	Sensor	Touring	28981	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
		Service Pack	Touring; Includes Valve	20036	35, 4		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Pilot	Sensor	-	28981	35, 4		Sensor	-	20131	62, 7	
		Service Pack	Includes Valve	20036	35, 4		Service Pack	-	20006	62, 7	
	Ridgeline	Sensor	RTL, RTS, RTX	28981	35, 4	2007-2006					
		Sensor	RT	28982	35, 4	H3, H3T	EZ-Sensor	-	33000*	11.5, 1.3	
		Service Pack	RT; Includes Valve	20035	35, 4	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
	2006					Hummer	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Odyssey	Sensor	Touring	28981	35, 4		Sensor	-	20131	62, 7	
		Service Pack	Touring; Includes Valve	20036	35, 4		Service Pack	-	20006	62, 7	
	Pilot	Sensor	-	28981	35, 4		2014				
Service Pack		Includes Valve	20036	35, 4	Accent		EZ-Sensor	-	33000*	11.5, 1.3	
Ridgeline	Sensor	RTL, RTS	28981	35, 4			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Sensor	RT	28982	35, 4			EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Service Pack	RT; Includes Valve	20035	35, 4			Sensor	-	20092	31-40, 3.5-4.5	
Service Pack	RTL, RTS; Includes Valve	20036	35, 4	Equus	EZ-Sensor		-	33000*	11.5, 1.3		
2005					EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3		
Odyssey	Sensor	Touring	28981		35, 4		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Service Pack	Touring; Includes Valve	20036		35, 4		Sensor	-	28849	31-40, 3.5-4.5	
Pilot	Sensor	EX	28981		35, 4	Service Pack	-	20022	31-40, 3.5-4.5		
	Sensor	LX; W/Short Stem Valve	28981		35, 4	Santa Fe	Sensor	-	28849	31-40, 3.5-4.5	
	Sensor	LX; W/Long Stem Valve	28982	35, 4	Sensor		-				
	Service Pack	LX; W/Long Stem Valve; Includes Valve	20035	35, 4	Service Pack		-	20022	31-40, 3.5-4.5		
	Service Pack	EX; Includes Valve	20036	35, 4	Service Pack	-					
Service Pack	LX; W/Short Stem Valve; Includes Valve	20036	35, 4	Sonata	Sensor	-	20092	31-40, 3.5-4.5			
2010-2009					Tucson	Sensor	-				
H2	EZ-Sensor	-	33000*	11.5, 1.3		Service Pack	-				
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	2013						
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Accent	EZ-Sensor	-	33000*	11.5, 1.3		
	Sensor	-	20153	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
	Service Pack	-	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		
Service Pack	-	20018	11.5, 1.3	Sensor		-	20092	31-40, 3.5-4.5			
H3, H3T	EZ-Sensor	-	33000*	11.5, 1.3	Azera	EZ-Sensor	-	33000*	11.5, 1.3		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		
	Sensor	-	20131	62, 7		Sensor	Includes Transmitter Only	20086	31-40, 3.5-4.5		
	Service Pack	-	20006	62, 7		Service Pack	Includes Valve	20036	31-40, 3.5-4.5		
Service Pack	-	20006	62, 7	2008							
H2	EZ-Sensor	-	33000*	11.5, 1.3	EZ-Sensor	-	33000*	11.5, 1.3			
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3			
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7			
	Sensor	-	20153	11.5, 1.3	Sensor	-	20153	11.5, 1.3			
	Service Pack	-	20018	11.5, 1.3	Service Pack	-	20018	11.5, 1.3			

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2013 (cont.)					2012 (cont.)					
Hyundai (cont.)	Elantra	Sensor	W/Transmitter Only	20086	31-40, 3.5-4.5	Equus	Sensor	-	28849	31-40, 3.5-4.5
		Service Pack	Includes Valve	20036	31-40, 3.5-4.5		Service Pack	-	20022	31-40, 3.5-4.5
	Equus	Sensor	-	28849	31-40, 3.5-4.5	Genesis	EZ-Sensor	-	33000*	11.5, 1.3
		Service Pack	-	20022	31-40, 3.5-4.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Santa Fe	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	Coupe	20092	31-40, 3.5-4.5
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Sensor	Sedan	28849	31-40, 3.5-4.5	
		Sensor	-	28849	31-40, 3.5-4.5	Service Pack	Sedan	20022	31-40, 3.5-4.5	
	Sonata	Service Pack	-	20022	31-40, 3.5-4.5	Santa Fe	EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Sonata	EZ-Sensor	-	33000*	11.5, 1.3
	Sensor	-	20092	31-40, 3.5-4.5	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	
	Tucson	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	20092	31-40, 3.5-4.5
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Tucson	EZ-Sensor	-	33000*	11.5, 1.3
		Sensor	-	28849	31-40, 3.5-4.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Service Pack	-	20022	31-40, 3.5-4.5	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	
Sensor	-	28849	31-40, 3.5-4.5	Sensor	-		20092	31-40, 3.5-4.5		
Veloster	Sensor	-	28505	11.5, 1.3	Veloster	Sensor	-	28505	11.5, 1.3	
	Service Pack	-	20018	11.5, 1.3		Service Pack	-	20018	11.5, 1.3	
2012					Veracruz	EZ-Sensor	-	33000*	11.5, 1.3	
Accent	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	-	20092	31-40, 3.5-4.5	
	Sensor	-	20092	31-40, 3.5-4.5		Azera, Elantra	EZ-Sensor	-	33000*	11.5, 1.3
Azera, Elantra	EZ-Sensor	-	33000*	11.5, 1.3			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3			EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7			Sensor	Includes Transmitter Only	20086	31-40, 3.5-4.5
	Sensor	Includes Transmitter Only	20086	31-40, 3.5-4.5		Service Pack	Includes Valve	20036	31-40, 3.5-4.5	
Elantra Touring	Service Pack	Includes Valve	20036	31-40, 3.5-4.5		2011				
	EZ-Sensor	-	33000*	11.5, 1.3	Accent	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
Sensor	W/Transmitter Only	20092	31-40, 3.5-4.5	Sensor		-	28849	31-40, 3.5-4.5		
					Service Pack	-	20022	31-40, 3.5-4.5		

* Programming Tool Required

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.
2011 (cont.)					2010				
Azera, Elantra	EZ-Sensor	-	33000*	11.5, 1.3	Accent	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	Includes Transmitter Only	20086	31-40, 3.5-4.5		Sensor	-	28849	31-40, 3.5-4.5
	Service Pack	Includes Valve	20036	31-40, 3.5-4.5		Service Pack	-	20022	31-40, 3.5-4.5
Elantra Touring	EZ-Sensor	-	33000*	11.5, 1.3	Azera, Elantra	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	Includes Transmitter Only	20092	31-40, 3.5-4.5		Sensor	Includes Transmitter Only	20086	31-40, 3.5-4.5
Service Pack	Includes Valve	20036	31-40, 3.5-4.5	Service Pack		Includes Valve	20036	31-40, 3.5-4.5	
Equus	Sensor	-	28849	31-40, 3.5-4.5	Elantra Touring, Genesis	EZ-Sensor	-	33000*	11.5, 1.3
	Service Pack	-	20022	31-40, 3.5-4.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
Genesis	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	Includes Transmitter Only	20092	31-40, 3.5-4.5
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	Includes Valve	20036	31-40, 3.5-4.5
	Sensor	Coupe	20092	31-40, 3.5-4.5	Santa Fe	EZ-Sensor	-	33000*	11.5, 1.3
	Sensor	Sedan	28849	31-40, 3.5-4.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
Service Pack	Sedan	20022	31-40, 3.5-4.5	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	
Santa Fe	EZ-Sensor	-	33000*	11.5, 1.3		Sensor	Includes Transmitter Only	20086	31-40, 3.5-4.5
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	Includes Valve	20036	31-40, 3.5-4.5
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Sonata, Tucson	EZ-Sensor	-	33000*	11.5, 1.3
	Sonata	EZ-Sensor	-	33000*		11.5, 1.3	EZ-Sensor Service Pack	Rubber Valve	20018
EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	
EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Sensor		-	28849	31-40, 3.5-4.5	
Sensor	-	20092	31-40, 3.5-4.5	Service Pack		-	20022	31-40, 3.5-4.5	
Tucson	EZ-Sensor	-	33000*	11.5, 1.3	Veracruz	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	-	28849	31-40, 3.5-4.5		Sensor	Includes Transmitter Only	20086	31-40, 3.5-4.5
	Service Pack	-	20022	31-40, 3.5-4.5		Service Pack	Includes Valve	20036	31-40, 3.5-4.5
Veracruz	EZ-Sensor	-	33000*	11.5, 1.3	2009				
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Accent	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Sensor	Includes Transmitter Only	20086	31-40, 3.5-4.5		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Service Pack	Includes Valve	20036	31-40, 3.5-4.5		Sensor	-	28849	31-40, 3.5-4.5
Service Pack	Includes Valve	20036	31-40, 3.5-4.5	Service Pack		-	20022	31-40, 3.5-4.5	

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2009 (cont.)					2008 (cont.)					
Hyundai (cont.)	Azera, Elantra	EZ-Sensor	-	33000*	11.5, 1.3	Azera, Elantra	EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		Sensor	Includes Transmitter Only	20086	31-40, 3.5-4.5		Sensor	Includes Transmitter Only	20086	31-40, 3.5-4.5
		Service Pack	Includes Valve	20036	31-40, 3.5-4.5		Service Pack	Includes Valve	20036	31-40, 3.5-4.5
	Entourage	Sensor	Includes Transmitter Only	20085	31-40, 3.5-4.5	Entourage	Sensor	Includes Transmitter Only	20085	31-40, 3.5-4.5
		Service Pack	Includes Valve	20036	31-40, 3.5-4.5		Service Pack	Includes Valve	20036	31-40, 3.5-4.5
	Genesis	Service Pack	-	20022	31-40, 3.5-4.5	Santa Fe	EZ-Sensor	-	33000*	11.5, 1.3
	Santa Fe	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	Includes Transmitter Only	20085	31-40, 3.5-4.5
		Sensor	Includes Transmitter Only	20086	31-40, 3.5-4.5		Service Pack	Includes Valve	20036	31-40, 3.5-4.5
		Service Pack	Includes Valve	20036	31-40, 3.5-4.5	Sonata	EZ-Sensor	-	33000*	11.5, 1.3
	Sonata	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	-	28983	31-40, 3.5-4.5
		Sensor	-	28849	31-40, 3.5-4.5		Service Pack	Includes Valve	20036	31-40, 3.5-4.5
		Service Pack	-	20022	31-40, 3.5-4.5	Tiburon, Tucson	Sensor	-	28983	31-40, 3.5-4.5
	Tucson	Sensor	-	28983	31-40, 3.5-4.5		Service Pack	Includes Valve	20036	31-40, 3.5-4.5
		Service Pack	Includes Valve	20036	31-40, 3.5-4.5	Veracruz	EZ-Sensor	-	33000*	11.5, 1.3
Veracruz	EZ-Sensor	-	33000*	11.5, 1.3	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Sensor		Includes Transmitter Only	20085	31-40, 3.5-4.5	
	Sensor	Includes Transmitter Only	20086	31-40, 3.5-4.5	Service Pack		Includes Valve	20036	31-40, 3.5-4.5	
	Service Pack	Includes Valve	20036	31-40, 3.5-4.5	2007					
2008					Azera, Elantra	EZ-Sensor	-	33000*	11.5, 1.3	
Accent	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	Includes Transmitter Only	20086	31-40, 3.5-4.5	
	Sensor	-	28849	31-40, 3.5-4.5		Service Pack	Includes Valve	20036	31-40, 3.5-4.5	
	Service Pack	-	20022	31-40, 3.5-4.5	Entourage, Santa Fe	Sensor	Includes Transmitter Only	20085	31-40, 3.5-4.5	
	Service Pack	Includes Valve	20036	31-40, 3.5-4.5						

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
Hyundai (cont.)					2012					
2007 (cont.)					EX35, FX35, FX50, G25, G37	EZ-Sensor	-	33000*	11.5, 1.3	
Sonata, Tiburon, Tucson	Sensor	-	28983	31-40, 3.5-4.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	Includes Valve	20036	31-40, 3.5-4.5		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
Veracruz	Sensor	Includes Transmitter Only	20085	31-40, 3.5-4.5		Sensor	-		66, 7.5 .	
	Service Pack	Includes Valve	20036	31-40, 3.5-4.5		Service Pack	-		66, 7.5 .	
2006					M35, M35H, M37, M56	EZ-Sensor	-	33000*	11.5, 1.3	
Azera	Sensor	Includes Transmitter Only	20086	31-40, 3.5-4.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	Includes Valve	20036	31-40, 3.5-4.5		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
Tucson	Sensor	-	28983	31-40, 3.5-4.5		Sensor	-	28204	66, 7.5 .	
	Service Pack	Includes Valve	20036	31-40, 3.5-4.5		Service Pack	-	20014	66, 7.5 .	
2014					QX56	EZ-Sensor	-	33000*	11.5, 1.3	
Q50, Q60, QX50, QX60, QX70, QX80	Sensor	-				EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	-				EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
2013						Sensor	-		66, 7.5 .	
EX35, FX35, FX37	EZ-Sensor	-	33000*	11.5, 1.3		Service Pack	-		66, 7.5 .	
Infiniti	FX50	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	EX35, FX35, FX50, G25, G37	EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		Sensor	-		66, 7.5 .		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		Service Pack	-		66, 7.5 .		Sensor	-	28204	66, 7.5 .
		Sensor	-		66, 7.5 .		Service Pack	-	20014	66, 7.5 .
	G37	Service Pack	-		66, 7.5 .	M35, M37, M56	EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	-	28204	66, 7.5 .
		Sensor	-		66, 7.5 .		Service Pack	-	20014	66, 7.5 .
	Q50, Q60	Service Pack	-		66, 7.5 .	QX56	EZ-Sensor	-	33000*	11.5, 1.3
		Sensor	-				EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	QX50	Service Pack	-				EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		Sensor	-				Sensor	-		66, 7.5 .
	QX56	Service Pack	-				Service Pack	-		66, 7.5 .
EZ-Sensor		-	33000*	11.5, 1.3	2011					
EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	EX35, FX35, FX50, G37	EZ-Sensor	-	33000*	11.5, 1.3	
EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
Sensor		-				EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
Service Pack	-			Sensor		-	28210	66, 7.5 .		
Sensor	-			Service Pack		-	20014	66, 7.5 .		
QX60, QX70, QX80	Service Pack	-			M35, M45, QX56	EZ-Sensor	-	33000*	11.5, 1.3	
	Sensor	-				EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
2010						EX35, FX35, FX50, G37	EZ-Sensor	-	33000*	11.5, 1.3
QX56	EZ-Sensor	-	33000*	11.5, 1.3			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3			EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Sensor		-	28210	66, 7.5 .	
	Sensor	-			Service Pack		-	20014	66, 7.5 .	
	Service Pack	-			EZ-Sensor	-	33000*	11.5, 1.3		

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2010 (cont.)					2007					
M35, M45, QX56	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	FX35, FX45	EZ-Sensor	-	33000*	11.5, 1.3	
	Sensor	-	28204	66, 7.5 .		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	-	20014	66, 7.5 .		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
2009						Sensor	Jun. & Older	20064	66, 7.5 .	
EX35, FX35, FX50, G37	EZ-Sensor	-	33000*	11.5, 1.3		Sensor	Jul. & Newer	28204	66, 7.5 .	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	Jun. & Older	20007	66, 7.5 .	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	Jul. & Newer	20014	66, 7.5 .	
	Sensor	-	28210	66, 7.5 .		G35	EZ-Sensor	-	33000*	11.5, 1.3
	Service Pack	-	20014	66, 7.5 .			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
M35, M45, QX56	EZ-Sensor	-	33000*	11.5, 1.3			EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Sensor		Coupe	28204	66, 7.5 .	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Sensor	Sedan	28210	66, 7.5 .		
	Sensor	-	28204	66, 7.5 .	Service Pack	-	20014	66, 7.5 .		
	Service Pack	-	20014	66, 7.5 .	M35, M45	EZ-Sensor	-	33000*	11.5, 1.3	
2008						EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
EX35	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	20064	66, 7.5 .	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Service Pack	-	20007	66, 7.5 .		
	Sensor	-	28210	66, 7.5 .	QX56	EZ-Sensor	-	33000*	11.5, 1.3	
	Service Pack	-	20014	66, 7.5 .		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
FX35, FX45	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	Mar. & Older	20161	49, 5.5	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	Apr. 1 & Newer	28204	49, 5.5	
	Sensor	-	28204	66, 7.5 .		Service Pack	Mar. & Older	20007	49, 5.5	
	Service Pack	-	20014	66, 7.5 .	Service Pack	Apr. 1 & Newer	20014	49, 5.5		
G35, G37	EZ-Sensor	-	33000*	11.5, 1.3	2006					
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	FX35, FX45	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Sensor	-	28210	66, 7.5 .		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Service Pack	-	20014	66, 7.5 .		Sensor	-	20064	66, 7.5 .	
	M35, M45	EZ-Sensor	-	33000*	11.5, 1.3	Service Pack	-	20007	66, 7.5 .	
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	G35	EZ-Sensor	-	33000*	11.5, 1.3
EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	
Sensor		-	28204	66, 7.5 .	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	
Service Pack		-	20014	66, 7.5 .	Sensor		-	20064	61-72, 6.8-8.2	
QX56	EZ-Sensor	-	33000*	11.5, 1.3	Service Pack	-	20007	61-72, 6.8-8.2		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	M35, M45	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Sensor	-	28204	49, 5.5		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Service Pack	-	20014	49, 5.5		Sensor	-	20064	66, 7.5 .	
Service Pack	-	20014	49, 5.5	Service Pack		-	20007	66, 7.5 .		

* Programming Tool Required



On the winding road of TPMS

Bartec is always **AHEAD** of the curve!



**First
Wireless
TPMS
Service
Tool**



**First
OBDII
TPMS
Service
Tool**



**First
Wireless
Front
Counter
Tool**



**First
"At-the-car"
Sensor
Programming**



**First TPMS Tool
to feature Inductive
Charging**



**First OBDII Relearn
Solution for Mitsubishi
Vehicles**

IT'S SO EZ.



EZ-sensor[®]

- Fully programmable TPMS sensor • Produced to OE standards • Snap-in & clamp-in service packs
- New WAL sensor technology • Programs wirelessly • 2 part numbers cover 90% of the market

 **SCHRADER[®]**

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2006 (cont.)					2004 (cont.)					
Q45	EZ-Sensor	-	33000*	11.5, 1.3	FX35, FX45 (cont.)	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	20064	66, 7.5 .	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	-	20007	66, 7.5 .	
	QX56	Sensor	Jul. & Older	20064	66, 7.5 .	G35	EZ-Sensor	-	33000*	11.5, 1.3
		Sensor	Aug. & Newer	28204	66, 7.5 .		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		Service Pack	Jul. & Older	20007	66, 7.5 .		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		Service Pack	Aug. & Newer	20014	66, 7.5 .		Sensor	-	20064	61-72, 6.8-8.2
Service Pack		-	33000*	11.5, 1.3	Service Pack		-	20007	61-72, 6.8-8.2	
EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	M45, Q45	EZ-Sensor	-	33000*	11.5, 1.3	
EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
Sensor	W/Steel Wheels	20069	49, 5.5	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7		
Sensor	W/Alloy Wheels	20161	49, 5.5	Sensor		-	20064	66, 7.5 .		
Service Pack	W/Steel Wheels	20005	49, 5.5	Service Pack		-	20007	66, 7.5 .		
Service Pack	W/Alloy Wheels	20007	49, 5.5	QX56	EZ-Sensor	-	33000*	11.5, 1.3		
2005					2003					
FX35, FX45	EZ-Sensor	-	33000*		11.5, 1.3	FX35, FX45	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018		11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000		62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	-	20064	66, 7.5 .	Sensor		-	20064	66, 7.5 .	
	Service Pack	-	20007	66, 7.5 .	Service Pack		-	20007	66, 7.5 .	
G35	EZ-Sensor	-	33000*	11.5, 1.3	G35	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Sensor	-	20064	61-72, 6.8-8.2		Sensor	Jun. & Newer	20064	61-72, 6.8-8.2	
	Service Pack	-	20007	61-72, 6.8-8.2		Service Pack	Jun. & Newer	20007	61-72, 6.8-8.2	
Q45	EZ-Sensor	-	33000*	11.5, 1.3	M45, Q45, QX4	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Sensor	-	20064	66, 7.5 .		Sensor	-	20064	66, 7.5 .	
	Service Pack	-	20007	66, 7.5 .		Service Pack	-	20007	66, 7.5 .	
QX56	EZ-Sensor	-	33000*	11.5, 1.3	2009					
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	I-290, I-370	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Sensor	W/Steel Wheels	20069	49, 5.5		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Sensor	W/Alloy Wheels	20161	49, 5.5		Sensor	-	20131	62, 7	
	Service Pack	W/Steel Wheels	20005	49, 5.5		Service Pack	-	20006	62, 7	
	Service Pack	W/Alloy Wheels	20007	49, 5.5	2004					
FX35, FX45	EZ-Sensor	-	33000*	11.5, 1.3	FX35, FX45	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.
2008-2007					2007				
Ascender	Sensor	-	20116	62, 7	Super V8, Vanden Plas, XJ8, XJR, XK, XKR	Sensor	W/315 MHz Sensor	20090	71, 8
	Service Pack	-	20004	62, 7		Sensor	W/433 MHz Sensor	20091	71, 8
I-290, I-370	EZ-Sensor	-	33000*	11.5, 1.3		Service Pack	-	20030	71, 8
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	2006-2005				
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	Super V8, Vanden Plas, XJ8, XJR	Sensor	W/315 MHz Sensor	20090	71, 8
	Sensor	-	20131	62, 7		Sensor	W/433 MHz Sensor	20091	71, 8
	Service Pack	-	20006	62, 7		Service Pack	-	20030	71, 8
	2006					2004			
Ascender	Sensor	-	20116	62, 7	Vanden Plas, XJ8, XJR	Sensor	W/315 MHz Sensor	20090	71, 8
	Service Pack	-	20004	62, 7		Sensor	W/433 MHz Sensor	20091	71, 8
Rodeo	2004					Service Pack	-	20030	71, 8
	EZ-Sensor	-	33100	11.5, 1.3	2014				
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Cherokee	Sensor	-	28984	N/A
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		Service Pack	-		
	Sensor	-	20028**	62, 7	Compass	Sensor	-	28308	11.5, 1.3
	Service Pack	-	20003	62, 7		Service Pack	Rubber Valve	20018	11.5, 1.3
2014					Grand Cherokee	EZ-Sensor		33200	11.5, 1.3
XJ	Sensor					EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Service Pack	-				EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
2013						Sensor	-	20398	11.5, 1.3
XF, XJ, XK	Sensor					Service Pack	-	20018	11.5, 1.3
	Service Pack	-				Patriot	Sensor	W/315 MHz	28308
2012					Service Pack		Rubber Valve	20018	11.5, 1.3
XF, XJ, XK	Sensor	W/315 MHz Sensor	20090	71, 8	Wrangler	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33200	11.5, 1.3
	Sensor	W/433 MHz Sensor	20091	71, 8		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Service Pack	-	20030	71, 8		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
2011						Sensor	-	20398	11.5, 1.3
XF, XFR, XJ, XK, XKR	Sensor	W/315 MHz Sensor	20090	71, 8		Service Pack	-	20018	11.5, 1.3
	Sensor	W/433 MHz Sensor	20091	71, 8		2013			
	Service Pack	-	20030	71, 8	Compass	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3
2010						EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
XF, XFR, XJ, XK, XKR	Sensor	W/315 MHz Sensor	20090	71, 8		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
	Sensor	W/433 MHz Sensor	20091	71, 8		Sensor	-	28308	11.5, 1.3
	Service Pack	-	20030	71, 8		Service Pack	Rubber Valve	20018	11.5, 1.3
2009						Grand Cherokee	EZ-Sensor		33200
Super V8, Vanden Plas, XF, XJ8, XJR, XK, XKR	Sensor	W/315 MHz Sensor	20090	71, 8	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3
	Sensor	W/433 MHz Sensor	20091	71, 8	EZ-Sensor Service Pack		Almm. Valve	34000	62, 7
	Service Pack	-	20030	71, 8	Sensor		-	20398	11.5, 1.3
2008					Service Pack		-	20018	11.5, 1.3
S-Type, Super V-8, Vanden Plas, X-Type, XJ8, XJR, XK, XKR	Sensor	W/315 MHz Sensor	20090	71, 8	Patriot		Sensor	W/315 MHz	28308
	Sensor	W/433 MHz Sensor	20091	71, 8		Service Pack	Rubber Valve	20018	11.5, 1.3
	Service Pack	-	20030	71, 8		2013			

* Programming Tool Required ** Magnet Required to Activate Sensor

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.		
2013 (cont.)					2011						
Wrangler	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33200	11.5, 1.3	Com-mander	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33100	11.5, 1.3		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		
	Sensor	-	20398	11.5, 1.3		Sensor	-	28155	58, 6.5		
	Service Pack	-	20018	11.5, 1.3		Sensor	-	28434	11.5, 1.3		
2012						Service Pack	Does Not Include Stem	20013	58, 6.5		
Compass	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3		Service Pack	Rubber Valve	20018	11.5, 1.3		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	Includes Stem Only	20020	58, 6.5		
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		Compass	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3	
	Sensor	-	28308	11.5, 1.3			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	Rubber Valve	20018	11.5, 1.3	EZ-Sensor Service Pack		Almm. Valve	34000	62, 7		
Grand Cherokee	EZ-Sensor		33200	11.5, 1.3	Sensor		-	20066	58, 6.5		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Sensor		-	28308	11.5, 1.3		
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	Service Pack		W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5		
	Sensor	-	20398	11.5, 1.3	Service Pack		Rubber Valve	20018	11.5, 1.3		
	Service Pack	-	20018	11.5, 1.3	Service Pack		W/Schrader Sensor; Includes Stem Only	20020	58, 6.5		
Liberty	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3	Grand Cherokee		EZ-Sensor		33200	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		
	Sensor	-	20066	58, 6.5		Sensor	-	20398	11.5, 1.3		
	Sensor	-	28308	11.5, 1.3		Service Pack	-	20018	11.5, 1.3		
	Service Pack	Does Not Include Stem	20013	58, 6.5		Liberty	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3	
	Service Pack	Rubber Valve	20018	11.5, 1.3			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	Includes Stem Only	20020	58, 6.5			EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
	Patriot	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*			11.5, 1.3	Sensor	-	20066	58, 6.5
		EZ-Sensor Service Pack	Rubber Valve	20018			11.5, 1.3	Sensor	-	28308	11.5, 1.3
EZ-Sensor Service Pack		Almm. Valve	34000	62, 7	Service Pack		Does Not Include Stem	20013	58, 6.5		
Sensor		-	20066	58, 6.5	Service Pack		Rubber Valve	20018	11.5, 1.3		
Service Pack		W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5	Service Pack		Includes Stem Only	20020	58, 6.5		
Wrangler (cont.)	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3	Patriot, Wrangler		EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		
	Sensor	-	20066	58, 6.5		Sensor	-	20066	58, 6.5		
	Sensor	-	28308	11.5, 1.3		Sensor	-	28308	11.5, 1.3		
	Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5		Service Pack	Does Not Include Stem	20013	58, 6.5		
	Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	Rubber Valve	20018	11.5, 1.3		
	Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5		Service Pack	Includes Stem Only	20020	58, 6.5		
	Wrangler (cont.)	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*		11.5, 1.3	Patriot, Wrangler	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018		11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
EZ-Sensor Service Pack		Almm. Valve	34000	62, 7	EZ-Sensor Service Pack	Almm. Valve		34000	62, 7		
Sensor		-	20066	58, 6.5	Sensor	-		20066	58, 6.5		
Service Pack		-	20018	11.5, 1.3	Service Pack	W/Schrader Sensor; Does Not Include Stem		20013	58, 6.5		
Service Pack	-	20018	11.5, 1.3	Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5				

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.
2010					2010 (cont.)				
Com- mander	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33100	11.5, 1.3	Patriot (cont.)	Sensor	-	28308	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5
	Sensor	-	28155	58, 6.5		Service Pack	W/Siemens Sensor	20030	71, 8
	Sensor	-	28434	11.5, 1.3	Wrangler	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33100	11.5, 1.3
	Service Pack	Does Not Include Stem	20013	58, 6.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
	Service Pack	Includes Stem Only	20020	58, 6.5		Sensor	-	28155	58, 6.5
Compass	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3		Sensor	-	28434	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	Does Not Include Stem	20013	58, 6.5
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		Service Pack	Includes Stem Only	20020	58, 6.5
	Sensor	-	20066	58, 6.5		2009			
	Sensor	-	28308	11.5, 1.3	Com- mander	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33100	11.5, 1.3
	Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
	Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5		Sensor	-	28155	58, 6.5
Service Pack	W/Siemens Sensor	20030	71, 8	Sensor		-	28434	11.5, 1.3	
Grand Cherokee	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33100	11.5, 1.3		Service Pack	Does Not Include Stem	20013	58, 6.5
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		Service Pack	Includes Stem Only	20020	58, 6.5
	Sensor	-	28155	58, 6.5	Compass	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3
	Sensor	-	28434	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Service Pack	Does Not Include Stem	20013	58, 6.5		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
	Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	20066	58, 6.5
	Service Pack	Includes Stem Only	20020	58, 6.5		Sensor	-	28308	11.5, 1.3
Liberty	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3		Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5
	Sensor	-	20066	58, 6.5	Service Pack	W/Siemens Sensor	20030	71, 8	
	Sensor	-	28308	11.5, 1.3	Grand Cherokee	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33100	11.5, 1.3
	Service Pack	Does Not Include Stem	20013	58, 6.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
	Service Pack	Includes Stem Only	20020	58, 6.5		Sensor	-	28155	58, 6.5
Patriot	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3		Sensor	-	28434	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	Does Not Include Stem	20013	58, 6.5
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		Service Pack	Rubber Valve	20018	11.5, 1.3
	Sensor	-	20066	58, 6.5		Service Pack	Includes Stem Only	20020	58, 6.5

* Programming Tool Required

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.		
2009 (cont.)					2008 (cont.)						
Liberty	EZ-Sensor	W/315 MHz Sensor. Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3	Compass	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3		
	EZ-Sensor	W/433 MHz Sensor. Caution: Pressure by location vehicles not supported by EZ-sensor	33100	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		Sensor	-	20066	58, 6.5		
	Sensor	W/315 MHz Sensor	20066	58, 6.5		Sensor	-	28308	11.5, 1.3		
	Sensor	W/315 MHz Sensor	28155	58, 6.5		Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5		
	Sensor	W/315 MHz Sensor	28308	11.5, 1.3		Service Pack	Rubber Valve	20018	11.5, 1.3		
	Sensor	W/315 MHz Sensor	28434	11.5, 1.3		Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5		
	Service Pack	Does Not Include Stem	20013	58, 6.5		Service Pack	W/Siemens Sensor	20030	71, 8		
	Service Pack	Includes Stem Only	20020	58, 6.5		Grand Cherokee	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33100	11.5, 1.3	
Patriot	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	EZ-Sensor Service Pack		Almm. Valve	34000	62, 7		
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	Sensor		-	28155	58, 6.5		
	Sensor	-	20066	58, 6.5	Sensor		-	28434	11.5, 1.3		
	Sensor	-	28308	11.5, 1.3	Service Pack		Does Not Include Stem	20013	58, 6.5		
	Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5	Service Pack		Rubber Valve	20018	11.5, 1.3		
	Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5	Service Pack		Includes Stem Only	20020	58, 6.5		
	Service Pack	W/Siemens Sensor	20030	71, 8	Liberty, Patriot, Wrangler		EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3	
	Wrangler	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33100			11.5, 1.3	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018		11.5, 1.3	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
EZ-Sensor Service Pack		Almm. Valve	34000	62, 7		Sensor	-	20066	58, 6.5		
Sensor		-	28155	58, 6.5		Sensor	-	28308	11.5, 1.3		
Sensor		-	28434	11.5, 1.3		Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5		
Service Pack		Does Not Include Stem	20013	58, 6.5		Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5		
Service Pack		Includes Stem Only	20020	58, 6.5		Service Pack	W/Siemens Sensor	20030	71, 8		
2008						2007					
Com- mander		EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33100		11.5, 1.3	Com- mander, Compass, Grand Cherokee, Liberty, Patriot, Wrangler	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	EZ-Sensor Service Pack	Almm. Valve		34000	62, 7		
	Sensor	-	28155	58, 6.5	Sensor	-		20066	58, 6.5		
	Sensor	-	28434	11.5, 1.3	Sensor	-		28308	11.5, 1.3		
	Service Pack	Does Not Include Stem	20013	58, 6.5	Service Pack	W/Schrader Sensor; Does Not Include Stem		20013	58, 6.5		
	Service Pack	Rubber Valve	20018	11.5, 1.3	Service Pack	Rubber Valve		20018	11.5, 1.3		
	Service Pack	Includes Stem Only	20020	58, 6.5	Service Pack	W/Schrader Sensor; Includes Stem Only		20020	58, 6.5		
					Service Pack	W/Siemens Sensor	20030	71, 8			

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2006					2014 (cont.)					
Jeep (cont.)	Com-mander, Grand Cherokee, Liberty	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3	Sedona	Sensor	Includes Transmitter Only		
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	Includes Valve		
		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	Sorento	EZ-Sensor	-	33000*	11.5, 1.3
		Sensor	-	20066	58, 6.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		Sensor	-	28308	11.5, 1.3		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
		Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5		Sensor	-		
		Service Pack	Rubber Valve	20018	11.5, 1.3	2013				
		Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5	Forte, Optima	EZ-Sensor	-	33000*	11.5, 1.3
		Service Pack	W/Siemens Sensor	20030	71, 8		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
Grand Cherokee, Liberty	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3	EZ-Sensor Service Pack		Almm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Sensor		-	20092	31-40, 3.5-4.5	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	Rio	Sensor	-	20086	31-40, 3.5-4.5	
	Sensor	-	20066	58, 6.5		Service Pack	Includes Valve	20036	31-40, 3.5-4.5	
	Sensor	-	28308	11.5, 1.3	Sedona	EZ-Sensor	-	33000*	11.5, 1.3	
	Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
	Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5		Sensor	Includes Transmitter Only	20086	31-40, 3.5-4.5	
	Service Pack	W/Siemens Sensor	20030	71, 8	Service Pack	Includes Valve	20036	31-40, 3.5-4.5		
2005					Kia (cont.)	Sorento	EZ-Sensor	-	33000*	11.5, 1.3
Grand Cherokee, Liberty	EZ-Sensor		33100	11.5, 1.3			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3			EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		Sensor	-	20092	31-40, 3.5-4.5	
	Sensor	-	20028**	64, 7		Soul	EZ-Sensor	-	33000*	11.5, 1.3
	Service Pack	-	20003	64, 7			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
Service Pack	-	20003	64, 7	EZ-Sensor Service Pack			Almm. Valve	34000	62, 7	
2004						Sportage	Sensor	-	28849	31-40, 3.5-4.5
Grand Cherokee, Liberty	EZ-Sensor		33100	11.5, 1.3			Service Pack	-	20022	31-40, 3.5-4.5
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	2012					
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	Forte, Optima		EZ-Sensor	-	33000*	11.5, 1.3
	Sensor	-	20028**	64, 7			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Service Pack	-	20003	64, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
Service Pack	-	20003	64, 7	Sensor		-	20092	31-40, 3.5-4.5		
2003-2002					Rio	Sensor	-	20086	31-40, 3.5-4.5	
Grand Cherokee, Liberty	EZ-Sensor		33100	11.5, 1.3		Service Pack	Includes Valve	20036	31-40, 3.5-4.5	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	2014					
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	Kia	Cadenza	EZ-Sensor	-	33000*	11.5, 1.3
	Sensor	-	20028**	64, 7			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Service Pack	-	20003	64, 7			EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
Service Pack	-	20003	64, 7	Sensor			-	20092	31-40, 3.5-4.5	
Service Pack	-	20003	64, 7	Service Pack			-			
2014					Forte	Sensor	-			
Kia	Cadenza	EZ-Sensor		33000*		11.5, 1.3	Service Pack	-		
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	2012				
		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	Forte, Optima	EZ-Sensor	-	33000*	11.5, 1.3
		Sensor	-	20092	31-40, 3.5-4.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		Service Pack	-				EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
Service Pack	-			Sensor	-		20092	31-40, 3.5-4.5		
Forte	Sensor	-			Rio	Sensor	-	20086	31-40, 3.5-4.5	
	Service Pack	-				Service Pack	Includes Valve	20036	31-40, 3.5-4.5	

* Programming Tool Required ** Magnet Required to Activate Sensor

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2012 (cont.)					2011 (cont.)					
Sedona	EZ-Sensor	-	33000*	11.5, 1.3	Sorento, Soul	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
	Sensor	Includes Transmitter Only	20086	31-40, 3.5-4.5		Sensor	-	20092	31-40, 3.5-4.5	
	Service Pack	Includes Valve	20036	31-40, 3.5-4.5		Sportage	EZ-Sensor	-	33000*	11.5, 1.3
Sorento, Soul	EZ-Sensor	-	33000*	11.5, 1.3	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	EZ-Sensor Service Pack		Almm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	Sensor		-	28849	31-40, 3.5-4.5	
	Sensor	-	20092	31-40, 3.5-4.5	Service Pack		-	20022	31-40, 3.5-4.5	
Sportage	EZ-Sensor	-	33000*	11.5, 1.3	2010					
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Borrego	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Sensor	-	28849	31-40, 3.5-4.5		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
	Service Pack	-	20022	31-40, 3.5-4.5		Sensor	-	28849	31-40, 3.5-4.5	
				Service Pack		-	20022	31-40, 3.5-4.5		
2011					Forte	EZ-Sensor	-	33000*	11.5, 1.3	
Borrego	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		Sensor	-	20092	31-40, 3.5-4.5	
	Sensor	-	28849	35-35.7, 3.5-4.5		Magentis	Sensor	Includes Transmitter Only	20086	31-40, 3.5-4.5
	Service Pack	-	20022	35-35.7, 3.5-4.5	Service Pack		Includes Valve	20036	31-40, 3.5-4.5	
Forte, Optima	EZ-Sensor	-	33000*	11.5, 1.3	Optima	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
	Sensor	-	20092	31-40, 3.5-4.5		Sensor	Includes Transmitter Only	20086	31-40, 3.5-4.5	
Rio	EZ-Sensor	-	33000*	11.5, 1.3	Service Pack	Includes Valve	20036	31-40, 3.5-4.5		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Rio	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Sensor	-	28849	35-35.7, 3.5-4.5	EZ-Sensor Service Pack		Almm. Valve	34000	62, 7	
	Service Pack	-	20022	35-35.7, 3.5-4.5	Sensor		-	28849	35-35.7, 3.5-4.5	
				Service Pack	-		20022	35-35.7, 3.5-4.5		
Rondo, Sedona	EZ-Sensor	-	33000*	11.5, 1.3	Rondo, Sedona	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
	Sensor	Includes Transmitter Only	20086	31-40, 3.5-4.5						
	Service Pack	Includes Valve	20036	31-40, 3.5-4.5						

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.
2010 (cont.)					2009 (cont.)				
Rondo, Sedona (cont.)	Sensor	Includes Transmitter Only	20086	31-40, 3.5-4.5	Rondo, Sedona (cont.)	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Service Pack	Includes Valve	20036	31-40, 3.5-4.5		Sensor	Includes Transmitter Only	20086	31-40, 3.5-4.5
Soul	EZ-Sensor	-	33000*	11.5, 1.3	Soul	Service Pack	Includes Valve	20036	31-40, 3.5-4.5
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sorento	Sensor	-	28983
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Service Pack		Includes Valve	20036	35-35.7, 3.5-4.5
	Sensor	-	20092	31-40, 3.5-4.5	Spectra	EZ-Sensor	-	33000*	11.5, 1.3
Sportage	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	-	28849	35-35.7, 3.5-4.5
	Sensor	-	28849	31-40, 3.5-4.5	Service Pack	-	20022	35-35.7, 3.5-4.5	
Sportage	Service Pack	-	20022	31-40, 3.5-4.5	Sportage	EZ-Sensor	-	33000*	11.5, 1.3
						EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
2009					2008				
Amanti	Sensor	-	28983	35-35.7, 3.5-4.5	Amanti	Sensor	-	28983	35-35.7, 3.5-4.5
	Service Pack	Includes Valve	20036	35-35.7, 3.5-4.5		Service Pack	Includes Valve	20036	35-35.7, 3.5-4.5
Borrego	EZ-Sensor	-	33000*	11.5, 1.3	Magentis	Sensor	Includes Transmitter Only	20086	31-40, 3.5-4.5
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	Includes Valve	20036	31-40, 3.5-4.5
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Optima	EZ-Sensor	-	33000*	11.5, 1.3
	Sensor	-	28849	31-40, 3.5-4.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
Service Pack	-	20022	31-40, 3.5-4.5	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	
				Sensor		Includes Transmitter Only	20086	31-40, 3.5-4.5	
Magentis	Sensor	Includes Transmitter Only	20086	31-40, 3.5-4.5	Optima	Service Pack	Includes Valve	20036	31-40, 3.5-4.5
	Service Pack	Includes Valve	20036	31-40, 3.5-4.5		Rio	EZ-Sensor	-	33000*
Optima	EZ-Sensor	-	33000*	11.5, 1.3	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Sensor		-	28849	35-35.7, 3.5-4.5
	Sensor	Includes Transmitter Only	20086	31-40, 3.5-4.5	Service Pack	-	20022	35-35.7, 3.5-4.5	
Optima	Service Pack	Includes Valve	20036	31-40, 3.5-4.5	Rondo	EZ-Sensor	-	33000*	11.5, 1.3
	Service Pack	Includes Valve	20036	31-40, 3.5-4.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
Rio	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3					
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7					
	Sensor	-	28849	35-35.7, 3.5-4.5					
	Service Pack	-	20022	35-35.7, 3.5-4.5					
Rondo, Sedona	EZ-Sensor	-	33000*	11.5, 1.3					
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3					

* Programming Tool Required

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.
2008 (cont.)					2007 (cont.)				
Rondo (cont.)	Sensor	Includes Transmitter Only	20086	31-40, 3.5-4.5	Sorento	Sensor	-	28983	35-35.7, 3.5-4.5
	Service Pack	Includes Valve	20036	31-40, 3.5-4.5		Service Pack	Includes Valve	20036	35-35.7, 3.5-4.5
Sedona	Sensor	Includes Transmitter Only	20085	31-40, 3.5-4.5	Spectra	EZ-Sensor	-	33000*	11.5, 1.3
	Service Pack	Includes Valve	20036	31-40, 3.5-4.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
Sorento	Sensor	-	28983	35-35.7, 3.5-4.5		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Service Pack	Includes Valve	20036	35-35.7, 3.5-4.5		Sensor	-	28849	35-35.7, 3.5-4.5
Spectra	EZ-Sensor	-	33000*	11.5, 1.3	Service Pack	-	20022	35-35.7, 3.5-4.5	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Sportage	Sensor	-	28983	31-40, 3.5-4.5
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	Includes Valve	20036	31-40, 3.5-4.5
	Sensor	-	28849	35-35.7, 3.5-4.5	2006				
Service Pack	-	20022	35-35.7, 3.5-4.5	Optima, Rondo	EZ-Sensor	-	33000*	11.5, 1.3	
Sportage	Sensor	-	28983		31-40, 3.5-4.5	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Service Pack	Includes Valve	20036		31-40, 3.5-4.5	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
2007					Sensor	Includes Transmitter Only	20086	31-40, 3.5-4.5	
Amanti	Sensor	-	28983	35-35.7, 3.5-4.5	Service Pack	Includes Valve	20036	31-40, 3.5-4.5	
	Service Pack	Includes Valve	20036	35-35.7, 3.5-4.5	Sedona	Sensor	Includes Transmitter Only	20085	31-40, 3.5-4.5
Optima	EZ-Sensor	-	33000*	11.5, 1.3		Service Pack	Includes Valve	20036	31-40, 3.5-4.5
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Spectra	Sensor	-	28849	35-35.7, 3.5-4.5
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	-	20022	35-35.7, 3.5-4.5
	Sensor	Includes Transmitter Only	20086	31-40, 3.5-4.5	Sportage	Sensor	-	28983	31-40, 3.5-4.5
Service Pack	Includes Valve	20036	31-40, 3.5-4.5	Service Pack		Includes Valve	20036	31-40, 3.5-4.5	
Rio	EZ-Sensor	-	33000*	11.5, 1.3	2005				
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Sportage	Sensor	Jun. 15, 2005 & Newer	28983	31-40, 3.5-4.5
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	Jun. 15, 2005 & Newer; Includes Valve	20036	31-40, 3.5-4.5
	Sensor	-	28849	35-35.7, 3.5-4.5	2013-2012				
	Service Pack	-	20022	35-35.7, 3.5-4.5	Evoque, LR2, LR4, Range Rover	Sensor	-	20090	71, 8
Rondo	EZ-Sensor	-	33000*	11.5, 1.3		Service Pack	-	20030	71, 8
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	2011-2010				
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	LR2	Sensor	-	20090	71, 8
	Sensor	Includes Transmitter Only	20086	31-40, 3.5-4.5		Service Pack	-	20030	71, 8
	Service Pack	Includes Valve	20036	31-40, 3.5-4.5	LR4, Range Rover	Sensor	W/315 MHz Sensor	20090	71, 8
Sedona	Sensor	Includes Transmitter Only	20085	31-40, 3.5-4.5		Sensor	W/433 MHz Sensor	20091	71, 8
	Service Pack	Includes Valve	20036	31-40, 3.5-4.5		Service Pack	-	20030	71, 8

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2009					2013 (cont.)					
LR2	Sensor	-	20090	71, 8	GS350 (cont.)	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Service Pack	-	20030	71, 8		Sensor	-			
LR3, Range Rover	Sensor	W/315 MHz Sensor	20090	71, 8		Service Pack	-			
	Sensor	W/433 MHz Sensor	20091	71, 8	GS450H, GX460, IS F, IS250, IS300H, IS350, LFA, LS460, LS600H, LX570, RX350, RX450H	EZ-Sensor	-	33000*	11.5, 1.3	
	Service Pack	-	20030	71, 8		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
2008	LR2	Sensor	-	20090		71, 8	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		Service Pack	-	20030		71, 8	Sensor	-	28370	35, 4
	LR3, Range Rover	Sensor	W/315 MHz Sensor	20090		71, 8	Service Pack	-	20032	35, 4
Sensor		W/433 MHz Sensor	20091	71, 8	RXF Sport	Sensor	Vehicle Made for Canada	28370	35, 4	
Service Pack		-	20030	71, 8		Service Pack	-	20032	35, 4	
2007-2006					2012					
LR3, Range Rover	Sensor	W/315 MHz Sensor	20090	71, 8	CT200H, ES350, GX460	EZ-Sensor	-	33000*	11.5, 1.3	
	Sensor	W/433 MHz Sensor	20091	71, 8		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	-	20030	71, 8		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
2005	LR3, Range Rover	Sensor	Includes Transmitter Only	28082		58, 6.5	Sensor	-	28370	35, 4
		Service Pack	Does Not Include Valve	20023		58, 6.5	Service Pack	-	20032	35, 4
		Service Pack	W/43mm Silver Insert	20037	58, 6.5	HS250H	EZ-Sensor	-	33000*	11.5, 1.3
		Service Pack	W/48mm Green Insert	20038	58, 6.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		Service Pack	W/49mm Black Insert	20039	58, 6.5		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
Service Pack	W/51mm Orange Insert	20040	58, 6.5	Sensor	-		28345	35, 4		
Service Pack	W/51mm Orange Insert	20040	58, 6.5	Service Pack	-		20032	35, 4		
2004-2002					2011					
Range Rover	Sensor	Includes Transmitter Only	28082	58, 6.5	IS C, IS F, IS250, IS300H, IS350, LFA, LS460, LS600H, RX350	EZ-Sensor	-	33000*	11.5, 1.3	
	Service Pack	Does Not Include Valve	20023	58, 6.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	W/43mm Silver Insert	20037	58, 6.5		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Service Pack	W/48mm Green Insert	20038	58, 6.5		Sensor	-	28370	35, 4	
	Service Pack	W/49mm Black Insert	20039	58, 6.5		Service Pack	-	20032	35, 4	
	Service Pack	W/51mm Orange Insert	20040	58, 6.5	RX400H	EZ-Sensor	-	33000*	11.5, 1.3	
2014						ES300H, ES350, IS350, LX570, RX450H	EZ-Sensor	-	28370	35, 4
Sensor	-		28370	35, 4			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
Service Pack	-		20032	35, 4			EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
2013							Sensor	-	28370	35, 4
CT200H	EZ-Sensor	-	33000*	11.5, 1.3	Service Pack		-	20032	35, 4	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	RX450H	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Sensor	-	28370	35, 4		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Service Pack	-	20032	35, 4		Sensor	-	28370	35, 4	
Service Pack	-	20032	35, 4	Service Pack		-	20032	35, 4		
ES300H	Sensor	-	28370	35, 4	ES350	EZ-Sensor	-	33000*	11.5, 1.3	
	Service Pack	-	20032	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
ES350	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	28370	35, 4	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	-	20032	35, 4	
	Sensor	-	28370	35, 4	GS350	EZ-Sensor	-	33200	11.5, 1.3	
	Service Pack	-	20032	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
Service Pack	-	20032	35, 4	Service Pack		-	20032	35, 4		

* Programming Tool Required

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2011					2010 (cont.)					
CT200H, ES350, GS350, GS450H, GS460, GX460	EZ-Sensor	-	33000*	11.5, 1.3	RX350	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Sensor	-	28370	35, 4		Sensor	Models Made in Japan	28370	35, 4	
	Service Pack	-	20032	35, 4		Service Pack	-	20032	35, 4	
	Service Pack	-	20032	35, 4		Service Pack	-	20032	35, 4	
	HS250H	EZ-Sensor	-	33000*	11.5, 1.3	RX400H	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	Models Made in Japan	28370	35, 4
		Sensor	-	28345	35, 4		Service Pack	-	20032	35, 4
Service Pack		-	20032	35, 4	Service Pack		-	20032	35, 4	
IS C, IS F, IS250, IS300H, IS350, LFA, LS460, LS600H, LX570, RX350	EZ-Sensor	-	33000*	11.5, 1.3	RX450H	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Sensor	-	28370	35, 4		Sensor	-	28370	35, 4	
	Service Pack	-	20032	35, 4		Service Pack	-	20032	35, 4	
	Service Pack	-	20032	35, 4	Service Pack	-	20032	35, 4		
RX400H	EZ-Sensor	-	33000*	11.5, 1.3	SC430	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Sensor	Models Made in Japan	28370	35, 4		Sensor	-	28370	27, 3	
	Service Pack	-	20032	35, 4		Service Pack	-	20032	27, 3	
	Service Pack	-	20032	35, 4	Service Pack	-	20032	27, 3		
RX450H	EZ-Sensor	-	33000*	11.5, 1.3	2009-2008					
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	ES350, GS350, GS450H, GS460, GX470, IS C, IS F, IS250, IS300H, IS350, LS460, LS600H, LX570	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Sensor	-	28370	35, 4		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Service Pack	-	20032	35, 4		Sensor	-	28370	35, 4	
	Service Pack	-	20032	35, 4		Service Pack	-	20032	35, 4	
2010					RX350	EZ-Sensor	-	33000*	11.5, 1.3	
ES350, GS350, GS450H, GS460, GX460	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Sensor	-	28370	35, 4		Sensor	Models Made in Japan	28370	35, 4	
	Service Pack	-	20032	35, 4		Service Pack	-	20032	35, 4	
HS250H	EZ-Sensor	-	33000*	11.5, 1.3	RX400H	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Sensor	-	28345	35, 4		Sensor	Models Made in Japan	28370	35, 4	
	Service Pack	-	20032	35, 4		Service Pack	-	20032	35, 4	
IS C, IS F, IS250, IS300H, IS350, LS460, LS600H, LX570	EZ-Sensor	-	33000*	11.5, 1.3	SC430	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Sensor	-	28370	35, 4		Sensor	-	28370	27, 3	
	Service Pack	-	20032	35, 4		Service Pack	-	20032	27, 3	

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.		
2007					2006 (cont.)						
ES350, GS350, GS430, GS450H, GX470, IS C, IS F, IS250, IS300H, IS350, LS460, LX470	EZ-Sensor	-	33000*	11.5, 1.3	IS C, IS F	EZ-Sensor	-	33000*	11.5, 1.3		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		
	Sensor	-	28370	35, 4		Sensor	-	28370	35, 4		
	Service Pack	-	20032	35, 4		Service Pack	-	20032	35, 4		
RX350, RX400H	EZ-Sensor	-	33000*	11.5, 1.3	IS250	EZ-Sensor	-	33000*	11.5, 1.3		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		
	Sensor	Models Made in Japan	28370	35, 4		Sensor	Mar. & Older	28335	35, 4		
	Service Pack	-	20032	35, 4		Service Pack	Apr. 1 & Newer	28370	35, 4		
SC430	EZ-Sensor	-	33000*	11.5, 1.3	IS300H	Service Pack	Mar. & Older	20031	35, 4		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	Apr. 1 & Newer	20032	35, 4		
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		IS300H	EZ-Sensor	-	33000*	11.5, 1.3	
	Sensor	-	28370	27, 3			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	-	20032	27, 3			EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
GS300	2006				IS350		Sensor	-	28370	35, 4	
	EZ-Sensor	-	33000*	11.5, 1.3			Service Pack	-	20032	35, 4	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		IS350	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Sensor	-	28335	35, 4			EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
Service Pack	-	20031	35, 4	Sensor	Mar. & Older		28335	35, 4			
GS430	EZ-Sensor	-	33000*	11.5, 1.3	Sensor		Apr. 1 & Newer	28370	35, 4		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Service Pack	Mar. & Older	20031	35, 4			
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	Service Pack	Apr. 1 & Newer	20032	35, 4			
	Sensor	Jun. & Older	28335	35, 4	LX470	EZ-Sensor	-	33000*	11.5, 1.3		
	Sensor	Jul. & Newer	28370	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
	Service Pack	Jun. & Older	20031	35, 4		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		
	Service Pack	Jul. & Newer	20032	35, 4		Sensor	Jul. & Older	28365	35, 4		
	GX470	EZ-Sensor	-	33000*		11.5, 1.3	Sensor	Aug. & Newer	28370	35, 4	
EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	Service Pack	Jul. & Older	20031	35, 4			
EZ-Sensor Service Pack		Almm. Valve	34000	62, 7	Service Pack	Aug. & Newer	20032	35, 4			
Sensor		Feb. & Newer; W/O Valve Cap	28335	35, 4	RX330	EZ-Sensor	-	33000*	11.5, 1.3		
Sensor		Jan. 31 & Older	28345	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
Sensor		Feb. & Newer; W/Valve Cap	28365	35, 4		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		
Service Pack		Jan. 31 & Older	20031	35, 4		Sensor	Models Made in Japan; Feb. & Newer	28370	35, 4		
Service Pack		Feb. & Newer	20032	35, 4		Service Pack	Jan. 31 & Older	20031	35, 4		
Lexus (cont.)	GS430	Service Pack	20032	35, 4	Lexus (cont.)	RX330	Service Pack	20032	35, 4		
										Lexus (cont.)	RX400H
Lexus (cont.)	GX470	Service Pack	Feb. & Newer	20032	35, 4	Lexus (cont.)	RX400H	Service Pack	-		

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.						
2006 (cont.)					2003-2002										
Lexus (cont.)	SC430	EZ-Sensor	-	33000*	11.5, 1.3	Lexus (cont.)	SC430	Sensor	W/White I.D. Mark	28310	27, 3				
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3			Sensor	W/Blue I.D. Mark	28315	27, 3				
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7			Sensor	W/Red I.D. Mark	28320	27, 3				
		Sensor	W/White I.D. Mark; Jul. & Older	28310	27, 3			Sensor	W/Gold I.D. Mark	28325	27, 3				
		Sensor	W/Blue I.D. Mark; Jul. & Older	28315	27, 3	2014									
		Sensor	W/Red I.D. Mark; Jul. & Older	28320	27, 3	MKS, MKT, MKX, MKZ, Navigator	Sensor	-	20315	11.5, 1.3					
		Sensor	W/Gold I.D. Mark; Jul. & Older	28325	27, 3		Service Pack	-	20018	11.5, 1.3					
		Sensor	Aug. & Newer	28370	27, 3	2013-2012									
		Service Pack	Aug. & Newer	20032	27, 3	MKS, MKT, MKX, MKZ, Navigator	EZ-Sensor	-	33000*	11.5, 1.3					
2005					EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3						
GS430	EZ-Sensor	-	33000*	11.5, 1.3	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7						
		Rubber Valve	20018	11.5, 1.3	Sensor		-	20315	11.5, 1.3						
		Almnm. Valve	34000	62, 7	Service Pack	-	20018	11.5, 1.3							
		-	28335	35, 4	2011										
		-	20031	35, 4	MKS, MKT, MKX, MKZ, Navigator, Town Car	EZ-Sensor	-	33000*	11.5, 1.3						
GX470	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3						
		Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7						
EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Sensor		-	20315	11.5, 1.3							
Sensor	-	28345	35, 4	Service Pack	-	20018	11.5, 1.3	2010							
Service Pack	-	20031	35, 4	Lexus (cont.)	LX470	EZ-Sensor	-	33000*	11.5, 1.3	MKS, MKT, MKX	EZ-Sensor	-	33000*	11.5, 1.3	
EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3				EZ-Sensor Service Pack	Rubber Valve	20018		11.5, 1.3				
EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7				EZ-Sensor Service Pack	Almnm. Valve	34000		62, 7				
Sensor	-	28345	35, 4				Sensor	-	28390		27, 3				
Service Pack	-	20031	35, 4				Sensor Clip	-	22100		-				
Sensor	-	28365	35, 4				Sensor Cradle	-	22101		-				
Service Pack	-	20031	35, 4				Sensor Universal Band	-	22102		-				
SC430	Sensor	W/White I.D. Mark	28310	27, 3	Lincoln	MKZ	EZ-Sensor	-	33000*	11.5, 1.3					
		W/Blue I.D. Mark	28315	27, 3			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3					
		W/Red I.D. Mark	28320	27, 3			EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7					
		W/Gold I.D. Mark	28325	27, 3			Sensor	-	20315	11.5, 1.3					
2004							Service Pack	-	20018	11.5, 1.3	Navigator	EZ-Sensor	-	33000*	11.5, 1.3
GX470	EZ-Sensor	-	33000*	11.5, 1.3			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3					
		Rubber Valve	20018	11.5, 1.3			EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7					
		Almnm. Valve	34000	62, 7	Sensor	-	28390	27, 3							
		-	28345	35, 4	Sensor Clip	-	22100	-							
		-	20031	35, 4	Sensor Cradle	-	22101	-							
SC430	Sensor	W/White I.D. Mark	28310	27, 3	Sensor Universal Band	-	22102	-							
		W/Blue I.D. Mark	28315	27, 3	2009										
		W/Red I.D. Mark	28320	27, 3	Navigator	EZ-Sensor	-	33000*	11.5, 1.3						
		W/Gold I.D. Mark	28325	27, 3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3						
EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7							
Sensor	-	28390	27, 3	Sensor		-	28390	27, 3							
Sensor	-	22100	-	Sensor Clip	-	22100	-								
Sensor	-	22101	-	Sensor Cradle	-	22101	-								
Sensor	-	22102	-	Sensor Universal Band	-	22102	-								

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.									
2010 (cont.)					2008													
Lincoln (cont.)	Town Car	EZ-Sensor	-	33000*	11.5, 1.3	Lincoln (cont.)	Mark LT	EZ-Sensor	-	33000*	11.5, 1.3							
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3							
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7			EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7							
		Sensor	-	28385	27, 3			Sensor	-	28385	27, 3							
		Sensor Clip	-	22100	-			Sensor Clip	-	22100	-							
		Sensor Cradle	-	22101	-			Sensor Cradle	-	22101	-							
		Sensor Universal Band	-	22102	-			Sensor Universal Band	-	22102	-							
2009																		
Lincoln (cont.)	Mark LT	EZ-Sensor	-	33000*						11.5, 1.3	Lincoln (cont.)	MKS, MKX	EZ-Sensor	-	33000*	11.5, 1.3		
		EZ-Sensor Service Pack	Rubber Valve	20018						11.5, 1.3			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
		Sensor	-	20315						11.5, 1.3			EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		
Lincoln (cont.)	MKS, MKX	EZ-Sensor	-	33000*						11.5, 1.3			Sensor	W/Chrome Plated Almnm. Wheels	28385	27, 3		
		EZ-Sensor Service Pack	Rubber Valve	20018						11.5, 1.3			Sensor	W/O Chrome Plated Almnm. Wheels	28390	27, 3		
		EZ-Sensor Service Pack	Almnm. Valve	34000						62, 7			Sensor Clip	-	22100	-		
		Sensor	-	28390						27, 3			Sensor Cradle	-	22101	-		
		Sensor Clip	-	22100						-			Sensor Universal Band	-	22102	-		
		Sensor Cradle	-	22101						-			Lincoln (cont.)	MKZ	EZ-Sensor	-	33000*	11.5, 1.3
		Sensor Universal Band	-	22102						-					EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
Lincoln (cont.)	MKZ	EZ-Sensor	-	33000*						11.5, 1.3	EZ-Sensor Service Pack	Almnm. Valve			34000	62, 7		
		EZ-Sensor Service Pack	Rubber Valve	20018						11.5, 1.3	Sensor	-			28385	27, 3		
		EZ-Sensor Service Pack	Almnm. Valve	34000						62, 7	Sensor Clip	-			22100	-		
		Sensor	-	28385						27, 3	Sensor Cradle	-			22101	-		
		Sensor Clip	-	22100						-	Sensor Universal Band	-			22102	-		
		Sensor Cradle	-	22101						-	Lincoln (cont.)	Navigator	EZ-Sensor	-	33000*	11.5, 1.3		
		Sensor Universal Band	-	22102						-			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
Lincoln (cont.)	Navigator	EZ-Sensor	-	33000*						11.5, 1.3			EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		
		EZ-Sensor Service Pack	Rubber Valve	20018						11.5, 1.3			Sensor	-	28390	27, 3		
		EZ-Sensor Service Pack	Almnm. Valve	34000						62, 7			Sensor Clip	-	22100	-		
		Sensor	-	28390						27, 3			Sensor Cradle	-	22101	-		
		Sensor Clip	-	22100						-			Sensor Universal Band	-	22102	-		
		Sensor Cradle	-	22101						-	Lincoln (cont.)	Town Car	EZ-Sensor	-	33000*	11.5, 1.3		
		Sensor Universal Band	-	22102						-			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
Lincoln (cont.)	Town Car	EZ-Sensor	-	33000*						11.5, 1.3			EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		
		EZ-Sensor Service Pack	Rubber Valve	20018						11.5, 1.3			Sensor	-	28385	27, 3		
		EZ-Sensor Service Pack	Almnm. Valve	34000						62, 7			Sensor Clip	-	22100	-		
		Sensor	-	28385	27, 3	Sensor Cradle	-	22101	-									
		Sensor Clip	-	22100	-	Sensor Universal Band	-	22102	-									
		Sensor Cradle	-	22101	-													
		Sensor Universal Band	-	22102	-													

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2007					2006					
Lincoln (cont.)	Mark LT	EZ-Sensor	-	33000*	11.5, 1.3	Navigator	Sensor	-	20135**	44, 5
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	-	20002	44, 5
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Town Car	EZ-Sensor	-	33000*	11.5, 1.3
		Sensor	-	28385	27, 3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		Sensor Clip	-	22100	-		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		Sensor Cradle	-	22101	-		Sensor	-	28385	27, 3
		Sensor Universal Band	-	22102	-		Sensor Clip	-	22100	-
	Sensor Cradle	-	22101	-	Sensor Cradle	-	22101	-		
	Sensor Universal Band	-	22102	-	Sensor Universal Band	-	22102	-		
	MKX	EZ-Sensor	-	33000*	11.5, 1.3	2005				
EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	Aviator	EZ-Sensor	-	33100	11.5, 1.3	
EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
Sensor		W/Chrome Plated Almnm. Wheels	28385	27, 3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
Sensor		W/O Chrome Plated Almnm. Wheels	28390	27, 3		Sensor	-	20096**	44, 5	
Sensor Clip		-	22100	-		Service Pack	-	20002	44, 5	
Sensor Cradle		-	22101	-	Navigator	Sensor	-	20135**	44, 5	
Sensor Universal Band	-	22102	-	Service Pack		-	20002	44, 5		
MKZ	EZ-Sensor	-	33000*	11.5, 1.3	2004-2003					
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Aviator, Navigator	EZ-Sensor	-	33100	11.5, 1.3	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Sensor	-	28385	27, 3	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		
	Sensor Clip	-	22100	-	Sensor	-	20096**	44, 5		
	Sensor Cradle	-	22101	-	Service Pack	-	20002	44, 5		
	Sensor Universal Band	-	22102	-	2006					
Navigator	EZ-Sensor	-	33000*	11.5, 1.3	Coupe, Gransport, MC-12	Service Pack	Does Not Include Valve	20023	-	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	W/43mm Silver Insert	20037	-	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Service Pack	W/48mm Green Insert	20038	-		
	Sensor	-	28390	27, 3	Service Pack	W/49mm Black Insert	20039	-		
	Sensor Clip	-	22100	-	Service Pack	W/51mm Orange Insert	20040	-		
	Sensor Cradle	-	22101	-	Quattroporte	Sensor	Includes Transmitter Only	20077	35, 4	
	Sensor Universal Band	-	22102	-		Service Pack	Does Not Include Valve	20023	35, 4	
Town Car	EZ-Sensor	-	33000*	11.5, 1.3		Service Pack	W/43mm Silver Insert	20037	35, 4	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	W/48mm Green Insert	20038	35, 4	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	W/49mm Black Insert	20039	35, 4	
	Sensor	-	28385	27, 3	Service Pack	W/51mm Orange Insert	20040	35, 4		
	Sensor Clip	-	22100	-	Spyder	Service Pack	Does Not Include Valve	20023	-	
	Sensor Cradle	-	22101	-		Service Pack	W/43mm Silver Insert	20037	-	
	Sensor Universal Band	-	22102	-		Service Pack	W/48mm Green Insert	20038	-	
Service Pack	W/49mm Black Insert	20039	-							
Service Pack	W/51mm Orange Insert	20040	-	2005-2004						
Service Pack	W/43mm Silver Insert	20037	-	Coupe, Gransport	Service Pack	Does Not Include Valve	20023	-		
Service Pack	W/48mm Green Insert	20038	-		Service Pack	W/43mm Silver Insert	20037	-		
Service Pack	W/49mm Black Insert	20039	-		Service Pack	W/48mm Green Insert	20038	-		
Service Pack	W/51mm Orange Insert	20040	-		Service Pack	W/49mm Black Insert	20039	-		
Service Pack	W/51mm Orange Insert	20040	-	Service Pack	W/51mm Orange Insert	20040	-			

* Programming Tool Required ** Magnet Required to Activate Sensor

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.		
2005-2004 (cont.)											
Maserati (cont.)	Quattroporte	Sensor	Includes Transmitter Only	20077	35, 4	B2300 Pickup, B4000 Pickup (cont.)	Sensor Cradle	-	22101	-	
		Service Pack	Does Not Include Valve	20023	35, 4		Sensor Universal Band	-	22102	-	
		Service Pack	W/43mm Silver Insert	20037	35, 4		CX-7, CX-9, MX-5 Miata, RX-8	Sensor	-	20093	71, 8
		Service Pack	W/48mm Green Insert	20038	35, 4	Service Pack		-	20030	71, 8	
		Service Pack	W/49mm Black Insert	20039	35, 4	Tribute	EZ-Sensor	-	33000*	11.5, 1.3	
		Service Pack	W/51mm Orange Insert	20040	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Spyder	Service Pack	Does Not Include Valve	20023	-		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
		Service Pack	W/43mm Silver Insert	20037	-		Sensor	-	20315	11.5, 1.3	
		Service Pack	W/48mm Green Insert	20038	-		Service Pack	-	20018	11.5, 1.3	
		Service Pack	W/49mm Black Insert	20039	-	2008					
	Service Pack	W/51mm Orange Insert	20040	-	Mazda (cont.)	3, 5, 6	Sensor	-	20093	71, 8	
	2013						Service Pack	-	20030	71, 8	
	2, 3, 5, 6, CX-9	Sensor	-	20093		71, 8	B2300 Pickup, B3000 Pickup, B4000 Pickup, Tribute	EZ-Sensor	-	33000*	11.5, 1.3
		Service Pack	-	20030		71, 8		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
2012						EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	
2, 3, 5, 6, CX-9, MX-5 Miata	Sensor	-	20093	71, 8		Sensor		-	28385	27, 3	
	Service Pack	-	20030	71, 8		Sensor Clip		-	22100	-	
2011						Sensor Cradle	-	22101	-		
2, 3, 6, CX-7, CX-9, MX-5 Miata, RX-8	Sensor	-	20093	71, 8		Sensor Universal Band	-	22102	-		
	Service Pack	-	20030	71, 8		CX-7, CX-9, MX-5 Miata, RX-8	Sensor	-	20093	71, 8	
Tribute	EZ-Sensor	-	33000*	11.5, 1.3			Service Pack	-	20030	71, 8	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Tribute	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Sensor	-	20315	11.5, 1.3			EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Service Pack	-	20030	71, 8	Sensor		-	28385	27, 3		
Service Pack	-	20030	71, 8	Sensor Clip	-		22100	-			
2010					Sensor Cradle	-	22101	-			
3, 5, 6, CX-7, CX-9, MX-5 Miata, RX-8	Sensor	-	20093	71, 8	Sensor Universal Band	-	22102	-			
	Service Pack	-	20030	71, 8	2007						
Tribute	EZ-Sensor	-	33000*	11.5, 1.3	3, 5	Sensor	-	20093	71, 8		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	-	20030	71, 8		
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	B2300 Pickup, B3000 Pickup, B4000 Pickup	EZ-Sensor	-	33000*	11.5, 1.3		
	Sensor	-	20315	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
	Service Pack	-	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		
Sensor	-	28385	27, 3	Sensor		-	28385	27, 3			
Service Pack	-	22100	-	Sensor Clip		-	22100	-			
2009					Sensor Cradle	-	22101	-			
3, 5, 6	Sensor	-	20093	71, 8	Sensor Universal Band	-	22102	-			
	Service Pack	-	20030	71, 8							
B2300 Pickup, B4000 Pickup	EZ-Sensor	-	33000*	11.5, 1.3							
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3							
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7							
	Sensor	-	28385	27, 3							
	Sensor Clip	-	22100	-							

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.		
2007					2012 (cont.)						
Mazda (cont.)	CX-7, CX-9, MX-5, Miata, RX-8	Sensor	-	20093	71, 8	E550, E63, G550, GL350, GL450, GL550	EZ-Sensor	-	33200	11.5, 1.3	
		Service Pack	-	20030	71, 8		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	2006						EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
	3, 5, MX-5, Miata, RX-8	Sensor	-	20093	71, 8		Sensor	-	28214	58, 6.5	
		Service Pack	-	20030	71, 8		Service Pack	W/O Valve	20016	58, 6.5	
	Tribute	EZ-Sensor	-	33000*	11.5, 1.3		Service Pack	W/Valve	20020	58, 6.5	
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		GLK350, ML350	EZ-Sensor	-	33200	11.5, 1.3
		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		Sensor	-	28385	27, 3			EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
		Sensor Clip	-	22100	-			Sensor	-	28214	58, 6.5
Sensor Cradle		-	22101	-	Service Pack	Does Not Include Stem		20016	58, 6.5		
Sensor Universal Band		-	22102	-	Service Pack	Includes Stem Only		20020	58, 6.5		
2005-2004					ML63	EZ-Sensor		-	33200	11.5, 1.3	
3, RX-8	Sensor	-	20093	71, 8		EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	
	Service Pack	-	20030	71, 8		EZ-Sensor Service Pack		Almm. Valve	34000	62, 7	
2013						Sensor		-	28214	58, 6.5	
Mercedes-Benz	C250, C300, C350, C63, CL550, CL600, CL63, CL65, CLS550, CLS63, E350, E550, E63, G550, GL350, GL450, GL550, GL63, GLK350, ML350, ML63, R350, S350, S400, S550, S600, S63, S65, SL550, SL63, SLK250, SLK350, SLS	EZ-Sensor	-	33200		11.5, 1.3	Service Pack	W/O Valve	20016	58, 6.5	
		EZ-Sensor Service Pack	Rubber Valve	20018		11.5, 1.3	Service Pack	W/Valve	20020	58, 6.5	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		R350	EZ-Sensor	-	33200	11.5, 1.3	
	Sensor	-	28214	58, 6.5			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	W/O Valve	20016	58, 6.5			EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
	Service Pack	W/Valve	20020	58, 6.5			Sensor	-	28214	58, 6.5	
	2012						Service Pack	Does Not Include Stem	20016	58, 6.5	
	C250, C300, C350, C63, CL550, CL600, CL63, CL65, CLS550, CLS63, E350	EZ-Sensor	-	33200	11.5, 1.3		Service Pack	Includes Stem Only	20020	58, 6.5	
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		S350, S400, S550, S600, S63, S65	EZ-Sensor	-	33200	11.5, 1.3
		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
Sensor		-	28214	58, 6.5	EZ-Sensor Service Pack			Almm. Valve	34000	62, 7	
Service Pack		Does Not Include Stem	20016	58, 6.5	Sensor			-	28214	58, 6.5	
Service Pack		Includes Stem Only	20020	58, 6.5	Service Pack	W/O Valve		20016	58, 6.5		
2012					Service Pack	W/Valve		20020	58, 6.5		
C250, C300, C350, C63, CL550, CL600, CL63, CL65, CLS550, CLS63, E350		EZ-Sensor	-	33200	11.5, 1.3	SL550, SL63, SLK250, SLK350, SLS		EZ-Sensor	-	33200	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	EZ-Sensor Service Pack			Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	EZ-Sensor Service Pack			Almm. Valve	34000	62, 7	
	Sensor	-	28214	58, 6.5	Sensor			-	28214	58, 6.5	
	Service Pack	Does Not Include Stem	20016	58, 6.5	Service Pack		Does Not Include Stem	20016	58, 6.5		
	Service Pack	Includes Stem Only	20020	58, 6.5	Service Pack		Includes Stem Only	20020	58, 6.5		

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.			
2011					2011 (cont.)							
Mercedes-Benz (cont.)	C300, C350, C63, CL550, CL63, E350, E550, E63, G55, G550, GL350, GL450, GL550, GLK350, ML350, ML450, ML550, ML63, R350, S400, S550, S600, S63, S65, SLK300, SLK350, SLS	EZ-Sensor	-	33200	11.5, 1.3	SLK300, SLK350, SLS	EZ-Sensor	-	33200	11.5, 1.3		
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		
		Sensor	-	28214	58, 6.5		Sensor	-	28214	58, 6.5		
		Service Pack	Does Not Include Stem	20016	58, 6.5		Service Pack	Does Not Include Stem	20016	58, 6.5		
		Service Pack	Includes Stem Only	20020	58, 6.5		Service Pack	Includes Stem Only	20020	58, 6.5		
		C300, C350, C63, CL550, CL600, CL63, CL65	EZ-Sensor	-	33200	11.5, 1.3	E350, E550, E63, G55, G550, GL350, GL450, GL550, GLK350, ML350, ML450, ML550, ML63, R350	EZ-Sensor	-	33200	11.5, 1.3	
			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
			EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
			Sensor	-	28214	58, 6.5		Sensor	-	28214	58, 6.5	
	Service Pack		Does Not Include Stem	20016	58, 6.5	Service Pack		Does Not Include Stem	20016	58, 6.5		
	Service Pack		Includes Stem Only	20020	58, 6.5	Service Pack		Includes Stem Only	20020	58, 6.5		
	CL550, CLS63		Sensor	-	20094	53, 6	CLS550, CLS63	Sensor	-	20094	53, 6	
			Service Pack	Includes Valve	20036	53, 6		Service Pack	Includes Valve	20036	53, 6	
			E350, E550, E63	EZ-Sensor	-	33200	11.5, 1.3	S400, S550, S600, S63, S65	Sensor	-	20094	53, 6
				EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	Includes Valve	20036	53, 6
		EZ-Sensor Service Pack		Almm. Valve	34000	62, 7	SLK300, SLK350, SLK55		EZ-Sensor	-	33200	11.5, 1.3
		Sensor		-	28214	58, 6.5			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		Service Pack		Does Not Include Stem	20016	58, 6.5			EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
		Service Pack		Includes Stem Only	20020	58, 6.5			Sensor	-	28214	58, 6.5
Service Pack	Includes Stem Only	20020		58, 6.5	Service Pack	Does Not Include Stem			20016	58, 6.5		
G55, G550, GL350, GL450, GL550, GLK350, ML350, ML450, ML550, ML63, R350	EZ-Sensor	-	33200	11.5, 1.3	S400, S550, S600, S63, S65	Service Pack	Includes Stem Only	20020	58, 6.5			
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		C300, C350, C63	EZ-Sensor	-	33200	11.5, 1.3		
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
	Sensor	-	28214	58, 6.5			EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		
	Service Pack	Mar. & Newer; Does Not Include Stem	20016	58, 6.5			Sensor	-	28214	58, 6.5		
	Service Pack	Mar. & Newer; Includes Stem Only	20020	58, 6.5			Service Pack	Does Not Include Stem	20016	58, 6.5		
	S400, S550, S600, S63, S65	EZ-Sensor	-	33200	11.5, 1.3	CL550, CL600, CL63, CL65	Sensor	-	20094	53, 6		
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	Includes Valve	20036	53, 6		
		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		Mercedes-Benz (cont.)	C300, C350, C63, CL550, CL63, E350, E550, E63, G55, G550, GL350, GL450, GL550, GLK350, ML350, ML450, ML550, ML63, R350, S400, S550, S600, S63, S65, SLK300, SLK350, SLS	EZ-Sensor	-	33200	11.5, 1.3
		Sensor	-	28214	58, 6.5				EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
Service Pack		Does Not Include Stem	20016	58, 6.5	EZ-Sensor Service Pack				Almm. Valve	34000	62, 7	
Service Pack		Includes Stem Only	20020	58, 6.5	Sensor				-	28214	58, 6.5	
Service Pack		Includes Stem Only	20020	58, 6.5	Service Pack	Does Not Include Stem			20016	58, 6.5		
Service Pack	Includes Stem Only	20020	58, 6.5	Service Pack	Includes Stem Only	20020			58, 6.5			
SL63, SL65	Sensor	-	20094	53, 6	2009							
					C300, C350, C63	EZ-Sensor			-	33200	11.5, 1.3	
				EZ-Sensor Service Pack		Rubber Valve			20018	11.5, 1.3		
				EZ-Sensor Service Pack		Almm. Valve			34000	62, 7		
				Sensor		-	28214	58, 6.5				
				Service Pack		Does Not Include Stem	20016	58, 6.5				

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2009 (cont.)					2008 (cont.)					
CLK350, CLK550, CLK63	EZ-Sensor	-	33200	11.5, 1.3	CL550, CL600, CL63, CL65	Sensor	-	20094	53, 6	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	Includes Valve	20036	53, 6	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	CLK350, CLK 550, CLK63	EZ-Sensor	-	33200	11.5, 1.3	
	Sensor	-	28214	58, 6.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	Does Not Include Stem	20016	58, 6.5		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
	Service Pack	Includes Stem Only	20020	58, 6.5		Sensor	-	28214	58, 6.5	
	CLS550, CLS63, E320	Sensor	-	20094		53, 6	Service Pack	Does Not Include Stem	20016	58, 6.5
		Service Pack	Includes Valve	20036		53, 6	Service Pack	Includes Stem Only	20020	58, 6.5
		E350, E550	Sensor	W/315 MHz Sensor	20094	53, 6	CLS550, CLS63, E320	Sensor	-	20094
	Sensor		W/433 MHz Sensor	20095	53, 6	Service Pack	Includes Valve	20036	53, 6	
Service Pack	Includes Valve		20036	53, 6	E350, E550	Sensor	W/315 MHz Sensor	20094	53, 6	
E63	Sensor	-	20094	53, 6		Sensor	W/433 MHz Sensor	20095	53, 6	
	Service Pack	Includes Valve	20036	53, 6		Service Pack	Includes Valve	20036	53, 6	
G55, G550	EZ-Sensor	-	33200	11.5, 1.3	E63	Sensor	-	20094	53, 6	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	Includes Valve	20036	53, 6	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		G500, G55	EZ-Sensor	-	33200	11.5, 1.3
	Sensor	-	28214	58, 6.5	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	
	Service Pack	Does Not Include Stem	20016	58, 6.5	EZ-Sensor Service Pack		Almm. Valve	34000	62, 7	
	GL320, GL450, GL550, ML320, ML350, ML550, ML63, R320, R350	Service Pack	Includes Stem Only	20020	58, 6.5	GL320, GL450, GL550, ML320, ML350, ML550, ML63, R320, R350	Sensor	-	28214	58, 6.5
Sensor		-	20095	53, 6	Service Pack		Does Not Include Stem	20016	58, 6.5	
Service Pack		Includes Valve	20036	53, 6	Service Pack		Includes Stem Only	20020	58, 6.5	
S550, S600, S63, S65, SL550, SL600, SL63, SL65	Sensor	-	20094	53, 6	Sensor		-	20095	53, 6	
	Service Pack	Includes Valve	20036	53, 6	Service Pack		Includes Valve	20036	53, 6	
SLK300, SLK350, SLK55	EZ-Sensor	-	33200	11.5, 1.3	R550		Service Pack	Does Not Include Valve	20023	53, 6
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	W/43mm Silver Insert	20037	53, 6	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		Service Pack	W/48mm Green Insert	20038	53, 6	
	Sensor	-	28214	58, 6.5		Service Pack	W/49mm Black Insert	20039	53, 6	
	Service Pack	Does Not Include Stem	20016	58, 6.5		Service Pack	W/51mm Orange Insert	20040	53, 6	
	Service Pack	Includes Stem Only	20020	58, 6.5	S550, S600, S63, S65, SL55, SL550, SL600, SL65	Sensor	-	20094	53, 6	
	SLR McLaren	Sensor	-	20094		53, 6	Service Pack	Includes Valve	20036	53, 6
Service Pack		Includes Valve	20036	53, 6	SLK280, SLK350, SLK55	EZ-Sensor	-	33200	11.5, 1.3	
2008						EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
C300, C350, C63	EZ-Sensor	-	33200	11.5, 1.3		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	28214	58, 6.5	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		Service Pack	Does Not Include Stem	20016	58, 6.5	
	Sensor	-	28214	58, 6.5		Service Pack	Includes Stem Only	20020	58, 6.5	
	Service Pack	Does Not Include Stem	20016	58, 6.5	SLR McLaren	Sensor	-	20094	53, 6	
	Service Pack	Includes Stem Only	20020	58, 6.5		Service Pack	Includes Valve	20036	53, 6	

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2007					2007 (cont.)					
C280	Sensor	Mar. & Newer	28214	58, 6.5	SLK280, SLK350, SLK55 (cont.)	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
	Service Pack	Mar. & Newer; Does Not Include Stem	20016	58, 6.5		Sensor	May & Newer	28214	58, 6.5	
	Service Pack	Mar. & Newer; Includes Stem Only	20020	58, 6.5		Service Pack	May & Newer; Does Not Include Stem	20016	58, 6.5	
Service Pack	Jun. & Newer	28214	58, 6.5	Service Pack		May & Newer; Includes Stem Only	20020	58, 6.5		
C350	Sensor	Jun. & Newer	28214	58, 6.5	SLR McLaren	Service Pack	Does Not Include Valve	20023	53, 6	
	Service Pack	Jun. & Newer; Does Not Include Stem	20016	58, 6.5		Service Pack	W/43mm Silver Insert	20037	53, 6	
	Service Pack	Jun. & Newer; Includes Stem Only	20020	58, 6.5		Service Pack	W/48mm Green Insert	20038	53, 6	
Service Pack	-	20094	53, 6	Service Pack		W/49mm Black Insert	20039	53, 6		
Service Pack	Includes Valve	20036	53, 6	Service Pack		W/51mm Orange Insert	20040	53, 6		
CL550, CL600, CL63	Sensor	-	20094	53, 6	2006					
	Service Pack	Includes Valve	20036	53, 6	CL500, CL55, CL600, CL65	Service Pack	Does Not Include Valve	20023	35, 4	
CLK350, CLK350, CLK550, CLK63	EZ-Sensor	-	33200	11.5, 1.3		Service Pack	W/43mm Silver Insert	20037	35, 4	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	W/48mm Green Insert	20038	35, 4	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		Service Pack	W/49mm Black Insert	20039	35, 4	
	Sensor	-	28214	58, 6.5		Service Pack	W/51mm Orange Insert	20040	35, 4	
	Service Pack	Does Not Include Stem	20016	58, 6.5	CLK350, CLK500, CLK55	EZ-Sensor	-	33200	11.5, 1.3	
Service Pack	Includes Stem Only	20020	58, 6.5	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3		
Service Pack	Includes Valve	20036	53, 6	EZ-Sensor Service Pack		Almm. Valve	34000	62, 7		
CLS550, CLS63, E320	Sensor	-	20094	53, 6	E350	Sensor	-	28214	58, 6.5	
	Service Pack	Includes Valve	20036	53, 6		Service Pack	Does Not Include Stem	20016	58, 6.5	
E350, E550	Sensor	W/315 MHz Sensor	20094	53, 6		Service Pack	Includes Stem Only	20020	58, 6.5	
	Sensor	W/433 MHz Sensor	20095	53, 6		CLS500, CLS55, E320	Sensor	-	20094	53, 6
	Service Pack	Includes Valve	20036	53, 6			Service Pack	Includes Valve	20036	53, 6
E63	Sensor	-	20094	53, 6	E500, E55	Sensor	W/315 MHz Sensor	20094	53, 6	
	Service Pack	Includes Valve	20036	53, 6		Sensor	W/433 MHz Sensor	20095	53, 6	
G500, G55	EZ-Sensor	-	33200	11.5, 1.3		Service Pack	Includes Valve	20036	53, 6	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	ML350, ML500, R350, R500	Sensor	-	20094	53, 6	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		Service Pack	Includes Valve	20036	53, 6	
	Sensor	Mar. & Newer	28214	58, 6.5	S350, S430, S500, S55, S600, S65	Service Pack	Does Not Include Valve	20023	35, 4	
	Service Pack	Mar. & Newer; Does Not Include Stem	20016	58, 6.5		Service Pack	W/43mm Silver Insert	20037	35, 4	
Service Pack	Mar. & Newer; Includes Stem Only	20020	58, 6.5	Service Pack		W/48mm Green Insert	20038	35, 4		
Service Pack	Mar. & Newer; Includes Stem Only	20020	58, 6.5	Service Pack		W/49mm Black Insert	20039	35, 4		
GL320, GL450, ML320, ML350, ML500, ML63, R320, R350, R500, R63	Sensor	-	20095	53, 6	Service Pack	W/51mm Orange Insert	20040	35, 4		
	Service Pack	Includes Valve	20036	53, 6	SL500, SL55, SL600, SL65	Sensor	-	20094	53, 6	
S550, S600, S63, S65, SL55, SL550, SL600, SL65	Sensor	-	20094	53, 6		Service Pack	Includes Valve	20036	53, 6	
	Service Pack	Includes Valve	20036	53, 6	SLR McLaren	Service Pack	Does Not Include Valve	20023	35, 4	
SLK280, SLK350, SLK55	EZ-Sensor	-	33200	11.5, 1.3		Service Pack	W/43mm Silver Insert	20037	35, 4	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	W/48mm Green Insert	20038	35, 4	
						Service Pack	W/49mm Black Insert	20039	35, 4	
						Service Pack	W/51mm Orange Insert	20040	35, 4	

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2005					1999					
CL500, CL55, CL600, CL65, E320, E500, E55, S430, S500, S55, S600, SL500, SL55, SL600, SL65, SLR McLaren	Service Pack	Does Not Include Valve	20023	35, 4	Mercedes-Benz (cont.) E55	Service Pack	Does Not Include Valve; Jul. & Newer	20023	35, 4	
	Service Pack	W/43mm Silver Insert	20037	35, 4		Service Pack	W/43mm Silver Insert; Jul. & Newer	20037	35, 4	
	Service Pack	W/48mm Green Insert	20038	35, 4		Service Pack	W/48mm Green Insert; Jul. & Newer	20038	35, 4	
	Service Pack	W/49mm Black Insert	20039	35, 4		Service Pack	W/49mm Black Insert; Jul. & Newer	20039	35, 4	
	Service Pack	W/51mm Orange Insert	20040	35, 4		Service Pack	W/51mm Orange Insert; Jul. & Newer	20040	35, 4	
2004					2011					
CL500, CL55, CL600, E320, E500, E55, S430, S500, S55, S600, SL500, SL55, SL600, SLR McLaren	Service Pack	Does Not Include Valve	20023	35, 4	Grand Marquis	EZ-Sensor	-	33000*	11.5, 1.3	
	Service Pack	W/43mm Silver Insert	20037	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	W/48mm Green Insert	20038	35, 4		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Service Pack	W/49mm Black Insert	20039	35, 4		Sensor	-	20315	11.5, 1.3	
	Service Pack	W/51mm Orange Insert	20040	35, 4		Sensor Clip	-	22100	-	
2003					Mercury	Sensor Cradle	-	22101	-	
CL500, CL55, CL600, E320, E500, E55, S430, S500, S55, S600, SL500, SL55	Service Pack	Does Not Include Valve	20023	35, 4		Sensor Universal Band	-	22102	-	
	Service Pack	W/43mm Silver Insert	20037	35, 4		Mariner, Milan	EZ-Sensor	-	33000*	11.5, 1.3
	Service Pack	W/48mm Green Insert	20038	35, 4			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Service Pack	W/49mm Black Insert	20039	35, 4			EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Service Pack	W/51mm Orange Insert	20040	35, 4	Sensor		-	20315	13, 1.5	
Service Pack	W/51mm Orange Insert	20040	35, 4	Service Pack	-		20018	11.5, 1.3		
2002-2001					2010					
CL500, CL55, CL600, E320, E430, E55, S430, S500, S55, S600, SL500, SL600	Service Pack	Does Not Include Valve	20023	35, 4	Grand Marquis	EZ-Sensor	-	33000*	11.5, 1.3	
	Service Pack	W/43mm Silver Insert	20037	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	W/48mm Green Insert	20038	35, 4		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Service Pack	W/49mm Black Insert	20039	35, 4		Sensor	-	28385	27, 3	
	Service Pack	W/51mm Orange Insert	20040	35, 4		Sensor Clip	-	22100	-	
2000					Mariner, Milan	Sensor Cradle	-	22101	-	
CL500, E55, S430, S500	Service Pack	Does Not Include Valve	20023	35, 4		Sensor Universal Band	-	22102	-	
	Service Pack	W/43mm Silver Insert	20037	35, 4		Mountaineer	EZ-Sensor	-	33000*	11.5, 1.3
	Service Pack	W/48mm Green Insert	20038	35, 4			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Service Pack	W/49mm Black Insert	20039	35, 4			EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Service Pack	W/51mm Orange Insert	20040	35, 4	Sensor		-	28385	27, 3	
Service Pack	W/51mm Orange Insert	20040	35, 4	Sensor Clip	-		22100	-		
Service Pack	W/51mm Orange Insert	20040	35, 4	Sensor Cradle	-	22101	-			
Service Pack	W/51mm Orange Insert	20040	35, 4	Sensor Universal Band	-	22102	-			

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2009					2008 (cont.)					
Mercury (cont.)	Grand Marquis	EZ-Sensor	-	33000*	11.5, 1.3	Sable (cont.)	Sensor Clip	-	22100	-
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor Cradle	-	22101	-
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor Universal Band	-	22102	-
		Sensor	-	28385	27, 3	2007				
		Sensor Clip	-	22100	-	Grand Marquis, Mariner, Milan	EZ-Sensor	-	33000*	11.5, 1.3
		Sensor Cradle	-	22101	-		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		Sensor Universal Band	-	22102	-		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Mariner	EZ-Sensor	-	33000*	11.5, 1.3		Sensor	-	28385	27, 3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor Clip	-	22100	-
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor Cradle	-	22101	-
Sensor		-	20315	13, 1.5	Sensor Universal Band		-	22102	-	
Service Pack		-	20018	11.5, 1.3	Montego	EZ-Sensor	-	33000*	11.5, 1.3	
Milan, Mountaineer	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	-	28390	27, 3	
	Sensor	-	28385	27, 3		Sensor Clip	-	22100	-	
	Sensor Clip	-	22100	-		Sensor Cradle	-	22101	-	
	Sensor Cradle	-	22101	-		Sensor Universal Band	-	22102	-	
	Sensor Universal Band	-	22102	-	Mercury (cont.)	Monterey Van, Mountaineer	EZ-Sensor	-	33000*	11.5, 1.3
Sable	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	-	28385	27, 3	
	Sensor	-	28390	27, 3		Sensor Clip	-	22100	-	
	Sensor Clip	-	22100	-		Sensor Cradle	-	22101	-	
	Sensor Cradle	-	22101	-		Sensor Universal Band	-	22102	-	
	Sensor Universal Band	-	22102	-	2006					
2008					Grand Marquis, Mariner	EZ-Sensor	-	33000*	11.5, 1.3	
Grand Marquis, Mariner, Milan, Mountaineer	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	-	28385	27, 3	
	Sensor	-	28385	27, 3		Sensor Clip	-	22100	-	
	Sensor Clip	-	22100	-		Sensor Cradle	-	22101	-	
	Sensor Cradle	-	22101	-		Sensor Universal Band	-	22102	-	
	Sensor Universal Band	-	22102	-	Montego	EZ-Sensor	-	33000*	11.5, 1.3	
Sable	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	-	28390	27, 3	
	Sensor	-	28390	27, 3		Sensor Clip	-	22100	-	
	Sensor	-	28390	27, 3						

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2006 (cont.)					2013-2012					
Montego (cont.)	Sensor Cradle	-	22101	-	Cooper	Sensor	Includes Transmitter Only	28081	35, 4	
	Sensor Universal Band	-	22102	-		Service Pack	Does Not Include Valve	20023	35, 4	
Monterey Van, Mountain-eer	EZ-Sensor	-	33000*	11.5, 1.3		Service Pack	W/43mm Silver Insert	20037	35, 4	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	W/48mm Green Insert	20038	35, 4	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	W/49mm Black Insert	20039	35, 4	
	Sensor	-	28385	27, 3		Service Pack	W/51mm Orange Insert	20040	35, 4	
	Sensor Clip	-	22100	-	2011					
	Sensor Cradle	-	22101	-	Cooper	Sensor	Includes Transmitter Only	28081	35, 4	
	Sensor Universal Band	-	22102	-		Service Pack	W/43mm Silver Insert	20037	35, 4	
2005						Service Pack	W/48mm Green Insert	20038	35, 4	
Mariner	EZ-Sensor	-	33000*	11.5, 1.3		Service Pack	W/49mm Black Insert	20039	35, 4	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	W/51mm Orange Insert	20040	35, 4	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	2010					
	Sensor	Oct. 3, 2005 & Newer	28385	27, 3	Cooper	Sensor	Includes Transmitter Only	28081	35, 4	
	Sensor Clip	-	22100	-		Service Pack	Does Not Include Valve	20023	35, 4	
	Sensor Cradle	-	22101	-		Service Pack	W/43mm Silver Insert	20037	35, 4	
	Sensor Universal Band	-	22102	-		Service Pack	W/48mm Green Insert	20038	35, 4	
	Service Pack	-	20002	44, 5		Service Pack	W/49mm Black Insert	20039	35, 4	
2004					Service Pack	W/51mm Orange Insert	20040	35, 4		
Monterey Van	Sensor	-	20135**	44, 5	2009-2008					
	Service Pack	-	20002	44, 5	Cooper	Sensor	Includes Transmitter Only	20083	35, 4	
Mountain-eer	EZ-Sensor	-	33100	11.5, 1.3		Service Pack	Does Not Include Valve	20023	35, 4	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	W/43mm Silver Insert	20037	35, 4	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	W/48mm Green Insert	20038	35, 4	
	Sensor	-	20096**	44, 5		Service Pack	W/49mm Black Insert	20039	35, 4	
	Service Pack	-	20002	44, 5	Service Pack	W/51mm Orange Insert	20040	35, 4		
	2003-2002					2014				
Mountain-eer	EZ-Sensor	-	33100	11.5, 1.3	Lancer, Outlander	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Sensor	-	20096**	44, 5		Sensor	-	28096	71, 8	
	Service Pack	-	20002	44, 5		Service Pack	-	20030	71, 8	
	2013					2013				
Galant	EZ-Sensor	-	33000*	11.5, 1.3	Mitsubishi	Galant	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7			EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	W/Alloy Wheels	20034**	49, 5.5			Sensor	W/Alloy Wheels	20034**	49, 5.5
	Sensor	W/Steel Wheels	28129	45-53, 5-6			Sensor	W/Steel Wheels	28129	45-53, 5-6
	Service Pack	W/Alloy Wheels	20003	45-53, 5-6			Service Pack	W/Alloy Wheels	20003	45-53, 5-6
	Service Pack	W/Steel Wheels	20010	45-53, 5-6			Service Pack	W/Steel Wheels	20010	45-53, 5-6
	2012						Lancer, Outlander	Eclipse	EZ-Sensor	-
Lancer, Outlander	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	EZ-Sensor Service Pack	Rubber Valve			20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	EZ-Sensor Service Pack	Almnm. Valve			34000	62, 7
	Sensor	-	28096	71, 8	Sensor	-			28096	71, 8
	Service Pack	-	20030	71, 8	Service Pack	-			20030	71, 8
	2012					2012				
Eclipse	Sensor	W/Steel Wheels	28129	45-53, 5-6	Eclipse	Sensor	W/Steel Wheels	28129	45-53, 5-6	
	Service Pack	-	20003	45-53, 5-6		Service Pack	-	20003	45-53, 5-6	

* Programming Tool Required ** Magnet Required to Activate Sensor

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.		
2012 (cont.)					2010						
Mitsubishi (cont.)	Endeavor, Galant	EZ-Sensor	-	33000*	11.5, 1.3	Eclipse, Endeavor	EZ-Sensor	-	33000*	11.5, 1.3	
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
		Sensor	W/Alloy Wheels	20034**	49, 5.5		Sensor	-	20034**	45-53, 5-6	
		Sensor	W/Steel Wheels	28129	45-53, 5-6		Service Pack	-	20003	45-53, 5-6	
		Service Pack	W/Alloy Wheels	20003	45-53, 5-6		Galant	EZ-Sensor	-	33000*	11.5, 1.3
		Service Pack	W/Steel Wheels	20010	45-53, 5-6			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Lancer	EZ-Sensor	-	33000*	11.5, 1.3	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Sensor		W/Alloy Wheels	20034**	49, 5.5	
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Sensor		W/Steel Wheels	28129	45-53, 5-6	
		Sensor	W/Alloy Wheels	20398	11.5, 1.3	Service Pack		W/Alloy Wheels	20003	45-53, 5-6	
		Sensor	W/Steel Wheels	28096	71, 8	Service Pack		W/Steel Wheels	20010	45-53, 5-6	
		Service Pack	W/Alloy Wheels	20018	11.5, 1.3	Lancer, Outlander	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3	
		Service Pack	W/Steel Wheels	20030	71, 8		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Outlander	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	28096	71, 8	
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	-	20030	71, 8	
		Sensor	-	28096	71, 8		2009-2008				
		Service Pack	-	20030	71, 8		Eclipse, Endeavor	EZ-Sensor	-	33000*	11.5, 1.3
		2011						EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
Eclipse		EZ-Sensor	-	33000*	11.5, 1.3	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Sensor	-		20034**	45-53, 5-6		
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Service Pack	-		20003	45-53, 5-6		
	Sensor	-	20034**	49, 5.5	Galant	EZ-Sensor		-	33000*	11.5, 1.3	
	Service Pack	-	20003	45-53, 5-6		EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	
Endeavor, Galant	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	W/Alloy Wheels	20034**	45-53, 5-6		
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	W/Steel Wheels	28129	45-53, 5-6		
	Sensor	W/Alloy Wheels	20034**	49, 5.5		Service Pack	W/Alloy Wheels	20003	45-53, 5-6		
	Sensor	W/Steel Wheels	28129	45-53, 5-6		Service Pack	W/Steel Wheels	20010	45-53, 5-6		
	Service Pack	W/Alloy Wheels	20003	45-53, 5-6	Lancer, Outlander	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3		
	Service Pack	W/Steel Wheels	20010	45-53, 5-6		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
Lancer	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	28096	71, 8		
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	-	20030	71, 8		
	Sensor	W/Alloy Wheels	20398	11.5, 1.3		Raider	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3	
	Sensor	W/Steel Wheels	28096	71, 8			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	W/Alloy Wheels	20030	71, 8	2012 (cont.)						
	Service Pack	W/Steel Wheels	20030	71, 8	Outlander	EZ-Sensor	-	33000*	11.5, 1.3		
Outlander	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	-	28096	71, 8		
	Sensor	-	28096	71, 8		Service Pack	-	20030	71, 8		
	Sensor	W/Alloy Wheels	20398	11.5, 1.3		2010					
	Sensor	W/Steel Wheels	28096	71, 8		Eclipse, Endeavor	EZ-Sensor	-	33000*	11.5, 1.3	
	Service Pack	W/Alloy Wheels	20030	71, 8	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3		
Service Pack	W/Steel Wheels	20030	71, 8	EZ-Sensor Service Pack	Almnm. Valve		34000	62, 7			
Raider	EZ-Sensor	-	33000*	11.5, 1.3	Sensor		-	20034**	45-53, 5-6		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Service Pack		-	20003	45-53, 5-6		
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Galant		EZ-Sensor	-	33000*	11.5, 1.3	
	Sensor	-	28096	71, 8			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	-	20030	71, 8		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		
	Outlander	EZ-Sensor	-	33000*		11.5, 1.3	Sensor	W/Alloy Wheels	20034**	45-53, 5-6	
		EZ-Sensor Service Pack	Rubber Valve	20018		11.5, 1.3	Sensor	W/Steel Wheels	28129	45-53, 5-6	
EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7		Service Pack	W/Alloy Wheels	20003	45-53, 5-6		
Sensor		-	28096	71, 8		Service Pack	W/Steel Wheels	20010	45-53, 5-6		
Sensor		W/Alloy Wheels	20398	11.5, 1.3	Lancer, Outlander	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3		
Sensor		W/Steel Wheels	28096	71, 8		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
Service Pack		W/Alloy Wheels	20030	71, 8		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		
Service Pack	W/Steel Wheels	20030	71, 8	Sensor		-	28096	71, 8			
Outlander	EZ-Sensor	-	33000*	11.5, 1.3		Service Pack	-	20030	71, 8		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Raider	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Sensor	-	28096	71, 8	2012 (cont.)						
	Sensor	W/Alloy Wheels	20398	11.5, 1.3	Eclipse, Endeavor		EZ-Sensor	-	33000*	11.5, 1.3	
	Sensor	W/Steel Wheels	28096	71, 8			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	W/Alloy Wheels	20030	71, 8			EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
Service Pack	W/Steel Wheels	20030	71, 8	Sensor			-	20034**	45-53, 5-6		
Outlander	EZ-Sensor	-	33000*	11.5, 1.3		Service Pack	-	20003	45-53, 5-6		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Galant	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Sensor	-	28096	71, 8	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7		
	Sensor	W/Alloy Wheels	20398	11.5, 1.3	Sensor		W/Alloy Wheels	20034**	45-53, 5-6		
	Sensor	W/Steel Wheels	28096	71, 8	Sensor		W/Steel Wheels	28129	45-53, 5-6		
	Service Pack	W/Alloy Wheels	20030	71, 8	Service Pack		W/Alloy Wheels	20003	45-53, 5-6		
Service Pack	W/Steel Wheels	20030	71, 8	Service Pack	W/Steel Wheels		20010	45-53, 5-6			

* Programming Tool Required ** Magnet Required to Activate Sensor

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2009-2008 (cont.)					2006 (cont.)					
Raider (cont.)	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	Endeavor (cont.)	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
	Sensor	-	28154	58, 6.5		Sensor	Aug. & Older	20028**	45-53, 5-6	
	Sensor	-	28461	11.5, 1.3		Sensor	Sept. 1 & Newer	20034**	45-53, 5-6	
	Service Pack	Does Not Include Stem	20013	58, 6.5		Service Pack	-	20003	45-53, 5-6	
	Service Pack	Includes Stem Only	20020	58, 6.5		Galant	EZ-Sensor Service Pack	-	33100	11.5, 1.3
2007					EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	
Eclipse	EZ-Sensor	-	33000*	11.5, 1.3	EZ-Sensor Service Pack		Almm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Sensor		-	20028**	45-53, 5-6	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	Service Pack		-	20003	45-53, 5-6	
	Sensor	W/Alloy Wheels	20034**	45-53, 5-6	Montero	EZ-Sensor	-	33000*	11.5, 1.3	
	Sensor	W/Steel Wheels	28129	45-53, 5-6		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	W/Alloy Wheels	20003	45-53, 5-6		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
	Service Pack	W/Steel Wheels	20010	45-53, 5-6		Sensor	-	20034**	45-53, 5-6	
	Service Pack	W/Steel Wheels	20010	45-53, 5-6		Service Pack	-	20003	45-53, 5-6	
Endeavor	EZ-Sensor	W/315 MHz Sensor	33000*	11.5, 1.3	2005-2004					
	EZ-Sensor	W/433 MHz Sensor	33100	11.5, 1.3	Endeavor, Galant	EZ-Sensor	-	33100	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
	Sensor	-	20028**	45-53, 5-6	Sensor	-	20028**	45-53, 5-6		
Service Pack	-	20003	45-53, 5-6	Service Pack	-	20003	45-53, 5-6			
Galant	EZ-Sensor	-	33000*	11.5, 1.3	Montero	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
	Sensor	W/Alloy Wheels	20034**	45-53, 5-6		Sensor	-	20034**	45-53, 5-6	
	Sensor	W/Steel Wheels	28129	45-53, 5-6		Service Pack	-	20003	45-53, 5-6	
	Service Pack	W/Alloy Wheels	20003	45-53, 5-6	2003	Montero	EZ-Sensor	-	33000*	11.5, 1.3
	Service Pack	W/Steel Wheels	20010	45-53, 5-6			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Outlander	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33000*			11.5, 1.3	EZ-Sensor Service Pack	Almm. Valve	34000
EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3			Sensor	-	20034**	45-53, 5-6
EZ-Sensor Service Pack		Almm. Valve	34000	62, 7			Service Pack	-	20003	45-53, 5-6
Sensor		-	28096	71, 8	2014					
Service Pack		-	20030	71, 8	GT-R	EZ-Sensor	When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000	33000*	11.5, 1.3	
2006						Nissan	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
Eclipse	EZ-Sensor	-	33000*	11.5, 1.3			EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3			Sensor	-	28204	49, 5.5
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7			Service Pack	-	20014	71, 8
	Sensor	W/Alloy Wheels	20034**	45-53, 5-6			Pathfinder	Sensor	-	
	Sensor	W/Steel Wheels	28129	45-53, 5-6		Service Pack		-		
Service Pack	W/Alloy Wheels	20003	45-53, 5-6							
Service Pack	W/Steel Wheels	20010	45-53, 5-6							
Endeavor	EZ-Sensor	Sept. 1 & Newer	33000*	11.5, 1.3						
	EZ-Sensor	Aug. & Older	33100	11.5, 1.3						
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3						

* Programming Tool Required ** Magnet Required to Activate Sensor

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.
2014 (cont.)					2013 (cont.)				
Versa (Ikey)	Sensor	-			Juke (Ikey), Juke (non-Ikey), Leaf, Maxima	EZ-Sensor	-	33000*	11.5, 1.3
	Service Pack	-				EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
Versa (non-Ikey)	Sensor	-				EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Service Pack	-				Sensor	-		
2013							Service Pack	-	
370Z	EZ-Sensor	-	33000*	11.5, 1.3	Maxima GCC	EZ-Sensor	-	33100	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	-				Sensor	-		
	Service Pack	-	20032	50 - 60, 5.6 - 7.9		Service Pack	-		
Altima	Sensor	-			Murano	Sensor	-		
	Service Pack	-				Service Pack	-		
Armada	EZ-Sensor	-	33000*	11.5, 1.3	NV, NV-200	Sensor	-	28342	68, 7.7
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	-	20014	71, 8
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Pathfinder	Sensor	-		
	Sensor	-	28204	49, 5.5		Service Pack	-		
	Service Pack	-	20014	71, 8	Quest, Rogue	EZ-Sensor	-	33000*	11.5, 1.3
EZ-Sensor	-	33000*	11.5, 1.3	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	
EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	
EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Sensor		-			
Sensor	-			Service Pack		-			
Cube (Ikey)	Service Pack	-			Sentra, Titan	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	-	28204	49, 5.5
	Sensor	-				Service Pack	-	20014	71, 8
Cube (non-Ikey)	Service Pack	-			Versa (Ikey), Versa (non-Ikey)	Sensor	-		
	EZ-Sensor	-	33000*	11.5, 1.3		Service Pack	-		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Xterra	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
Sensor	-	28204	49, 5.5	Sensor		-	28204	49, 5.5	
Service Pack	-	20014	71, 8	Service Pack		-	20014	71, 8	
Frontier	EZ-Sensor	-	33000*	11.5, 1.3	2012				
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	370Z	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Sensor	-	28204	49, 5.5		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Service Pack	-	20014	71, 8		Sensor	-		
				Service Pack		-	20032	50 - 60, 5.6 - 7.9	
GT-R	EZ-Sensor	When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000	33000*	11.5, 1.3					
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3					
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7					
	Sensor	-	28204	49, 5.5					
	Service Pack	-	20014	71, 8					

* Programming Tool Required

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2012 (cont.)					2012 (cont.)					
Nissan (cont.)	Altima	EZ-Sensor	-	33000*	11.5, 1.3	Juke (non-IKey) (cont.)	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	28204	49, 5.5
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	-	20014	49, 5.5
		Sensor	-	28204	66, 7.5	Leaf	EZ-Sensor	-	33000*	11.5, 1.3
		Sensor	-	28204	49, 5.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		Service Pack	-	20014	71, 8		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Armada	EZ-Sensor	-	33000*	11.5, 1.3	Sensor	-			
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Service Pack	-			
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Maxima, Murano	EZ-Sensor	-	33000*	11.5, 1.3
		Sensor	-	28204	49, 5.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		Service Pack	-	20014	71, 8		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		EZ-Sensor	-	33000*	11.5, 1.3		Sensor	-	28204	49, 5.5
	Cube (IKey)	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Service Pack	-	20014	71, 8	
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	NV	Sensor	-	28342	68, 7.7
		Sensor	-				Service Pack	-	20014	71, 8
		Service Pack	-			Pathfinder	EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Sensor		-	28204	49, 5.5	
	Cube (non-IKey)	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Service Pack	-	20014	71, 8	
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Quest	EZ-Sensor	-	33000*	11.5, 1.3
		Sensor	-	28204	49, 5.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		Service Pack	-	20014	49, 5.5		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		Service Pack	-	20014	49, 5.5		Sensor	-		
Frontier		EZ-Sensor	-	33000*	11.5, 1.3	Service Pack	-			
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Rogue	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Sensor	-	28204	49, 5.5		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Service Pack	-	20014	71, 8		Sensor	-	28204	49, 5.5	
	GT-R	EZ-Sensor	When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000	33000*	11.5, 1.3	Service Pack	-	20014	71, 8	
EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	Sentra	EZ-Sensor	-	33000*	11.5, 1.3	
EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
Sensor		-	28204	49, 5.5		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
Service Pack		-	20014	71, 8		Sensor	-	28204	66, 7.5	
Juke (IKey)		EZ-Sensor	-	33000*	11.5, 1.3	Sensor	-	28204	49, 5.5	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Service Pack	-	20014	71, 8		
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Titan, Versa, Xterra	EZ-Sensor	-	33000*	11.5, 1.3	
	Sensor	-				EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	-				EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	EZ-Sensor	-	33000*	11.5, 1.3		Sensor	-	28204	49, 5.5	
Juke (non-IKey)	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Service Pack	-	20014	71, 8		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3						

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2011					2011 (cont.)					
Nissan (cont.)	370Z	EZ-Sensor	-	33000*	11.5, 1.3	Juke (non-IKey) (cont.)	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	28204	49, 5.5
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	-	20014	49, 5.5
		Sensor	-			Leaf	EZ-Sensor	-	33000*	11.5, 1.3
		Service Pack	-	20032	50 - 60, 5.6 - 7.9		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Altima	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-		
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Service Pack	-			
		Sensor	-	28204	49, 5.5	Maxima	EZ-Sensor	-	33000*	11.5, 1.3
	Service Pack	-	20014	71, 8	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	
	Armada	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Sensor	-	28204	49, 5.5	
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Service Pack	-	20014	71, 8	
		Sensor	-	28204	49, 5.5	Murano	EZ-Sensor	-	33000*	11.5, 1.3
		Service Pack	-	20014	49, 5.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Cube (IKey)	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Sensor	-	28204	49, 5.5	
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Service Pack	-	20014	49, 5.5	
		Sensor	-			NV	Sensor	-	28342	68, 7.7
		Service Pack	-				Service Pack	-	20014	71, 8
	Cube (non-IKey), Frontier	EZ-Sensor	-	33000*	11.5, 1.3	Pathfinder	EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		Sensor	-	28204	49, 5.5		Sensor	-	28204	49, 5.5
		Service Pack	-	20014	49, 5.5		Service Pack	-	20014	49, 5.5
		GT-R	EZ-Sensor	When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000	33000*	11.5, 1.3	Quest	EZ-Sensor	-	33000*
	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7
Sensor	-		28204	49, 5.5	Sensor	-				
Service Pack	-		20014	71, 8	Service Pack	-				
Juke (IKey)	EZ-Sensor		-	33000*	11.5, 1.3	Rogue	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	-			Sensor		-	28204	49, 5.5	
	Service Pack	-			Service Pack		-	20014	49, 5.5	
Juke (non-IKey)	EZ-Sensor	-	33000*	11.5, 1.3	Sentra	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Sensor	-				Sensor	-	28204	49, 5.5	
	Service Pack	-				Service Pack	-	20014	71, 8	

* Programming Tool Required

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.
2011 (cont.)					2010 (cont.)				
Titan	EZ-Sensor	-	33000*	11.5, 1.3	Frontier (cont.)	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	28204	49, 5.5
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	-	20014	49, 5.5
	Sensor	-	28204	49, 5.5	GT-R	EZ-Sensor	When installing EZ-sensor the rubber valve MUST be removed and replaced with Schrader aluminum valve kit 34000	33000*	11.5, 1.3
	Service Pack	-	20014	49, 5.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
Versa	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	28204	71, 8
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	-	20014	71, 8
	Sensor	-	28204	49, 5.5	Maxima	EZ-Sensor	-	33000*	11.5, 1.3
Service Pack	-	20014	71, 8	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	
Xterra	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	28204	68, 7.7
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	-	20014	68, 7.7
	Sensor	-	28204	49, 5.5	Murano	EZ-Sensor	-	33000*	11.5, 1.3
Service Pack	-	20014	49, 5.5	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	
2010						EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
370Z	EZ-Sensor	-	33000*	11.5, 1.3		Sensor	-	28204	35, 4
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	-	20014	49, 5.5
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Pathfinder	EZ-Sensor	-	33000*	11.5, 1.3
	Sensor	-	28210	71, 8		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Sensor	-			EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Service Pack		20032	50 - 60, 5.6 - 7.9	Sensor	-	28204	49, 5.5	
	Service Pack	-	20014	71, 8	Service Pack	-	20014	49, 5.5	
Altima	EZ-Sensor	-	33000*	11.5, 1.3	Sentra	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	-	28204	71, 8		Sensor	-	28204	68, 7.7
	Service Pack	-	20014	71, 8		Service Pack	-	20014	68, 7.7
Armada	EZ-Sensor	-	33000*	11.5, 1.3	Titan	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	-	28204	49, 5.5		Sensor	-	28204	49, 5.5
	Service Pack	-	20014	49, 5.5		Service Pack	-	20014	49, 5.5
Cube	EZ-Sensor	-	33000*	11.5, 1.3	Versa	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	-	28204	71, 8		Sensor	-	28204	71, 8
	Service Pack	-	20014	71, 8		Service Pack	-	20014	71, 8
Frontier	EZ-Sensor	-	33000*	11.5, 1.3					
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3					

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.
2010 (cont.)					2009 (cont.)				
Xterra	EZ-Sensor	-	33000*	11.5, 1.3	Rogue, Sentra	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	-	28204	49, 5.5		Sensor	-	28204	68, 7.7
	Service Pack	-	20014	49, 5.5		Service Pack	-	20014	68, 7.7
2009					Titan	EZ-Sensor	-	33000*	11.5, 1.3
350Z, 370Z, Altima	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	-	28204	49, 5.5
	Sensor	-	28204	71, 8		Service Pack	-	20014	49, 5.5
	Service Pack	-	20014	71, 8	Versa	EZ-Sensor	-	33000*	11.5, 1.3
Armada	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	-	28204	71, 8
	Sensor	-	28204	49, 5.5		Service Pack	-	20014	71, 8
	Service Pack	-	20014	49, 5.5	Xterra	EZ-Sensor	-	33000*	11.5, 1.3
Cube	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	-	28204	49, 5.5
	Sensor	-	28204	71, 8		Service Pack	-	20014	49, 5.5
	Service Pack	-	20014	71, 8	2008				
Frontier	EZ-Sensor	-	33000*	11.5, 1.3	350Z, Altima	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	-	28204	49, 5.5		Sensor	-	28204	71, 8
	Service Pack	-	20014	49, 5.5		Service Pack	-	20014	71, 8
GT-R	EZ-Sensor	-	33000*	11.5, 1.3	Armada	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	-	28204	71, 8		Sensor	SE	20161	49, 5.5
	Service Pack	-	20014	71, 8		Sensor	LE	28204	49, 5.5
Maxima, Murano	EZ-Sensor	-	33000*	11.5, 1.3	Service Pack	SE	20007	49, 5.5	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Service Pack	LE	20014	49, 5.5	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Frontier	EZ-Sensor	-	33000*	11.5, 1.3
	Sensor	-	28204	68, 7.7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Service Pack	-	20014	68, 7.7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
Path- finder, Quest	EZ-Sensor	-	33000*	11.5, 1.3		Sensor	W/Alloy Wheels	20161	49, 5.5
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	W/Steel Wheels	28204	49, 5.5
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Service Pack	W/Alloy Wheels	20007	49, 5.5	
	Sensor	-	28204	49, 5.5	Service Pack	W/Steel Wheels	20014	49, 5.5	
	Service Pack	-	20014	49, 5.5					

* Programming Tool Required

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2008 (cont.)					2007 (cont.)					
Nissan (cont.)	Maxima	EZ-Sensor	-	33000*	11.5, 1.3	Armada	EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
		Sensor	-	28204	68, 7.7		Sensor	-	20161	49, 5.5
		Service Pack	-	20014	68, 7.7		Service Pack	-	20007	49, 5.5
	Path-finder, Quest	EZ-Sensor	-	33000*	11.5, 1.3	Frontier	EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
		Sensor	-	28204	49, 5.5		Sensor	W/Steel Wheels	20069	49, 5.5
		Service Pack	-	20014	49, 5.5		Sensor	W/Alloy Wheels	20161	49, 5.5
	Rogue	EZ-Sensor	-	33000*	11.5, 1.3	Service Pack	W/Steel Wheels	20005	49, 5.5	
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Service Pack	W/Alloy Wheels	20007	49, 5.5	
		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	Maxima	EZ-Sensor	-	33000*	11.5, 1.3
		Sensor	-	28204	68, 7.7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		Service Pack	-	20014	68, 7.7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
	Sentra	EZ-Sensor	-	33000*	11.5, 1.3		Sensor	Mar. & Older	20161	49, 5.5
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	Apr. 1 & Newer	28204	68, 7.7
		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	Service Pack	Mar. & Older	20007	49, 5.5	
		Sensor	-	28204	71, 8	Service Pack	Apr. 1 & Newer	20014	68, 7.7	
		Service Pack	-	20014	71, 8	Murano	EZ-Sensor	-	33000*	11.5, 1.3
	Titan	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		Sensor	-	28204	71, 8
		Sensor	-	28204	49, 5.5		Service Pack	-	20014	71, 8
Service Pack		-	20014	49, 5.5	Pathfinder	EZ-Sensor	-	33000*	11.5, 1.3	
Versa	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		Sensor	OEM Part No. 40700JA01A	28167	49, 5.5	
	Sensor	-	28204	71, 8		Sensor	OEM Part No. 40700JA01B	28204	49, 5.5	
	Service Pack	-	20014	71, 8	Service Pack	-	20014	49, 5.5		
Xterra	EZ-Sensor	-	33000*	11.5, 1.3	Quest	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
	Sensor	-	28204	49, 5.5		Sensor	-	28204	49, 5.5	
	Service Pack	-	20014	49, 5.5		Service Pack	-	20014	49, 5.5	
2007					Nissan (cont.)	Sentra	EZ-Sensor	-	33000*	11.5, 1.3
350Z, Altima	EZ-Sensor	-	33000*	11.5, 1.3			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3			EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7			Sensor	W/Alloy Wheels	20161	78, 8.8
	Sensor	-	28204	71, 8			Sensor	W/Steel Wheels	28204	71, 8
	Service Pack	-	20014	71, 8		Service Pack	W/Alloy Wheels	20007	78, 8.8	
						Service Pack	W/Steel Wheels	20014	71, 8	

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2007 (cont.)					2006 (cont.)					
Titan	EZ-Sensor	-	33000*	11.5, 1.3	Maxima (cont.)	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	Jun. & Newer	20161	49, 5.5	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	Jun. & Newer	20007	49, 5.5	
	Sensor	Mar. & Older	20161	49, 5.5	Murano	EZ-Sensor	-	33000*	11.5, 1.3	
	Sensor	Apr. 1 & Newer	28204	49, 5.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	Mar. & Older	20007	49, 5.5		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Service Pack	Apr. 1 & Newer	20014	49, 5.5		Sensor	-	20064	66, 7.5 .	
	Versa	EZ-Sensor	-	33000*	11.5, 1.3	Service Pack	-	20007	66, 7.5 .	
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Pathfinder	EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
Sensor		OEM Part No. 40700JA01A	28167	71, 8	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	
Sensor		OEM Part No. 40700JA01B	28204	71, 8	Sensor		-	20161	49, 5.5	
Service Pack		-	20014	71, 8	Service Pack	-	20007	49, 5.5		
Xterra	EZ-Sensor	-	33000*	11.5, 1.3	Quest	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Sensor	OEM Part No. 40700JA01A	28167	49, 5.5		Sensor	W/Steel Wheels	20069	78, 8.8	
	Sensor	OEM Part No. 40700JA01B	28204	49, 5.5		Sensor	W/Alloy Wheels	20161	78, 8.8	
	Service Pack	-	20014	49, 5.5		Service Pack	W/Steel Wheels	20005	78, 8.8	
2006						2005				
350Z	EZ-Sensor	-	33000*	11.5, 1.3		Titan	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	
	Sensor	-	20064	49, 5.5	Sensor		-	20161	49, 5.5	
	Service Pack	-	20007	49, 5.5	Service Pack		-	20007	49, 5.5	
	Altima	EZ-Sensor	-	33000*	11.5, 1.3	Xterra	EZ-Sensor	-	33000*	11.5, 1.3
EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	
EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	
Sensor		Oct. 1 & Newer	28204	71, 8	Sensor		Submodel X	20069	49, 5.5	
Service Pack		Oct. 1 & Newer	20014	71, 8	Sensor		Exc. Submodel X	20161	49, 5.5	
Armada, Frontier		EZ-Sensor	-	33000*	11.5, 1.3		Service Pack	Submodel X	20005	49, 5.5
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Service Pack		Exc. Submodel X	20007	49, 5.5	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	2005					
	Sensor	W/Steel Wheels	20069	49, 5.5	350Z	EZ-Sensor	-	33000*	11.5, 1.3	
	Sensor	W/Alloy Wheels	20161	49, 5.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	W/Steel Wheels	20005	49, 5.5		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Service Pack	W/Alloy Wheels	20007	49, 5.5		Sensor	-	20064	49, 5.5	
	Service Pack	W/Alloy Wheels	20007	49, 5.5		Service Pack	-	20007	49, 5.5	
Maxima	EZ-Sensor	-	33000*	11.5, 1.3						
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3						

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.
2005 (cont.)					2004 (cont.)				
Armada, Frontier	EZ-Sensor	-	33000*	11.5, 1.3	350Z (cont.)	Sensor	-	20064	49, 5.5
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	-	20007	49, 5.5
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Frontier	EZ-Sensor	-	33000*	11.5, 1.3
	Sensor	W/Steel Wheels	20069	49, 5.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Sensor	W/Alloy Wheels	20161	49, 5.5		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Service Pack	W/Steel Wheels	20005	49, 5.5		Sensor	-	20064	36-60, 4.1-6.8
	Service Pack	W/Alloy Wheels	20007	49, 5.5		Service Pack	-	20007	36-60, 4.1-6.8
Murano	EZ-Sensor	-	33000*	11.5, 1.3	Murano	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	-	20064	66, 7.5 .		Sensor	-	20064	66, 7.5 .
	Service Pack	-	20007	66, 7.5 .		Service Pack	-	20007	66, 7.5 .
Pathfinder	EZ-Sensor	-	33000*	11.5, 1.3	Pathfinder	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	-	20161	49, 5.5		Sensor	Exc. Armada; Jul. & Older	20064	49, 5.5
Quest	EZ-Sensor	-	33000*	11.5, 1.3	Quest	Sensor	Armada	20069	49, 5.5
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	Exc. Armada; Aug. & Newer	20069	49, 5.5
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	Armada	20005	49, 5.5
	Sensor	W/Steel Wheels	20069	78, 8.8		Service Pack	Exc. Armada; Aug. & Newer	20005	49, 5.5
	Sensor	W/Alloy Wheels	20161	78, 8.8		Service Pack	Exc. Armada; Jul. & Older	20007	49, 5.5
	Service Pack	W/Steel Wheels	20005	78, 8.8		EZ-Sensor	-	33000*	11.5, 1.3
	Service Pack	W/Alloy Wheels	20007	78, 8.8		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Service Pack	W/Alloy Wheels	20007	78, 8.8		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
Titan	EZ-Sensor	-	33000*	11.5, 1.3	Titan	Sensor	-	20069	78, 8.8
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	-	20005	78, 8.8
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor	-	33000*	11.5, 1.3
	Sensor	Mar. & Older	20069	49, 5.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Sensor	Apr. 1 & Newer	20161	49, 5.5	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Service Pack	Mar. & Older	20005	49, 5.5	Sensor	-	20069	49, 5.5	
	Service Pack	Apr. 1 & Newer	20007	49, 5.5	Service Pack	-	20005	49, 5.5	
	Service Pack	Apr. 1 & Newer	20007	49, 5.5	Xterra	EZ-Sensor	-	33000*	11.5, 1.3
Xterra	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	-	20069	49, 5.5
	Sensor	-	20161	36-60, 4.1-6.8		Service Pack	-	20005	49, 5.5
	Service Pack	-	20007	36-60, 4.1-6.8	EZ-Sensor	-	33000*	11.5, 1.3	
2004					350Z	EZ-Sensor	-	33000*	11.5, 1.3
350Z	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	-	20064	36-60, 4.1-6.8
Service Pack	-	20007	36-60, 4.1-6.8	Service Pack		-	20007	36-60, 4.1-6.8	

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.		
2003					2010						
Nissan (cont.)	350Z	EZ-Sensor	-	33000*	11.5, 1.3	G3, G5, G6, G8	EZ-Sensor	-	33000*	11.5, 1.3	
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
		Sensor	-	20064	49, 5.5		Sensor	-	20153	11.5, 1.3	
		Service Pack	-	20007	49, 5.5		Service Pack	-	20008	11.5, 1.3	
	Frontier	EZ-Sensor	-	33000*	11.5, 1.3	Solstice	EZ-Sensor	-	33000*	11.5, 1.3	
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
		Sensor	-	20064	36-60, 4.1-6.8		Sensor	-	20158	62, 7	
		Service Pack	-	20007	36-60, 4.1-6.8		Service Pack	W/Schrader Sensor	20004	62, 7	
	Murano	EZ-Sensor	-	33000*	11.5, 1.3	Vibe	EZ-Sensor	-	33000*	11.5, 1.3	
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
		Sensor	-	20064	66, 7.5		Sensor	-	28360	35, 4	
		Service Pack	-	20007	66, 7.5		Service Pack	-	20032	35, 4	
	Pathfinder	EZ-Sensor	-	33000*	11.5, 1.3	2009					
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	G3, G3 Wave, G5, G6, G8	EZ-Sensor	-	33000*	11.5, 1.3	
		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
		Sensor	-	20064	49, 5.5		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	
		Service Pack	-	20007	49, 5.5		Sensor	-	20153	11.5, 1.3	
	Xterra	EZ-Sensor	-	33000*	11.5, 1.3		Pontiac	Service Pack	-	20008	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Montana, Solstice, Torrent		EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		Sensor	-	20064	36-60, 4.1-6.8			EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
Service Pack		-	20007	36-60, 4.1-6.8	Sensor			-	20158	62, 7	
2002					Vibe		Service Pack	W/Schrader Sensor	20004	62, 7	
Plymouth	Prowler	EZ-Sensor	Caution: Pressure by location vehicles not supported by EZ-sensor	33100		11.5, 1.3	Service Pack	W/Siemens Sensor	20030	80, 9	
		EZ-Sensor Service Pack	Rubber Valve	20018		11.5, 1.3	Wave	EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Almm. Valve	34000		62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		Sensor	-	20028**		35, 4		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
		Service Pack	W/Schrader Sensor	20003	35, 4	Sensor		-	28360	35, 4	
		Service Pack	W/Siemens Sensor	20030	35, 4	Service Pack		-	20032	35, 4	
2001-1999					Prowler	Sensor	-	28004	35, 4		
Prowler	Service Pack	W/Red Sensor Body	20003	35, 4		Service Pack	W/Red Sensor Body	20003	35, 4		
	Service Pack	W/Black Sensor Body	20012	35, 4		Service Pack	W/Black Sensor Body	20012	35, 4		
	1997					Prowler	Sensor	-	28004	35, 4	
Prowler	Service Pack	W/Red Sensor Body	20003	35, 4	Service Pack		W/Red Sensor Body	20003	35, 4		
	Service Pack	W/Black Sensor Body	20012	35, 4	Service Pack		W/Black Sensor Body	20012	35, 4		

* Programming Tool Required ** Magnet Required to Activate Sensor

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.
2008					2014-2012				
G5, G6	EZ-Sensor	-	33000*	11.5, 1.3	Cayenne	Sensor	Includes Transmitter Only	20103	35, 4
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	W/43mm Silver Insert	20037	35, 4
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		Service Pack	W/48mm Green Insert	20038	35, 4
	Sensor	-	20158	62, 7		Service Pack	W/49mm Black Insert	20039	35, 4
	Service Pack	W/Schrader Sensor	20004	62, 7		Service Pack	W/51mm Orange Insert	20040	35, 4
	Service Pack	W/Siemens Sensor	20030	80, 9	2011				
G8	EZ-Sensor	-	33000*	11.5, 1.3	911, Boxster	Sensor	Includes Transmitter Only	20077	35, 4
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	Does Not Include Valve	20023	35, 4
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		Service Pack	W/43mm Silver Insert	20037	35, 4
	Sensor	-	20153	62, 7		Service Pack	W/48mm Green Insert	20038	35, 4
	Service Pack	-	20008	62, 7		Service Pack	W/49mm Black Insert	20039	35, 4
	Service Pack	W/Siemens Sensor	20030	80, 9	Service Pack	W/51mm Orange Insert	20040	35, 4	
Grand Prix	EZ-Sensor	-	33000*	11.5, 1.3	Cayenne	Sensor	Includes Transmitter Only	20103	35, 4
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	W/43mm Silver Insert	20037	35, 4
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		Service Pack	W/48mm Green Insert	20038	35, 4
	Sensor	Snap-In Style Only; W/Rubber Valve Stem	20153	11.5, 1.3		Service Pack	W/49mm Black Insert	20039	35, 4
	Sensor	Clamp-In Style Only; W/Almm. Valve Stem	20158	62, 7	Service Pack	W/51mm Orange Insert	20040	35, 4	
	Service Pack	Clamp-In Style Only; W/Almm. Valve Stem	20004	62, 7	Cayman	Sensor	Includes Transmitter Only	20077	35, 4
Service Pack	Snap-In Style Only; W/Rubber Valve Stem	20008	11.5, 1.3	Service Pack		Does Not Include Valve	20023	35, 4	
Montana, Solstice, Torrent	EZ-Sensor	-	33000*	11.5, 1.3		Service Pack	W/43mm Silver Insert	20037	35, 4
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	W/48mm Green Insert	20038	35, 4
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	Service Pack	W/49mm Black Insert	20039	35, 4	
	Sensor	-	20158	62, 7	Service Pack	W/51mm Orange Insert	20040	35, 4	
	Service Pack	W/Schrader Sensor	20004	62, 7	Panamera	Sensor	Includes Transmitter Only	28087	31-40, 3.5-4.5
	Service Pack	W/Siemens Sensor	20030	80, 9		Service Pack	W/43mm Silver Insert	20037	31-40, 3.5-4.5
Vibe	EZ-Sensor	-	33000*	11.5, 1.3		Service Pack	W/48mm Green Insert	20038	31-40, 3.5-4.5
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	W/49mm Black Insert	20039	31-40, 3.5-4.5
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		Service Pack	W/51mm Orange Insert	20040	31-40, 3.5-4.5
	Sensor	-	28360	35, 4		2010			
	Service Pack	-	20032	35, 4	911, Boxster	Sensor	Includes Transmitter Only	28087	31-40, 3.5-4.5
	Service Pack	W/Schrader Sensor	20004	62, 7		Service Pack	Does Not Include Valve	20023	31-40, 3.5-4.5
Service Pack	W/Siemens Sensor	20030	80, 9	Service Pack		W/43mm Silver Insert	20037	31-40, 3.5-4.5	
Wave	EZ-Sensor	-	33000*	11.5, 1.3		Service Pack	W/48mm Green Insert	20038	31-40, 3.5-4.5
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	W/49mm Black Insert	20039	31-40, 3.5-4.5
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	Service Pack	W/51mm Orange Insert	20040	31-40, 3.5-4.5	
	Sensor	-	20153	11.5, 1.3	Cayenne	Service Pack	Does Not Include Valve	20023	31-40, 3.5-4.5
	Service Pack	-	20008	11.5, 1.3		Service Pack	W/43mm Silver Insert	20037	31-40, 3.5-4.5
	2007					Service Pack	W/48mm Green Insert	20038	31-40, 3.5-4.5
Grand Prix, Torrent	EZ-Sensor	-	33000*	11.5, 1.3		Service Pack	W/49mm Black Insert	20039	31-40, 3.5-4.5
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	W/51mm Orange Insert	20040	31-40, 3.5-4.5
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7					
	Sensor	-	20158	62, 7					
	Service Pack	W/Schrader Sensor	20004	62, 7					
	Service Pack	W/Siemens Sensor	20030	80, 9					

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2010 (cont.)					2006					
Cayman, Panamera	Sensor	Includes Transmitter Only	28087	31-40, 3.5-4.5	911, Boxster, Carrera GT, Cayenne, Cayman	Service Pack	Does Not Include Valve	20023	31-40, 3.5-4.5	
	Service Pack	Does Not Include Valve	20023	31-40, 3.5-4.5		Service Pack	W/43mm Silver Insert	20037	31-40, 3.5-4.5	
	Service Pack	W/43mm Silver Insert	20037	31-40, 3.5-4.5		Service Pack	W/48mm Green Insert	20038	31-40, 3.5-4.5	
	Service Pack	W/48mm Green Insert	20038	31-40, 3.5-4.5		Service Pack	W/49mm Black Insert	20039	31-40, 3.5-4.5	
	Service Pack	W/49mm Black Insert	20039	31-40, 3.5-4.5		Service Pack	W/51mm Orange Insert	20040	31-40, 3.5-4.5	
	Service Pack	W/51mm Orange Insert	20040	31-40, 3.5-4.5		2005				
2009					911, Boxster, Carrera GT, Cayenne	Service Pack	Does Not Include Valve	20023	31-40, 3.5-4.5	
911, Boxster, Cayenne	Service Pack	Does Not Include Valve	20023	31-40, 3.5-4.5		Service Pack	W/43mm Silver Insert	20037	31-40, 3.5-4.5	
	Service Pack	W/43mm Silver Insert	20037	31-40, 3.5-4.5		Service Pack	W/48mm Green Insert	20038	31-40, 3.5-4.5	
	Service Pack	W/48mm Green Insert	20038	31-40, 3.5-4.5		Service Pack	W/49mm Black Insert	20039	31-40, 3.5-4.5	
	Service Pack	W/49mm Black Insert	20039	31-40, 3.5-4.5		Service Pack	W/51mm Orange Insert	20040	31-40, 3.5-4.5	
	Service Pack	W/51mm Orange Insert	20040	31-40, 3.5-4.5		2004				
Cayman	Sensor	Includes Transmitter Only	28087	31-40, 3.5-4.5	Carrera GT, Cayenne	Service Pack	Does Not Include Valve	20023	31-40, 3.5-4.5	
	Service Pack	Does Not Include Valve	20023	31-40, 3.5-4.5		Service Pack	W/43mm Silver Insert	20037	31-40, 3.5-4.5	
	Service Pack	W/43mm Silver Insert	20037	31-40, 3.5-4.5		Service Pack	W/48mm Green Insert	20038	31-40, 3.5-4.5	
	Service Pack	W/48mm Green Insert	20038	31-40, 3.5-4.5		Service Pack	W/49mm Black Insert	20039	31-40, 3.5-4.5	
	Service Pack	W/49mm Black Insert	20039	31-40, 3.5-4.5		Service Pack	W/51mm Orange Insert	20040	31-40, 3.5-4.5	
	Service Pack	W/51mm Orange Insert	20040	31-40, 3.5-4.5	2003					
2008					Cayenne	Service Pack	Does Not Include Valve	20023	31-40, 3.5-4.5	
911, Boxster, Cayenne, Cayman	Service Pack	Does Not Include Valve	20023	31-40, 3.5-4.5		Service Pack	W/43mm Silver Insert	20037	31-40, 3.5-4.5	
	Service Pack	W/43mm Silver Insert	20037	31-40, 3.5-4.5		Service Pack	W/48mm Green Insert	20038	31-40, 3.5-4.5	
	Service Pack	W/48mm Green Insert	20038	31-40, 3.5-4.5		Service Pack	W/49mm Black Insert	20039	31-40, 3.5-4.5	
	Service Pack	W/49mm Black Insert	20039	31-40, 3.5-4.5		Service Pack	W/51mm Orange Insert	20040	31-40, 3.5-4.5	
	Service Pack	W/51mm Orange Insert	20040	31-40, 3.5-4.5	2010-2007					
2007					Phantom	Service Pack	Does Not Include Valve	20023	31-40, 3.5-4.5	
911, Boxster, Cayman	Service Pack	Does Not Include Valve	20023	31-40, 3.5-4.5		Service Pack	W/43mm Silver Insert	20037	31-40, 3.5-4.5	
	Service Pack	W/43mm Silver Insert	20037	31-40, 3.5-4.5		Service Pack	W/48mm Green Insert	20038	31-40, 3.5-4.5	
	Service Pack	W/48mm Green Insert	20038	31-40, 3.5-4.5		Service Pack	W/49mm Black Insert	20039	31-40, 3.5-4.5	
	Service Pack	W/49mm Black Insert	20039	31-40, 3.5-4.5		Service Pack	W/51mm Orange Insert	20040	31-40, 3.5-4.5	
	Service Pack	W/51mm Orange Insert	20040	31-40, 3.5-4.5	2012-2011					
2007					Saab	9-3, 9-5	Sensor	-	20159	88, 10 .
911, Boxster, Cayman	Service Pack	Does Not Include Valve	20023	31-40, 3.5-4.5		Service Pack	-	-	20009	88, 10 .
	Service Pack	W/43mm Silver Insert	20037	31-40, 3.5-4.5		9-4X	EZ-Sensor	-	33000*	11.5, 1.3
	Service Pack	W/48mm Green Insert	20038	31-40, 3.5-4.5		Sensor	-	-	28206	11.5, 1.3
	Service Pack	W/49mm Black Insert	20039	31-40, 3.5-4.5		Service Pack	-	-	20008	11.5, 1.3
	Service Pack	W/51mm Orange Insert	20040	31-40, 3.5-4.5						

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
Saab (cont.)					2010					
9-3, 9-5	Sensor	-	20159	88, 10 .	Aura	EZ-Sensor	-	33000*	11.5, 1.3	
	Service Pack	-	20009	88, 10 .		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
2009-2008						EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
9-3, 9-5	Sensor	-	20159	88, 10 .		Sensor	-	20153	11.5, 1.3	
	Service Pack	-	20009	88, 10 .		Service Pack	-	20008	11.5, 1.3	
9-7X	Sensor	-	20116	62, 7		Lambda	EZ-Sensor	-	33000*	11.5, 1.3
	Service Pack	-	20004	62, 7			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
2007-2005							EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
9-3, 9-5	Sensor	-	28078	62, 7			Sensor	-	20158	62, 7
	Service Pack	-	20009	62, 7		Service Pack	-	20004	62, 7	
9-7X	Sensor	-	20116	62, 7	Outlook	EZ-Sensor	-	33000*	11.5, 1.3	
	Service Pack	-	20004	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
2004-2003						EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
9-3, 9-5	Sensor	-	28078	62, 7		Sensor	-	20153	11.5, 1.3	
	Service Pack	-	20009	62, 7	Service Pack	-	20008	11.5, 1.3		
2010					Sky	EZ-Sensor	-	33000*	11.5, 1.3	
Astra	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	-	28206	11.5, 1.3	
	Sensor	-	28206	11.5, 1.3		Service Pack	-	20008	11.5, 1.3	
	Service Pack	-	20008	11.5, 1.3		VUE	EZ-Sensor	-	33000*	11.5, 1.3
Aura, Outlook	EZ-Sensor	-	33000*	11.5, 1.3			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3			EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Sensor			-	20153	11.5, 1.3	
Sensor	-	20153	11.5, 1.3	Service Pack			-	20008	11.5, 1.3	
Service Pack	-	20008	11.5, 1.3	Saturn (cont.)	VUE	Service Pack	-	20008	11.5, 1.3	
Sky	EZ-Sensor	-	33000*			11.5, 1.3	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018			11.5, 1.3	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000			62, 7	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	-	20158			62, 7	Sensor	-	20153	11.5, 1.3
	Service Pack	W/Schrader Sensor	20004		62, 7	Service Pack	-	20008	11.5, 1.3	
Service Pack	W/Siemens Sensor	20030	80, 9		2008					
VUE	EZ-Sensor	-	33000*		11.5, 1.3	Astra	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018		11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000		62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	-	20153	11.5, 1.3	Sensor		-	28078	80, 9	
	Service Pack	-	20008	11.5, 1.3	Service Pack		-	20009	80, 9	
2009					Aura	EZ-Sensor	-	33000*	11.5, 1.3	
Astra	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	-	20153	11.5, 1.3	
	Sensor	-	28078	80, 9		Service Pack	-	20008	11.5, 1.3	
	Service Pack	-	20009	80, 9	Lambda	EZ-Sensor	-	33000*	11.5, 1.3	
2010						EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
Astra	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	20158	62, 7	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	-	20004	62, 7	
	Sensor	-	28078	80, 9	2009					
	Service Pack	-	20009	80, 9						

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.				
2008 (cont.)					2010-2008								
Saturn (cont.)	Outlook	EZ-Sensor	-	33000*	11.5, 1.3	Saturn (cont.)	tC, xB, xD	EZ-Sensor	-	33000*	11.5, 1.3		
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7			EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		
		Sensor	-	20158	62, 7			Sensor	-	28365	35, 4		
		Service Pack	W/Schrader Sensor	20004	62, 7			Service Pack	-	20032	35, 4		
		Service Pack	W/Siemens Sensor	20030	62, 7			2007					
Saturn (cont.)	Sky	EZ-Sensor	-	33000*	11.5, 1.3	Saturn (cont.)	tC, xB	EZ-Sensor	-	33000*	11.5, 1.3		
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7			EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		
		Sensor	-	20158	62, 7			Sensor	-	28365	35, 4		
		Service Pack	W/Schrader Sensor	20004	62, 7			Service Pack	-	20032	35, 4		
		Service Pack	W/Siemens Sensor	20030	80, 9			2006					
Saturn (cont.)	VUE	EZ-Sensor	-	33000*	11.5, 1.3	Saturn (cont.)	tC	EZ-Sensor	-	33000*	11.5, 1.3		
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7			EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		
		Sensor	-	20153	11.5, 1.3			Sensor	May & Newer	28365	35, 4		
		Service Pack	-	20008	11.5, 1.3			Service Pack	May & Newer	20032	35, 4		
2007					2004								
Saturn (cont.)	Aura, Outlook	EZ-Sensor	-	33000*	11.5, 1.3	Saturn (cont.)	Fortwo	Sensor	-				
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3			Service Pack	W/Valve				
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7			Service Pack	W/O Valve				
		Sensor	-	20158	62, 7			2013					
		Service Pack	W/Schrader Sensor	20004	62, 7			Saturn (cont.)	Fortwo	EZ-Sensor	-	33200	11.5, 1.3
		Service Pack	W/Siemens Sensor	20030	62, 7					EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
Saturn (cont.)	VUE	EZ-Sensor	-	33000*	11.5, 1.3	EZ-Sensor Service Pack	Almnm. Valve			34000	62, 7		
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Sensor	-			28214	58, 6.5		
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Service Pack	W/O Valve			20016	58, 6.5		
		Sensor	-	20153	11.5, 1.3	Service Pack	W/Valve	20020	58, 6.5				
Service Pack	-	20008	11.5, 1.3	2012-2008									
2014					Saturn (cont.)	Fortwo	EZ-Sensor	-	33200	11.5, 1.3			
Scion	tC	Sensor	-	28365			35, 4	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
		Service Pack	-	20032			35, 4	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		
2013							Saturn (cont.)	Fortwo	Sensor	-	28214	53, 6	
Scion	FR-S	EZ-Sensor	-	33000*					11.5, 1.3	Service Pack	Does Not Include Stem	20016	53, 6
		EZ-Sensor Service Pack	Rubber Valve	20018					11.5, 1.3	Service Pack	Includes Stem Only	20020	53, 6
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	2014							
		Sensor	-	28360	35, 4	Subaru			BRZ	EZ-Sensor	-	33000*	11.5, 1.3
Service Pack	-	20032	35, 4	EZ-Sensor Service Pack	Rubber Valve		20018	11.5, 1.3					
Scion	iQ, tC, xB, xD	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve		34000	62, 7		
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-		28360	35, 4		
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	-		20032	35, 4		
		Sensor	-	28365	35, 4	Subaru	Forester	Sensor	-	28203	11.5, 1.3		
Service Pack	-	20032	35, 4	Service Pack	-			20008	11.5, 1.3				

* Programming Tool Required

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.					
2014 (cont.)					2011 (cont.)									
Legacy, Outback	EZ-Sensor	-	33000*	11.5, 1.3	Forester, Impreza, Legacy, Outback	EZ-Sensor	-	33000*	11.5, 1.3					
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3					
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7					
	Sensor	-	28203	11.5, 1.3		Sensor	-	28203	11.5, 1.3					
	Service Pack	-	20008	11.5, 1.3		Service Pack	-	20008	11.5, 1.3					
Tribeca	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Tribeca	EZ-Sensor	-	33000*	11.5, 1.3					
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3					
	Sensor	-	28203	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7					
	Service Pack	-	20008	11.5, 1.3		Sensor	W/Metal Stem Clamp-in Sensor	20081	66, 7.5 .					
2013														
BRZ	EZ-Sensor	-	33000*	11.5, 1.3						Sensor	W/Rubber Stem Snap-in Sensor	28203	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3						Service Pack	Rubber Valve	20008	11.5, 1.3	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7						2010				
	Sensor	-	28360	35, 4	B9 Tribeca	EZ-Sensor	-	33000*	11.5, 1.3					
	Service Pack	-	20032	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3					
Forester, Impreza, Legacy, Outback	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7					
EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Sensor		-	20081	66, 7.5 .						
Tribeca	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Service Pack	-	20011	66, 7.5 .						
	Sensor	-	28203	11.5, 1.3	Forester, Impreza, Legacy, Outback	EZ-Sensor	-	33000*	11.5, 1.3					
	Service Pack	-	20008	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3					
	Tribeca	EZ-Sensor Service Pack	Rubber Valve	20018		11.5, 1.3	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7				
EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7		Sensor	-	28203	11.5, 1.3					
Sensor		-	28203	11.5, 1.3	Service Pack	-	20008	11.5, 1.3						
Service Pack		-	20008	11.5, 1.3	Tribeca	EZ-Sensor	-	33000*	11.5, 1.3					
XV Crosstrek	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3					
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7					
	Sensor	-	28203	11.5, 1.3		Sensor	W/Metal Stem Clamp-in Sensor	20081	66, 7.5 .					
	Service Pack	Rubber Valve	20008	11.5, 1.3	Sensor	W/Rubber Stem Snap-in Sensor	28203	11.5, 1.3						
2012														
Forester, Impreza, Legacy, Outback, Tribeca	EZ-Sensor	-	33000*	11.5, 1.3						Service Pack	-	20008	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3						2009				
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7						B9 Tribeca	EZ-Sensor	-	33000*	11.5, 1.3
	Sensor	-	28203	11.5, 1.3	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3						
	Service Pack	-	20008	11.5, 1.3	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7						
2011					Sensor	-	20081	66, 7.5 .						
B9 Tribeca	EZ-Sensor	-	33000*	11.5, 1.3	Service Pack	-	20011	66, 7.5 .						
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Forester, Impreza, Legacy, Outback	EZ-Sensor	-	33000*	11.5, 1.3					
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3					
	Sensor	-	20081	66, 7.5 .		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7					
	Service Pack	-	20011	66, 7.5 .		Sensor	-	28203	11.5, 1.3					

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.
2009 (cont.)					2007-2006				
Tribeca	EZ-Sensor	-	33000*	11.5, 1.3	B9 Tribeca, Legacy, Outback	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
	Sensor	W/Metal Stem Clamp-in Sensor	20081	66, 7.5 .		Sensor	-	20081	66, 7.5 .
	Sensor	W/Rubber Stem Snap-in Sensor	28203	11.5, 1.3		Service Pack	-	20011	66, 7.5 .
	Service Pack	Rubber Valve	20008	11.5, 1.3	2005-2004				
	Service Pack	W/Metal Stem Clamp-in Sensor	20011	66, 7.5 .	Legacy, Outback	EZ-Sensor	-	33000*	11.5, 1.3
2008						EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
B9 Tribeca	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	20081	66, 7.5 .
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	Service Pack	-	20011	66, 7.5 .	
	Sensor	-	20081	66, 7.5 .	2013				
	Service Pack	-	20011	66, 7.5 .	Equator	EZ-Sensor	-	33000*	11.5, 1.3
Forester, Impreza	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		Sensor	-	28204	49, 5.5
Legacy	Sensor	-	28203	11.5, 1.3	Service Pack	-	20014	49, 5.5	
	Service Pack	-	20008	11.5, 1.3	Grand Vitara, SX4	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7		Sensor	-	20087	80, 9
	Sensor	W/16" Or 17" Wheels	20081	66, 7.5 .	Service Pack	-	20009	80, 9	
	Sensor	W/18" Wheels	28203	11.5, 1.3	2012				
Service Pack	W/18" Wheels	20008	11.5, 1.3	Equator	EZ-Sensor	-	33000*	11.5, 1.3	
Service Pack	W/16" Or 17" Wheels	20011	66, 7.5 .		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
Outback	EZ-Sensor	-	33000*		11.5, 1.3	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Rubber Valve	20018		11.5, 1.3	Sensor	-	28204	49, 5.5
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	Service Pack	-	20014	49, 5.5	
Sensor	-	28203	11.5, 1.3	Grand Vitara	EZ-Sensor	-	33000*	11.5, 1.3	
Service Pack	-	20008	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
Tribeca	EZ-Sensor	-	33000*		11.5, 1.3	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Rubber Valve	20018		11.5, 1.3	Sensor	-	20087	80, 9
	EZ-Sensor Service Pack	Almm. Valve	34000	62, 7	Service Pack	-	20009	80, 9	
	Sensor	W/Metal Stem Clamp-in Sensor	20081	66, 7.5 .	Kizashi	EZ-Sensor	-	33000*	11.5, 1.3
	Sensor	W/Rubber Stem Snap-in Sensor	28203	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Service Pack	W/Rubber Stem Snap-in Sensor	20008	11.5, 1.3		EZ-Sensor Service Pack	Almm. Valve	34000	62, 7
	Service Pack	W/Metal Stem Clamp-in Sensor	20011	66, 7.5 .		Sensor	-	20066	58, 6.5
					Sensor	-	28308	11.5, 1.3	
					Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5	
					Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5	
					Service Pack	W/Siemens Sensor	20030	71, 8	

* Programming Tool Required

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.
2012 (cont.)					2009 (cont.)				
SX4	EZ-Sensor	-	33000*	11.5, 1.3	Grand Vitara, SX4	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	-	20087	80, 9		Sensor	-	20087	80, 9
	Service Pack	-	20009	80, 9		Service Pack	-	20009	80, 9
2011-2010						XL-7	EZ-Sensor	-	33000*
Equator	EZ-Sensor	-	33000*	11.5, 1.3	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Sensor		-	20158	62, 7
	Sensor	-	28204	49, 5.5	Service Pack		W/Schrader Sensor	20004	62, 7
	Service Pack	-	20014	49, 5.5	Service Pack		W/Siemens Sensor	20030	62, 7
Grand Vitara	EZ-Sensor	-	33000*	11.5, 1.3	2008-2007				
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Forenza	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Sensor	-	20087	80, 9		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Service Pack	-	20009	80, 9		Sensor	-	20153	11.5, 1.3
Service Pack	-	20009	80, 9	Service Pack		-	20008	11.5, 1.3	
Kizashi	EZ-Sensor	-	33000*	11.5, 1.3	Grand Vitara	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	-	20066	58, 6.5		Sensor	-	20087	80, 9
	Sensor	-	28308	11.5, 1.3		Service Pack	-	20009	80, 9
	Service Pack	W/Schrader Sensor; Does Not Include Stem	20013	58, 6.5	Reno	EZ-Sensor	-	33000*	11.5, 1.3
	Service Pack	W/Schrader Sensor; Includes Stem Only	20020	58, 6.5		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Service Pack	W/Siemens Sensor	20030	71, 8		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Service Pack	W/Siemens Sensor	20030	71, 8		Sensor	-	20153	11.5, 1.3
SX4	EZ-Sensor	-	33000*	11.5, 1.3	Service Pack	-	20008	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	SX4	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Sensor	-	20087	80, 9		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Service Pack	-	20009	80, 9		Sensor	-	20087	80, 9
XL-7	EZ-Sensor	-	33000*	11.5, 1.3	Service Pack	-	20009	80, 9	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	XL-7	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Sensor	-	20158	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Service Pack	W/Schrader Sensor	20004	62, 7		Sensor	-	20158	62, 7
	Service Pack	W/Siemens Sensor	20030	62, 7		Service Pack	W/Schrader Sensor	20004	62, 7
Service Pack	W/Siemens Sensor	20030	62, 7	Service Pack		W/Siemens Sensor	20030	62, 7	
2009									
Equator	EZ-Sensor	-	33000*	11.5, 1.3					
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3					
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7					
	Sensor	-	28204	49, 5.5					
	Service Pack	-	20014	49, 5.5					

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.		
2006-2005					2013 (cont.)						
Suzuki (cont.)	Verona	EZ-Sensor	-	33000*	11.5, 1.3	Toyota (cont.)	Matrix	EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7			EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		Sensor	-	20082	80, 9			Sensor	Models made in USA.; OEM Part No. 4260706011	28360	35, 4
		Service Pack	-	20009	80, 9			Sensor	Models made in Japan.; OEM Part No. 4260733011	28365	35, 4
	XL-7	EZ-Sensor	-	33000*	11.5, 1.3		Service Pack	-	20032	35, 4	
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Prius	EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		Sensor	-	20087	80, 9			EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		Service Pack	-	20009	80, 9			Sensor	-	28365	35, 4
					Service Pack			-	20032	35, 4	
	2013										
Toyota	4 Runner	EZ-Sensor	-	33000*	11.5, 1.3	Toyota (cont.)	RAV4	EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7			EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		Sensor	-	28370	35, 4			Sensor	-	28370	35, 4
		Service Pack	-	20032	35, 4			Service Pack	-	20032	35, 4
	Avalon, Camry	EZ-Sensor	-	33000*	11.5, 1.3		Sequoia, Sienna	EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7			EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		Sensor	-	28360	35, 4			Sensor	-	28670	35, 4
		Service Pack	-	20032	35, 4			Service Pack	-	20022	35, 4
	Corolla	EZ-Sensor	-	33000*	11.5, 1.3		Tacoma	EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	
		Sensor	Models made in USA.; W/16" Or 17" Wheels	28360	35, 4	Sensor		W/Alloy Wheels; W/20 Deg. Angled Valve Sensor	28360	35, 4	
		Service Pack	-	20032	35, 4	Sensor		W/Steel Wheels; W/40 Deg. Angled Valve Sensor	28380	35, 4	
	FJ Cruiser	EZ-Sensor	-	33000*	11.5, 1.3	Service Pack	-	20032	35, 4		
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Tundra	Sensor	W/Alloy Wheels; W/TRW sensor	28670	35, 4	
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	-	20022	35, 4	
		Sensor	-	28365	35, 4	Venza, Yaris	EZ-Sensor	-	33000*	11.5, 1.3	
		Service Pack	-	20032	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	High-lander	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	28360	35, 4	
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	-	20032	35, 4	
		Sensor	-	28360	35, 4	Land Cruiser	EZ-Sensor	-	33000*	11.5, 1.3	
		Service Pack	-	20032	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Land Cruiser	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	28365	35, 4	
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	-	20032	35, 4	
Sensor		-	28365	35, 4							
Service Pack		-	20032	35, 4							

* Programming Tool Required

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2012					2012 (cont.)					
Toyota (cont.)	4 Runner	EZ-Sensor	-	33000*	11.5, 1.3	Matrix (cont.)	Sensor	Models made in Japan.; OEM Part No. 4260733011	28365	35, 4
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	-	20032	35, 4
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Prius	EZ-Sensor	-	33000*	11.5, 1.3
		Sensor	-	28370	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		Service Pack	-	20032	35, 4		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Avalon, Camry	EZ-Sensor	-	33000*	11.5, 1.3	Sensor	-	28365	35, 4	
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Service Pack	-	20032	35, 4	
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Prius C	EZ-Sensor	-	33000*	11.5, 1.3
		Sensor	-	28360	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Service Pack	-	20032	35, 4	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	
	Corolla	EZ-Sensor	-	33000*	11.5, 1.3	Sensor	-			
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Service Pack	-			
EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	Prius V	EZ-Sensor	-	33000*	11.5, 1.3	
Sensor		Models made in USA.; W/16" Or 17" Wheels	28360	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
Sensor		Models made in Japan.; OEM Part No. 4260733011	28365	35, 4		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
FJ Cruiser		Sensor	Models made in USA.; W/15" Wheels	28365	35, 4	Sensor	-	28365	35, 4	
	Sensor	Models made in Japan.; OEM Part No. 4260733021	28370	35, 4	Service Pack	-	20032	35, 4		
	Service Pack	-	20032	35, 4	RAV4	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Highlander	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Sensor	-	28370	35, 4	
Sensor		-	28365	35, 4	Service Pack	-	20032	35, 4		
Service Pack		-	20032	35, 4	RAV4 E	EZ-Sensor	-	33000*	11.5, 1.3	
EZ-Sensor		-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
Land Cruiser	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Sensor	-	28360	35, 4		
	Sensor	-	28360	35, 4	Service Pack	-	20032	35, 4		
	Service Pack	-	20032	35, 4	Sequoia, Sienna	EZ-Sensor	-	33000*	11.5, 1.3	
	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Matrix	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Sensor	-	28670	35, 4	
Sensor		Models made in USA.; OEM Part No. 4260706011	28360	35, 4	Service Pack	-	20022	35, 4		
EZ-Sensor		-	33000*	11.5, 1.3	Tacoma	EZ-Sensor	-	33000*	11.5, 1.3	
EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7		
	Sensor	Models made in USA.; OEM Part No. 4260706011	28360	35, 4	Sensor	W/Alloy Wheels; W/20 Deg. Angled Valve Sensor	28360	35, 4		
					Sensor	W/Steel Wheels; W/40 Deg. Angled Valve Sensor	28380	35, 4		
					Service Pack	-	20032	35, 4		

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.		
2012 (cont.)					2011 (cont.)						
Toyota (cont.)	Tundra	EZ-Sensor	-	33000*	11.5, 1.3	Toyota (cont.)	Corolla	EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7			EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		Sensor	-	28670	35, 4			Sensor	Models made in USA.; W/16" Or 17" Wheels	28360	35, 4
		Service Pack	-	20022	35, 4			Sensor	Models made in Japan.; OEM Part No. 4260733011	28365	35, 4
	Venza	EZ-Sensor	-	33000*	11.5, 1.3			Sensor	Models made in USA.; W/15" Wheels	28365	35, 4
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3			Sensor	Models made in Japan.; OEM Part No. 4260733021	28370	35, 4
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7			Service Pack	-	20032	35, 4
		Sensor	-	28360	35, 4			FJ Cruiser	EZ-Sensor	-	33000*
		Service Pack	-	20032	35, 4		EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3
	Yaris	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor		-	28365	35, 4
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack		-	20032	35, 4
		Sensor	-	28365	35, 4		High-lander, High-lander Hybrid	EZ-Sensor	-	33000*	11.5, 1.3
		Service Pack	-	20032	35, 4			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
2011					EZ-Sensor Service Pack	Almnm. Valve		34000	62, 7		
4 Runner	EZ-Sensor	-	33000*	11.5, 1.3	Sensor	-		28360	35, 4		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Service Pack	-		20032	35, 4		
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Land Cruiser	EZ-Sensor	-	33000*	11.5, 1.3		
	Sensor	-	28370	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
	Service Pack	-	20032	35, 4		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		
Avalon	EZ-Sensor	-	33000*	11.5, 1.3		Sensor	-	28365	35, 4		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	-	20032	35, 4		
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Matrix	EZ-Sensor	-	33000*	11.5, 1.3		
	Sensor	-	28360	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
	Service Pack	-	20032	35, 4		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		
Camry	EZ-Sensor	-	33000*	11.5, 1.3		Sensor	Models made in USA.; OEM Part No. 4260706011	28360	35, 4		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	Models made in Japan.; OEM Part No. 4260733011	28365	35, 4		
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Service Pack	-	20032	35, 4			
	Sensor	Models made in USA.; OEM Part No. 4260706011	28360	35, 4	Prius	EZ-Sensor	-	33000*	11.5, 1.3		
	Sensor	Models made in Japan.; OEM Part No. 4260733011	28365	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
Service Pack	-	20032	35, 4	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7			
Camry Hybrid	EZ-Sensor	-	33000*	11.5, 1.3		Sensor	Models made in USA.; OEM Part No. 4260706011	28360	35, 4		
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	Models made in Japan.; OEM Part No. 4260733011	28365	35, 4		
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Service Pack	-	20032	35, 4			
	Sensor	Models made in Japan.; OEM Part No. 4260733011	28365	35, 4	Prius	EZ-Sensor	-	33000*	11.5, 1.3		
	Service Pack	-	20032	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		
				EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7			
				Sensor		-	28365	35, 4			
				Service Pack		-	20032	35, 4			

* Programming Tool Required

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2011 (cont.)					2010					
Toyota (cont.)	RAV4	EZ-Sensor	-	33000*	11.5, 1.3	4 Runner	EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		Sensor	-	28370	35, 4		Sensor	-	28370	35, 4
		Service Pack	-	20032	35, 4		Service Pack	-	20032	35, 4
	Sequoia, Sienna	EZ-Sensor	-	33000*	11.5, 1.3		Avalon	EZ-Sensor	-	33000*
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7
		Sensor	-	28670	35, 4	Sensor		-	28360	35, 4
		Service Pack	-	20022	35, 4	Service Pack		-	20032	35, 4
	Solara	EZ-Sensor	-	33000*	11.5, 1.3	Camry	EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		Sensor	-	28360	35, 4		Sensor	Models made in USA.; OEM Part No. 4260706011	28360	35, 4
		Service Pack	-	20032	35, 4		Sensor	Models made in Japan.; OEM Part No. 4260733011	28365	35, 4
	Tacoma	EZ-Sensor	-	33000*	11.5, 1.3	Camry Hybrid	Service Pack	-	20032	35, 4
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		Sensor	W/Alloy Wheels; W/20 Deg. Angled Valve Sensor	28360	35, 4		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		Sensor	W/Steel Wheels; W/40 Deg. Angled Valve Sensor	28380	35, 4		Sensor	Models made in Japan.; OEM Part No. 4260733011	28365	35, 4
		Service Pack	-	20032	35, 4		Service Pack	-	20032	35, 4
	Tundra	EZ-Sensor	-	33000*	11.5, 1.3	Corolla	EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		Sensor	W/Alloy Wheels; W/TRW sensor	28670	35, 4		Sensor	Models made in USA.; W/16" Or 17" Wheels	28360	35, 4
		Service Pack	-	20022	35, 4		Sensor	Models made in Japan.; OEM Part No. 4260733011	28365	35, 4
	Venza	EZ-Sensor	-	33000*	11.5, 1.3	Sensor	Models made in USA.; W/15" Wheels	28365	35, 4	
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	Models made in Japan.; OEM Part No. 4260733021	28370	35, 4
EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	Service Pack		-	20032	35, 4	
Sensor		-	28360	35, 4	FJ Cruiser, Highlander, Highlander Hybrid, Land Cruiser		EZ-Sensor	-	33000*	11.5, 1.3
Service Pack		-	20032	35, 4			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
Yaris	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	28365	35, 4	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Service Pack	-	20032	35, 4		
	Sensor	-	28365	35, 4						
	Service Pack	-	20032	35, 4						

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	
2010 (cont.)					2010 (cont.)					
Toyota (cont.)	Matrix	EZ-Sensor	-	33000*	11.5, 1.3	Venza	EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		Sensor	Models made in USA.; OEM Part No. 4260706011	28360	35, 4		Sensor	-	28360	35, 4
		Sensor	Models made in Japan.; OEM Part No. 4260733011	28365	35, 4		Service Pack	-	20032	35, 4
		Service Pack	-	20032	35, 4		Yaris	EZ-Sensor	-	33000*
	Prius	EZ-Sensor	-	33000*	11.5, 1.3	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Sensor		-	28365	35, 4
		Sensor	-	28365	35, 4	Service Pack	-	20032	35, 4	
RAV4	EZ-Sensor	-	33000*	11.5, 1.3	2009					
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	4 Runner	EZ-Sensor ¹	-	33000*	11.5, 1.3	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Sensor	-	28370	35, 4		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Service Pack	-	20032	35, 4		Sensor	W/Valve Cap	28365	35, 4	
	Sequoia, Sienna	EZ-Sensor	-	33000*		11.5, 1.3	Sensor	W/O Valve Cap	28370	35, 4
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Service Pack	-	20032	35, 4	
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Avalon	EZ-Sensor	-	33000*	11.5, 1.3
Sensor		-	28670	35, 4	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	
Service Pack		-	20022	35, 4	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	
Solara		EZ-Sensor	-	33000*	11.5, 1.3	Sensor	-	28360	35, 4	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Service Pack	-	20032	35, 4		
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Camry	EZ-Sensor	-	33000*	11.5, 1.3	
	Sensor	-	28360	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	-	20032	35, 4		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	Tacoma	EZ-Sensor	-	33000*		11.5, 1.3	Sensor	Models made in USA.; OEM Part No. 4260706011	28360	35, 4
EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	Sensor	Models made in Japan.; OEM Part No. 4260733011	28365	35, 4		
EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	Service Pack	-	20032	35, 4		
Sensor		W/Alloy Wheels; W/20 Deg. Angled Valve Sensor	28360	35, 4	Camry Hybrid	EZ-Sensor	-	33000*	11.5, 1.3	
Sensor		W/Steel Wheels; W/40 Deg. Angled Valve Sensor	28380	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
Service Pack		-	20032	35, 4		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
Tundra	EZ-Sensor	-	33000*	11.5, 1.3		Sensor	Models made in Japan.; OEM Part No. 4260733011	28365	35, 4	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Service Pack	-	20032	35, 4		
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Corolla	EZ-Sensor	-	33000*	11.5, 1.3	
	Sensor	W/Alloy Wheels; W/TRW sensor	28670	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	Service Pack	-	20022	35, 4		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.
2009 (cont.)					2009 (cont.)				
Corolla (cont.)	Sensor	Models made in USA.; W/16" Or 17" Wheels	28360	35, 4	Tacoma	EZ-Sensor	-	33000*	11.5, 1.3
	Sensor	Models made in Japan.; OEM Part No. 4260733011	28365	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Sensor	Models made in USA.; W/15" Wheels	28365	35, 4		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	Models made in Japan.; OEM Part No. 4260733021	28370	35, 4		Sensor	W/Alloy Wheels; W/20 Deg. Angled Valve Sensor	28360	35, 4
	Service Pack	-	20032	35, 4		Sensor	W/Steel Wheels; W/40 Deg. Angled Valve Sensor	28380	35, 4
Service Pack	-	20032	35, 4	Service Pack		-	20032	35, 4	
FJ Cruiser, Highlander, Highlander Hybrid, Land Cruiser	EZ-Sensor	-	33000*	11.5, 1.3	Tundra	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	-	28365	35, 4		Sensor	W/Alloy Wheels; W/TRW sensor	28670	35, 4
	Service Pack	-	20032	35, 4		Service Pack	-	20022	35, 4
Service Pack	-	20032	35, 4	Service Pack		-	20022	35, 4	
Matrix	EZ-Sensor	-	33000*	11.5, 1.3	Venza	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	Models made in USA.; OEM Part No. 4260706011	28360	35, 4		Sensor	-	28360	35, 4
	Sensor	Models made in Japan.; OEM Part No. 4260733011	28365	35, 4		Service Pack	-	20032	35, 4
Service Pack	-	20032	35, 4	Service Pack	-	20032	35, 4		
Prius	EZ-Sensor	-	33000*	11.5, 1.3	Yaris	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	-	28365	35, 4		Sensor	-	28365	35, 4
	Service Pack	-	20032	35, 4		Service Pack	-	20032	35, 4
RAV4	EZ-Sensor	-	33000*	11.5, 1.3	2008				
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	4 Runner	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	-	28370	35, 4		Sensor	W/Valve Cap; OEM Part No. 4260733011	28365	35, 4
Service Pack	-	20032	35, 4	Sensor		W/O Valve Cap; OEM Part No. 4260733021	28370	35, 4	
Sequoia, Sienna	EZ-Sensor	-	33000*	11.5, 1.3	Service Pack	-	20032	35, 4	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Avalon	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Sensor	-	28670	35, 4		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Service Pack	-	20022	35, 4		Sensor	-	28360	35, 4
Service Pack	-	20022	35, 4	Service Pack		-	20032	35, 4	
Solara	EZ-Sensor	-	33000*	11.5, 1.3	Camry	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	May & Newer	28360	35, 4					
	Service Pack	May & Newer	20032	35, 4					

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.
2008 (cont.)					2008 (cont.)				
Camry (cont.)	Sensor	Models made in USA.; OEM Part No. 4260706011	28360	35, 4	Prius	EZ-Sensor	-	33000*	11.5, 1.3
	Sensor	Models made in Japan.; OEM Part No. 4260733011	28365	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Service Pack	-	20032	35, 4		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
Camry Hybrid	EZ-Sensor	-	33000*	11.5, 1.3		Sensor	-	28365	35, 4
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	-	20032	35, 4
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		RAV4	EZ-Sensor	-	33000*
	Sensor	Models made in Japan.; OEM Part No. 4260733011	28365	35, 4	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3
Service Pack	-	20032	35, 4	EZ-Sensor Service Pack	Almnm. Valve		34000	62, 7	
Corolla	EZ-Sensor	-	33000*	11.5, 1.3	Sensor		-	28370	35, 4
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Service Pack		-	20032	35, 4
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Sequoia, Sienna	EZ-Sensor	-	33000*	11.5, 1.3
	Sensor	Models made in USA.; OEM Part No. 4260706011	28360	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Sensor	Models made in Japan.; OEM Part No. 4260733011	28365	35, 4		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
Service Pack	-	20032	35, 4	Sensor		-	28670	35, 4	
Service Pack	-	20032	35, 4	Service Pack		-	20022	35, 4	
FJ Cruiser, Highlander	EZ-Sensor	-	33000*	11.5, 1.3	Solara	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	-	28365	35, 4		Sensor	-	28360	35, 4
	Service Pack	-	20032	35, 4		Service Pack	-	20032	35, 4
	Highlander Hybrid	Sensor	-	28365	35, 4	Tacoma	EZ-Sensor	-	33000*
Service Pack		-	20032	35, 4	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3
Land Cruiser	EZ-Sensor	-	33000*	11.5, 1.3	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Sensor		W/Alloy Wheels; W/20 Deg. Angled Valve Sensor	28360	35, 4
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Sensor		W/Steel Wheels; W/40 Deg. Angled Valve Sensor	28380	35, 4
	Sensor	-	28365	35, 4	Service Pack	-	20032	35, 4	
	Service Pack	-	20032	35, 4	Tundra	EZ-Sensor	-	33000*	11.5, 1.3
Matrix	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	W/Alloy Wheels; W/TRW sensor	28670	35, 4
	Sensor	Models made in USA.; OEM Part No. 4260706011	28360	35, 4		Service Pack	-	20022	35, 4
	Sensor	Models made in Japan.; OEM Part No. 4260733011	28365	35, 4	Yaris	EZ-Sensor	-	33000*	11.5, 1.3
Service Pack	-	20032	35, 4	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	
				EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	
				Sensor		-	28365	35, 4	
				Service Pack		-	20032	35, 4	

* Programming Tool Required

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.		
2007					2007 (cont.)						
Toyota (cont.)	4 Runner	EZ-Sensor	-	33000*	11.5, 1.3	Prius	EZ-Sensor	-	33000*	11.5, 1.3	
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
		Sensor	W/Valve Cap	28365	35, 4		Sensor	-	28365	35, 4	
		Sensor	W/O Valve Cap	28370	35, 4		Service Pack	-	20032	35, 4	
		Service Pack	-	20032	35, 4		RAV4	EZ-Sensor	-	33000*	11.5, 1.3
	Avalon	EZ-Sensor	-	33000*	11.5, 1.3	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Sensor		-	28370	35, 4	
		Sensor	-	28360	35, 4	Service Pack		-	20032	35, 4	
		Service Pack	-	20032	35, 4	Sequoia		EZ-Sensor	-	33000*	11.5, 1.3
		Camry	EZ-Sensor	-	33000*		11.5, 1.3	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	
	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7		Sensor	W/Steel Wheels; W/40 Deg. Angled Valve Sensor	28300	35, 4	
	Sensor		Models made in USA.; OEM Part No. 4260706011	28360	35, 4		Sensor	W/Alloy Wheels	28305	35, 4	
	Sensor		Models made in Japan.; OEM Part No. 4260733011	28365	35, 4		Sensor	W/Steel Wheels; W/20 Deg. Angled Valve Sensor	28305	35, 4	
	Service Pack		-	20032	35, 4		Service Pack	-	20031	35, 4	
	Corolla	EZ-Sensor	-	33000*	11.5, 1.3		Sienna	EZ-Sensor	-	33000*	11.5, 1.3
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3			EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7			EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
		Sensor	Models made in USA.; OEM Part No. 4260706011; Jun. & Newer	28360	35, 4	Sensor		-	28670	35, 4	
		Sensor	Models made in Japan.; OEM Part No. 4260733011; Jun. & Newer	28365	35, 4	Service Pack	-	20022	35, 4		
		Service Pack	Jun. & Newer	20032	35, 4	Solara	EZ-Sensor	-	33000*	11.5, 1.3	
	Highlander, Land Cruiser	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7		
EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	Sensor		-	28360	35, 4		
Sensor		May & Newer	28365	35, 4	Service Pack	-	20032	35, 4			
Service Pack		May & Newer	20032	35, 4	Tacoma	EZ-Sensor	-	33000*	11.5, 1.3		
Matrix		EZ-Sensor	-	33000*		11.5, 1.3	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	W/Alloy Wheels; W/20 Deg. Angled Valve Sensor	28360	35, 4		
	Sensor	Models made in USA.; OEM Part No. 4260706011; Jun. & Newer	28360	35, 4		Sensor	W/Steel Wheels; W/40 Deg. Angled Valve Sensor	28380	35, 4		
	Sensor	Models made in Japan.; OEM Part No. 4260733011; Jun. & Newer	28365	35, 4		Service Pack	-	20032	35, 4		
	Service Pack	Jun. & Newer	20032	35, 4	Tundra	EZ-Sensor	-	33000*	11.5, 1.3		
				EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3			
				EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7			
				Sensor		W/Alloy Wheels; W/TRW sensor	28670	35, 4			
				Sensor		W/Steel Wheels; W/TRW sensor					
				Service Pack		W/Alloy Wheels; W/TRW sensor	20022	35, 4			

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.
2007 (cont.)					2006 (cont.)				
Yaris	EZ-Sensor	-	33000*	11.5, 1.3	Sequoia (cont.)	Sensor	W/Steel Wheels; W/40 Deg. Angled Valve Sensor	28300	35, 4
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	W/Alloy Wheels	28305	35, 4
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Sensor	W/Steel Wheels; W/20 Deg. Angled Valve Sensor	28305	35, 4
	Sensor	Aug. & Newer	28365	35, 4		Service Pack	-	20031	35, 4
	Service Pack	Aug. & Newer	20032	35, 4	Sienna	EZ-Sensor	-	33000*	11.5, 1.3
	2006					EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
4 Runner	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	28670	35, 4
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Service Pack	-	20022	35, 4	
	Sensor	OEM Part No. 4260730030	28335	35, 4	Solara	EZ-Sensor	-	33000*	11.5, 1.3
	Sensor	OEM Part No. 4260735010	28345	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Sensor	OEM Part No. 4260733011	28365	35, 4		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	OEM Part No. 4260733021	28370	35, 4		Sensor	May & Newer	28360	35, 4
	Service Pack	May & Older	20031	35, 4	Service Pack	May & Newer	20032	35, 4	
	Service Pack	Jun. & Newer	20032	35, 4	Tacoma	EZ-Sensor	-	33000*	11.5, 1.3
	Avalon	EZ-Sensor	-	33000*		11.5, 1.3	EZ-Sensor Service Pack	Rubber Valve	20018
EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7		Sensor	W/Alloy Wheels; W/20 Deg. Angled Valve Sensor; Jul. & Older	28355	35, 4
Sensor		Aug. & Newer	28360	35, 4	Sensor	W/Alloy Wheels; W/20 Deg. Angled Valve Sensor; Aug. & Newer	28360	35, 4	
Service Pack		Aug. & Newer	20032	35, 4	Sensor	W/Steel Wheels; W/40 Deg. Angled Valve Sensor	28380	35, 4	
Land Cruiser		EZ-Sensor	-	33000*	11.5, 1.3	Service Pack	Jul. & Older	20031	35, 4
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Service Pack	Aug. & Newer	20032	35, 4	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Tundra	EZ-Sensor	-	33000*	11.5, 1.3
	Sensor	-	28365	35, 4		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	Service Pack	Mar. & Older	20031	35, 4		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Service Pack	Apr. 1 & Newer	20032	35, 4		Sensor	W/Steel Wheels; W/40 Deg. Angled Valve Sensor	28300	35, 4
Prius	EZ-Sensor	-	33000*	11.5, 1.3	Sensor	W/Alloy Wheels; W/20 Deg. Angled Valve Sensor	28305	35, 4	
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Sensor	W/Alloy Wheels; W/TRW sensor	28670	35, 4	
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Sensor	W/Steel Wheels; W/TRW sensor			
	Sensor	-	28365	35, 4	Service Pack	Nov. 1 & Newer	20022	35, 4	
	Service Pack	-	20032	35, 4	Service Pack	Oct. 31 & Older	20031	35, 4	
	RAV4	EZ-Sensor	-	33000*	11.5, 1.3	2005			
EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	4 Runner	EZ-Sensor	-	33000*	11.5, 1.3
EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
Sensor		-	28365	35, 4		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
Service Pack		-	20032	35, 4		Sensor	-	28345	35, 4
Service Pack		-	20032	35, 4		Service Pack	-	20031	35, 4
Sequoia	EZ-Sensor	-	33000*	11.5, 1.3					
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3					
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7					

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.
2005 (cont.)					2004 (cont.)				
Land Cruiser	EZ-Sensor	-	33000*	11.5, 1.3	Sequoia	EZ-Sensor	-	33000*	11.5, 1.3
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	Sensor	May & Newer	28365	35, 4		Sensor	W/Steel Wheels; W/40 Deg. Angled Valve Sensor	28300	35, 4
	Service Pack	May & Newer	20031	35, 4		Sensor	W/Alloy Wheels	28305	35, 4
Prius	EZ-Sensor	-	33000*	11.5, 1.3		Sensor	W/Steel Wheels; W/20 Deg. Angled Valve Sensor	28305	35, 4
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Service Pack	-	20031	35, 4
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	2003				
	Sensor	-	28365	35, 4	4 Runner	EZ-Sensor	-	33000*	11.5, 1.3
Service Pack	-	20032	35, 4	EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	
Sequoia	EZ-Sensor	-	33000*	11.5, 1.3		EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3		Sensor	-	28345	35, 4
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7	Service Pack	-	20031	35, 4	
	Sensor	W/Steel Wheels; W/40 Deg. Angled Valve Sensor	28300	35, 4	2013				
	Sensor	W/Alloy Wheels	28305	35, 4	CC	Sensor	-		
	Sensor	W/Steel Wheels; W/20 Deg. Angled Valve Sensor	28305	35, 4		Service Pack	-		
	Service Pack	-	20031	35, 4	Eos	Sensor	-	20088	71, 8
	Tacoma	EZ-Sensor	-	33000*		11.5, 1.3	Service Pack	-	20017
EZ-Sensor Service Pack		Rubber Valve	20018	11.5, 1.3	Touareg	Sensor	W/315 MHz Sensor; Includes Transmitter Only	20077	35, 4
EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7		Sensor	W/433 MHz Sensor; Includes Transmitter Only	20103	35, 4
Sensor		W/40 Deg. Angled Valve Sensor; Nov. 30 & Older	28300	35, 4		Service Pack	Does Not Include Valve; W/315 MHz Sensor	20023	35, 4
Sensor		W/20 Deg. Angled Valve Sensor; Nov. 30 & Older	28305	35, 4		Service Pack	W/43mm Silver Insert; W/315 MHz Sensor	20037	35, 4
Sensor		W/20 Deg. Angled Valve Sensor; Dec. 1 & Newer	28355	35, 4		Service Pack	W/48mm Green Insert; W/315 MHz Sensor	20038	35, 4
Sensor		W/40 Deg. Angled Valve Sensor; Dec. 1 & Newer	28380	35, 4		Service Pack	W/49mm Black Insert; W/315 MHz Sensor	20039	35, 4
Service Pack		-	20031	35, 4		Service Pack	W/51mm Orange Insert; W/315 MHz Sensor	20040	35, 4
Tundra	EZ-Sensor	-	33000*	11.5, 1.3		2012			
	EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	CC, Eos	Sensor	-	20088	71, 8
	EZ-Sensor Service Pack	Almnm. Valve	34000	62, 7		Service Pack	-	20017	71, 8
	Sensor	W/Steel Wheels; W/40 Deg. Angled Valve Sensor	28300	35, 4	Routan	Sensor	-		
	Sensor	W/Alloy Wheels; W/20 Deg. Angled Valve Sensor	28305	35, 4		Service Pack	-		
	Service Pack	-	20031	35, 4	Tiguan	Sensor	-	20088	71, 8
	4 Runner	EZ-Sensor	-	33000*		11.5, 1.3	Service Pack	-	20017
		EZ-Sensor Service Pack	Rubber Valve	20018	11.5, 1.3	Touareg, Touareg 2	Sensor	W/315 MHz Sensor; Includes Transmitter Only	20077
EZ-Sensor Service Pack		Almnm. Valve	34000	62, 7	Sensor		W/433 MHz Sensor; Includes Transmitter Only	20103	35, 4
Sensor		-	28345	35, 4	Service Pack	Does Not Include Valve; W/315 MHz Sensor	20023	35, 4	
Service Pack		-	20031	35, 4	Service Pack	W/43mm Silver Insert; W/315 MHz Sensor	20037	35, 4	
					Service Pack	W/48mm Green Insert; W/315 MHz Sensor	20038	35, 4	
				Service Pack	W/49mm Black Insert; W/315 MHz Sensor	20039	35, 4		
				Service Pack	W/51mm Orange Insert; W/315 MHz Sensor	20040	35, 4		

* Programming Tool Required

SCHRADER 2014 TPMS APPLICATION GUIDE

■ ALPHABETICAL LISTING

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.
2011					2008				
CC, Eos	Sensor	-	20088	71, 8	Beetle, Eos	Sensor	-	20088	71, 8
	Service Pack	-	20017	71, 8		Service Pack	-	20017	71, 8
Routan	Sensor	-			GLI	Service Pack	-	20017	71, 8
	Service Pack	-			Golf, GTI, Jetta	Sensor	-	20088	71, 8
Tiguan	Sensor	-	20088	71, 8		Service Pack	-	20017	71, 8
	Service Pack	-	20017	71, 8	Passat	Sensor	W/16" Or 17" Wheels	20088	71, 8
Touareg 2	Sensor	W/315 MHz Sensor; Includes Transmitter Only	20077	35, 4		Service Pack	W/16" Or 17" Wheels	20017	71, 8
	Sensor	W/433 MHz Sensor; Includes Transmitter Only	20103	35, 4	R32, Rabbit	Sensor	-	20088	71, 8
Service Pack	Does Not Include Valve; W/315 MHz Sensor	20023	35, 4	Service Pack		-	20017	71, 8	
Service Pack	W/43mm Silver Insert; W/315 MHz Sensor	20037	35, 4	Touareg 2	Sensor	Includes Transmitter Only	20078	35, 4	
Service Pack	W/48mm Green Insert; W/315 MHz Sensor	20038	35, 4		Service Pack	Does Not Include Valve	20023	35, 4	
Service Pack	W/49mm Black Insert; W/315 MHz Sensor	20039	35, 4		Service Pack	W/43mm Silver Insert	20037	35, 4	
Service Pack	W/51mm Orange Insert; W/315 MHz Sensor	20040	35, 4		Service Pack	W/48mm Green Insert	20038	35, 4	
2010					Service Pack	W/49mm Black Insert	20039	35, 4	
Beetle, CC, Eos, Golf, GTI, Jetta, Passat	Sensor	-	20088		71, 8	Service Pack	W/51mm Orange Insert	20040	35, 4
	Service Pack	-	20017	71, 8	2007				
Routan	Sensor	-			Eos	Sensor	-	20088	71, 8
	Service Pack	-				Service Pack	-	20017	71, 8
Tiguan	Sensor	-	20088	71, 8	GTI	Sensor	W/16" Or 17" Wheels	20088	71, 8
	Service Pack	-	20017	71, 8		Service Pack	W/16" Or 17" Wheels	20017	71, 8
Touareg 2	Sensor	Includes Transmitter Only	20103	35, 4	Jetta	Sensor	-	20088	71, 8
	Service Pack	Does Not Include Valve	20023	35, 4		Service Pack	-	20017	71, 8
	Service Pack	W/43mm Silver Insert	20037	35, 4	Passat	Sensor	W/16" Or 17" Wheels	20088	71, 8
	Service Pack	W/48mm Green Insert	20038	35, 4		Service Pack	W/16" Or 17" Wheels	20017	71, 8
	Service Pack	W/49mm Black Insert	20039	35, 4	Rabbit	Sensor	W/15" Wheels	20088	71, 8
	Service Pack	W/51mm Orange Insert	20040	35, 4		Service Pack	W/15" Wheels	20017	71, 8
2009					Touareg	Service Pack	Does Not Include Valve	20023	62, 7
Beetle, CC, Eos	Sensor	-	20088	71, 8		Service Pack	W/43mm Silver Insert	20037	62, 7
	Service Pack	-	20017	71, 8		Service Pack	W/48mm Green Insert	20038	62, 7
GLI	Service Pack	-	20017	71, 8		Service Pack	W/49mm Black Insert	20039	62, 7
Golf, GTI, Jetta, Passat, Rabbit	Sensor	-	20088	71, 8		Service Pack	W/51mm Orange Insert	20040	62, 7
	Service Pack	-	20017	71, 8		2006			
Routan	Sensor	-			Golf	Service Pack	GTI	20017	71, 8
	Service Pack	-			GTI	Sensor	W/16" Or 17" Wheels	20088	71, 8
Tiguan	Sensor	-	20088	71, 8		Service Pack	W/16" Or 17" Wheels	20017	71, 8
	Service Pack	-	20017	71, 8	Jetta	Sensor	-	20088	71, 8
Touareg 2	Sensor	Includes Transmitter Only	20078	35, 4		Service Pack	-	20017	71, 8
	Service Pack	Does Not Include Valve	20023	35, 4	Passat	Sensor	W/16" Or 17" Wheels	20088	71, 8
	Service Pack	W/43mm Silver Insert	20037	35, 4		Service Pack	W/16" Or 17" Wheels	20017	71, 8
	Service Pack	W/48mm Green Insert	20038	35, 4	Phaeton	Sensor	Includes Transmitter Only; W/315 MHz Sensor	20077	35, 4
	Service Pack	W/49mm Black Insert	20039	35, 4		Sensor	Includes Transmitter Only; W/433 MHz Sensor	20078	35, 4
	Service Pack	W/51mm Orange Insert	20040	35, 4		Service Pack	Does Not Include Valve; W/315 MHz Sensor	20023	35, 4
2008						Service Pack	W/43mm Silver Insert; W/315 MHz Sensor	20037	35, 4
2007						Service Pack	W/48mm Green Insert; W/315 MHz Sensor	20038	35, 4
2006						Service Pack	W/49mm Black Insert; W/315 MHz Sensor	20039	35, 4
2005					Service Pack	W/51mm Orange Insert; W/315 MHz Sensor	20040	35, 4	

Volkswagen (cont.)

Volkswagen (cont.)

■ ALPHABETICAL LISTING

SCHRADER 2014 TPMS APPLICATION GUIDE

Model	Application	Details	Part #	Torque In-lbs, Torque N.m.	Model	Application	Details	Part #	Torque In-lbs, Torque N.m.
2006 (cont.)					2009-2008				
Rabbit	Sensor	W/15" Wheels	20088	71, 8	C30, C70, S40	Sensor	-	20097	71, 8
	Service Pack	W/15" Wheels	20017	71, 8		Service Pack	-	20003	71, 8
Touareg	Service Pack	Does Not Include Valve	20023	62, 7	S60	Sensor	-	20156	44, 5
	Service Pack	W/43mm Silver Insert	20037	62, 7		Service Pack	-	20010	44, 5
	Service Pack	W/48mm Green Insert	20038	62, 7	S80, V50, V70, XC70	Sensor	-	20097	71, 8
	Service Pack	W/49mm Black Insert	20039	62, 7		Service Pack	-	20003	71, 8
Service Pack	W/51mm Orange Insert	20040	62, 7	XC90	Sensor	W/315 MHz Sensor	20156	44, 5	
Service Pack	W/51mm Orange Insert	20040	62, 7		Service Pack	W/315 MHz Sensor	20010	44, 5	
2005-2004					2007				
Phaeton	Sensor	Includes Transmitter Only; W/315 MHz Sensor	20077	35, 4	C30, C70, S40	Sensor	-	20097	71, 8
	Sensor	Includes Transmitter Only; W/433 MHz Sensor	20078	35, 4		Service Pack	-	20003	71, 8
	Service Pack	Does Not Include Valve; W/315 MHz Sensor	20023	35, 4	S60	Sensor	-	20156	44, 5
	Service Pack	W/43mm Silver Insert; W/315 MHz Sensor	20037	35, 4		Service Pack	-	20010	44, 5
	Service Pack	W/48mm Green Insert; W/315 MHz Sensor	20038	35, 4	S80, V50	Sensor	-	20097	71, 8
	Service Pack	W/49mm Black Insert; W/315 MHz Sensor	20039	35, 4		Service Pack	-	20003	71, 8
	Service Pack	W/51mm Orange Insert; W/315 MHz Sensor	20040	35, 4	V70, XC70, XC90	Sensor	W/315 MHz Sensor	20156	44, 5
Service Pack	W/51mm Orange Insert; W/315 MHz Sensor	20040	35, 4	Service Pack		W/315 MHz Sensor	20010	44, 5	
Touareg	Service Pack	Does Not Include Valve	20023	62, 7	2006				
	Service Pack	W/43mm Silver Insert	20037	62, 7	S60, S80	Sensor	-	20156	44, 5
	Service Pack	W/48mm Green Insert	20038	62, 7		Service Pack	-	20010	44, 5
	Service Pack	W/49mm Black Insert	20039	62, 7	V50	Sensor	-	20097	71, 8
	Service Pack	W/51mm Orange Insert	20040	62, 7		Service Pack	-	20003	71, 8
Service Pack	W/51mm Orange Insert	20040	62, 7	V70, XC70, XC90	Sensor	W/315 MHz Sensor	20156	44, 5	
Service Pack	W/51mm Orange Insert	20040	62, 7		Service Pack	W/315 MHz Sensor	20010	44, 5	
2013-2012					2005				
C30, C70, S40, S60, S80, XC60, XC70	Sensor	-	20097	71, 8	S60	Sensor	W/315 MHz Sensor	20156	44, 5
	Service Pack	-	20003	71, 8		Service Pack	W/315 MHz Sensor	20010	44, 5
XC90	Sensor	-	28362	11.5, 1.3	S80	Sensor	-	20156	44, 5
	Service Pack	-	20008	11.5, 1.3		Service Pack	-	20010	44, 5
2011					V50	Sensor	-	20097	71, 8
C30, C70, S40, S60, S80, V50, XC60, XC70	Sensor	-	20097	71, 8		Service Pack	-	20003	71, 8
	Service Pack	-	20003	71, 8	V70, XC70, XC90	Sensor	W/315 MHz Sensor	20156	44, 5
XC90	Sensor	W/315 MHz Sensor	20156	44, 5		Service Pack	W/315 MHz Sensor	20010	44, 5
	Service Pack	-	20010	44, 5	2004				
2010					S60	Sensor	W/315 MHz Sensor	20156	44, 5
C30, C70, S40, S80, V50, V70, XC60, XC70	Sensor	-	20097	71, 8		Service Pack	W/315 MHz Sensor	20010	44, 5
	Service Pack	-	20003	71, 8	S80	Sensor	-	20156	44, 5
XC90	Sensor	W/315 MHz Sensor	20156	44, 5		Service Pack	-	20010	44, 5
	Service Pack	-	20010	44, 5	V70, XC70	Sensor	W/315 MHz Sensor	20156	44, 5
Service Pack	-	20010	44, 5	Service Pack		W/315 MHz Sensor	20010	44, 5	
XC90	Sensor	-	20156	44, 5	XC90	Sensor	-	20156	44, 5
	Service Pack	-	20010	44, 5		Service Pack	-	20010	44, 5

SCHRADER 2014 TPMS APPLICATION GUIDE

MANUFACTURER'S PART NUMBERS

OEM Sensor #	Schrader Sensor #	OEM Sensor #	Schrader Sensor #	OEM Sensor #	Schrader Sensor #	OEM Sensor #	Schrader Sensor #
0009054100	28214	313020960	20097	42753STP6A82	20100	56053036AA	20066
0009054100	28214	36106790054	28081	42753SWA306	20099	5L1Z1A150AA	20135
0025406817	20094	36106798872	28126	42753SWA316	20099	68001696AA	20066
0025406917	20095	36106856227	28081	42753TK4A01	20720	68001696AA	28308
0025407917	20094	36118378682	20080	42753TL2A51	20098	68001696AA	28434
0025408017	20095	36146752128	28082	42753TL2A52	20098	68001696AB	20066
0025408617	28214	36236781847	20083	42753TP6A82	20100	68001696AB	28308
0025409017	28214	36236798726	28081	42753TR0A81	28720	68001698AA	28155
0035400217	28214	40700-1AA0B	28204	42753TX4A51	28128	68001698AA	28434
0045421518	28214	40700-1AA0D	28204	4313054J20	20087	68001698AB	28155
06421S3VA02	28981	40700-1PA0A	28342	4313054J21	20087	68001698AB	28434
06421S3VA03	28981	40700-CD001	20064	4313054J22	20087	68006771AA	20089
06421S3VA04	28981	40700-CK001	20161	4313057L00	20066	68038945AA	20089
06421S9VA01	28982	40700-CK002	20069	4313057L00	20066	68078861AA	20066
06421S9VA03	28982	40700-JA00C	28204	4313057L00	28308	68078861AA	28308
185189	20077	40700-JA01A	28167	4313078J10	20158	68193586AA	28586
10394110	20158	40700-JA01B	28204	4313085Z00	20153	68193586AB	28586
10438853	28006	40700-JA01C	28204	4313086Z20	20082	68239720AA	28984
12768826	28206	40700-JA02B	28204	4321182Z10	28204	6F2Z1A189A	28385
13172567	28078	40700-JK00B	28210	4815132	28004	7L1Z1A189A	28390
13227143	20159	42508875	28129	4815132AB	28004	7P0907275	20103
13581558	28206	4250A030	28129	4D0907275	20077	7P0907275A	20077
13581560	20223	4250A225	28096	4D0907275C	20077	7P0907275D	20103
13586335	20153	4250B668	20398	4D0907275D	20079	7PP907275F	20103
15114379	20107	4250B875	28129	4F0907275B	20078	86517000	20156
15122618	20131	4250B877	20034	4F0907275D	20103	88974915	28360
15136883	20115	4250B8975	28096	4F0907275H	20077	8257740060	20116
15254101	20153	4260702010	28365	4L2Z 1A150 BA	20096	8973271890	20028
15268606	20158	4260704010	28380	5096808AA	20028	8C2Z1A189A	28395
15825475	20158	4260706011	28360	5127335AB	20335	95536105300	20077
15921013	20158	4260706020	28360	5142340AA	20066	95836166100	20103
15922396	20153	4260708010	28670	52088990AC	20028	99760602120	28087
1K0907253D	20088	4260724010	28310	52088990AD	20028	9L3Z1A189A	20315
20922900	28206	4260724020	28315	529331FA00	28983	BBM2-37-140B	20093
20923680	20153	4260724030	28320	529332F000	28849	C2C25519	20090
20925924	20158	4260724030	28320	529332F001	28849	C2C40476	20090
20964159	28423	4260724040	28325	529332G200	20086	C2C40725	20091
224549	20077	4260730030	28335	529332G201	20086	C2S40710	20091
224551	20084	4260730060	28370	529332M000	20092	C2Z15016	20091
22853741	20153	4260733011	28360	529332M001	20092	C2Z15017	20090
22854866	28206	4260733011	28365	529332M550	20092	CM5T 1A180 AA	20315
22959744	28206	4260733021	28370	529332V000	28505	DE8T-1A180-AA	20315
24437708	28078	4260733022	28370	529334D200	20085	GN3A37140B	20093
25758220	20076	4260735010	28345	52933A5000	20092	GS1D37140	20093
25773946	20117	4260775010	28345	56029319AA	28154	LR010532	20091
25774006	20116	426070C010	28300	56029319AB	28154	LR010533	20090
25799331	20153	426070C020	28305	56029359AA	28155	LR018860	20090
25920615	20153	426070C030	28670	56029359AB	28155	LR018861	20091
28103AG00A	20081	426070C050	28670	56029359AC	28155	LR021936	20090
28103AG01A	28203	42607AD020	28355	56029398AA	20398	LR0500461	20090
28103AG01B	28203	426070E011	28370	56029398AB	20398	MN103033	20028
28103AG01C	28203	42753SHA53	28981	56029400AB	28291	MN103081	20034
28103SA001	28203	42753SHA54	28981	56029400AC	28291	MN103081	20034
28103SA002	28203	42753SHA82	28983	56029400AD	28291	RQH500471	20091
28103SG000	28203	42753SNA83	28720	56029465AB	20066	XR855949	20091
28103SG010	28203	42753SNA84	28720	56029465AC	20066	XR855950	20090
307489910	20156	42753STKA01	20098	56029479AA	20066	YBD000060	28082
31200923	20156	42753STKA02	20098	56029479AB	28308	YBD000061	28082
312009230	20156	42753STKA03	20098	56029481AB	28434	ZZC137140	28385
312802970	20097	42753STKA04	20098	56053030AB	20066	ZZDA37140	20315

SCHRADER 2014 TPMS APPLICATION GUIDE

NUMERICAL LISTING: Sensors/Transmitters

Part #	Year	Model
20028 (433 MHz)	Chrysler	
	2002 - 2004	300M
	2002 - 2004	Concorde
	2004 - 2008	Crossfire
	2002 - 2004	Intrepid
	2003 - 2004	Pacifica
	2002	Prowler
	2002 - 2003	Town & Country Van
	2002 - 2003	Voyager
	Dodge	
	2002 - 2003	Caravan
	2002 - 2003	Grand Caravan
	2002 - 2004	Intrepid
	2003 - 2011	Viper
Isuzu		
2004	Rodeo	
Jeep		
2002 - 2004	Grand Cherokee	
2002 - 2004	Liberty	
Mitsubishi		
2004 - 2006	Endeavor	
2004 - 2006	Galant	
Plymouth		
2002	Prowler	
Mitsubishi		
2006 - 11	Eclipse	
2006 - 12	Endeavor	
2007 - 13	Galant	
2003 - 06	Montero	
Infiniti		
2003 - 2007	FX35	
2003 - 2007	FX45	
2003 - 2006	G35	
2006 - 2007	M35	
2003 - 2007	M45	
2003 - 2006	Q45	
2003	QX4	
Nissan		
2003 - 2006	350Z	
2003 - 2004	Frontier	
2003 - 2006	Murano	
2003 - 2004	Pathfinder	
2003 - 2004	Xterra	

Part #	Year	Model
20069 (315 MHz)	Infiniti	
	2004 - 2006	QX56
	Nissan	
	2005 - 2006	Armada
	2005 - 2007	Frontier
	2004	Pathfinder
20076 (315 MHz)	2004 - 2006	Quest
	2004 - 2005	Titan
	2006	Xterra
	Cadillac	
2005 - 2008	STS	
2004 - 2009	XLR	
Chevrolet		
2005 - 2009	Corvette	
Audi		
2011	A6	
2003 - 2010	A8	
2011	Q7	
2011	S6	
2003 - 2009	S8	
Bentley		
2003 - 2005	Continental	
Ferrari		
2001 - 2002	550 Maranello	
2002 - 2005	575M Maranello	
2004 - 2009	612 Scaglietti	
2005 - 2009	F430	
Maserati		
2004 - 2006	Quattroporte	
Porsche		
2011	911	
2011	Boxster	
2011	Cayman	
Volkswagen		
2004 - 2006	Phaeton	
2012 - 2013	Touareg	
2011 - 2012	Touareg 2	
Audi		
2002 - 2008	A4	
2005 - 2009	A6	
2007 - 2009	Q7	
2008 - 2009	R8	
2007 - 2008	RS4	

Part #	Year	Model
20078 (433 MHz) (cont.)	Audi (cont.)	
	2004 - 2009	S4
	2007 - 2009	S6
	Bentley	
2006 - 2010	Continental	
Volkswagen		
2004 - 2006	Phaeton	
2008 - 2009	Touareg 2	
20079 (315 MHz)	Audi	
	2001 - 2003	A8
	2001 - 2005	Allroad Quattro
2001 - 2003	S8	
BMW		
2002 - 2005	320i	
2002 - 2006	325Ci	
2002 - 2006	325i	
2002 - 2006	325Xi	
2002 - 2006	330Ci	
2002 - 2006	330i	
2002 - 2006	330Xi	
2002 - 2005	525i	
2002 - 2005	530i	
2002 - 2003	540i	
2004 - 2005	545i	
2004 - 2005	645Ci	
2002 - 2005	745i	
2002 - 2005	745Li	
2004 - 2005	760i	
2003	760Li	
2011	Alpina B7	
2002 - 2003	M3	
2000 - 2003	M5	
2003	Z8	
20080 (433 MHz)	Subaru	
	2006 - 2011	B9 Tribeca
	2004 - 2008	Legacy
	2004 - 2007	Outback
2008 - 2011	Tribeca	
20081 (315 MHz)	Suzuki	
	2005 - 2006	Verona
20082 (315 MHz)		

SCHRADER 2014 TPMS APPLICATION GUIDE

NUMERICAL LISTING: Sensors/Transmitters

Part #	Year	Model
20083 (315 MHz)	BMW	
	2008 - 2011	128I
	2008 - 2010	135I
	BMW (cont.)	
	2006 - 2010	323I
	2007 - 2009	328I
	2007 - 2008	328XI
	2009	335D
	2007 - 2009	335I
	2007 - 2008	335XI
	2006 - 2007	525I
	2006 - 2007	525XI
	2008 - 2011	528I
	2008 - 2009	528XI
	2006 - 2007	530I
	2006 - 2007	530XI
	2008 - 2011	535I
	2008	535XI
	2010	535XI
	2006 - 2011	550I
	2006 - 2010	650I
	2011	740I
	2011	740LI
	2006 - 2011	750I
	2006 - 2011	750LI
	2006	760I
	2004 - 2011	760LI
	2007 - 2008	Alpina B7
	2004 - 2009	M3
	2006 - 2010	M5
2006 - 2010	M6	
2006 - 2011	X3	
2005 - 2011	X5	
2008 - 2011	X6	
2003 - 2011	Z4	
Mini		
2008 - 2009	Cooper	
Ferrari		
2003 - 2004	Enzo	
Hyundai		
2007 - 2009	Entourage	
2007 - 2008	Santa Fe	
2007 - 2008	Veracruz	

Part #	Year	Model
20085 (315 MHz) (cont.)	Kia	
	2006 - 2008	Sedona
20086 (315 MHz)	Hyundai	
	2006 - 2013	Azera
	2007 - 2010	Elantra
	2009 - 2010	Santa Fe
	2009 - 2012	Veracruz
	Kia	
	2008 - 2010	Magentis
	2006 - 2010	Optima
	2006 - 2011	Rondo
	2009 - 2013	Sedona
20087 (315 MHz)	Suzuki	
	2007 - 2013	Grand Vitara
	2007 - 2013	SX4
20088 (315 MHz)	2005 - 2006	XL-7
	Audi	
	2008 - 2012	A3
	2009 - 2012	A4
	2008 - 2012	A5
	2009 - 2012	Q5
	2010 - 2011	S4
	2008 - 2012	S5
	2008 - 2011	TT
	Volkswagen	
	2008 - 2010	Beetle
	2009 - 2012	CC
2007 - 2013	Eos	
2008 - 2010	Golf	
2006 - 2010	GTI	
2006 - 2010	Jetta	
2006 - 2010	Passat	
2008	R32	
2006 - 2009	Rabbit	
2009 - 2012	Tiguan	
Dodge		
2007 - 2010	Sprinter	
Freightliner		
2007 - 2008	Sprinter	
Jaguar		
2008	S-Type	
2005 - 2009	Super V8	
2004 - 2008	Vanden Plas	

Part #	Year	Model
20090 (315 MHz) (cont.)	Jaguar (cont.)	
	2009 - 2012	XF
	2010 - 2011	XFR
	2010 - 2012	XJ
	2004 - 2009	XJ8
	2004 - 2009	XJR
	2007 - 2012	XK
	2007 - 2011	XKR
	2008	X-Type
	Land Rover	
2012 - 2013	Evoque	
2008 - 2013	LR2	
2006 - 2009	LR3	
2010 - 2013	LR4	
2006 - 2013	Range Rover	
Jaguar		
2008	S-Type	
2005 - 2009	Super V8	
2004 - 2009	Vanden Plas	
2009 - 2012	XF	
2010 - 2011	XFR	
2010 - 2012	XJ	
2004 - 2009	XJ8	
2004 - 2009	XJR	
2007 - 2012	XK	
2007 - 2011	XKR	
2008	X-Type	
Land Rover		
2006 - 2009	LR3	
2010 - 2011	LR4	
2006 - 2011	Range Rover	
Hyundai		
2012 - 2014	Accent	
2010 - 2012	Elantra Touring	
2014	Equus	
2010 - 2012	Genesis	
2013 - 2014	Santa Fe	
2011 - 2014	Sonata	
Kia		
2014	Cadenza	
2010 - 2013	Forte	
2011 - 2013	Optima	
2011 - 2013	Sorento	
2010 - 2013	Soul	

■ NUMERICAL LISTING: Sensors/Transmitters

SCHRADER 2014 TPMS APPLICATION GUIDE

Part #	Year	Model
20093 (315 MHz)	Mazda	
	2011 - 2013	2
	2004 - 2013	3
	2006 - 2013	5
	2008 - 2013	6
	2007 - 2011	CX-7
	2007 - 2013	CX-9
	2006 - 2012	MX-5 Miata
	2004 - 2011	RX-8
20094 (433 MHz)	Mercedes-Benz	
	2007 - 2009	CL550
	2007 - 2009	CL600
	2007 - 2009	CL63
	2008 - 2009	CL65
	2006	CLS500
	2006	CLS55
	2007 - 2011	CLS550
	2007 - 2011	CLS63
	2006 - 2009	E320
	2006 - 2009	E350
	2006	E500
	2006	E55
	2007 - 2009	E550
	2007 - 2009	E63
	2010	S400
	2007 - 2010	S550
	2007 - 2010	S600
	2007 - 2010	S63
	2007 - 2010	S65
	2006	SL500
	2006 - 2008	SL55
	2007 - 2009	SL550
2006 - 2009	SL600	
2009 - 2011	SL63	
2006 - 2011	SL65	
2008 - 2009	SLR McLaren	
20095 (433 MHz)	Mercedes-Benz	
	2006 - 2009	E350
	2007 - 2009	E550
	2007 - 2009	GL320
	2007 - 2009	GL450
	2008 - 2009	GL550
	2007 - 2009	ML320
	2006 - 2009	ML350
	2006 - 2007	ML500

Part #	Year	Model
20095 (433 MHz) (cont.)	Mercedes-Benz (cont.)	
	2008 - 2009	ML550
	2007 - 2009	ML63
	2007 - 2009	R320
	2006 - 2009	R350
	2006 - 2007	R500
	2007	R63
20096 (433 MHz)	Ford	
	2003 - 2004	Expedition
	2002 - 2005	Explorer
	Lincoln	
	2003 - 2005	Aviator
	2003 - 2004	Navigator
	Mercury	
	2002 - 2005	Mountaineer
	Volvo	
	2007 - 2013	C30
20097 (433 MHz)	2007 - 2013	C70
	2007 - 2013	S40
	2011 - 2013	S60
	2007 - 2013	S80
	2005 - 2011	V50
	2008 - 2010	V70
	2009 - 2013	XC60
	2008 - 2013	XC70
	Acura	
	2007 - 2013	MDX
20098 (315 MHz)	2007 - 2012	RDX
	2007 - 2014	TSX
	Honda	
	2009 - 2014	Pilot
	Honda	
20099 (315 MHz)	2008 - 2012	Accord
	2007 - 2011	CR-V
	2008	Fit
20100 (315 MHz)	Honda	
	2010 - 2011	Accord
	2012 - 2014	Crosstour
20103 (433 MHz)	2012 - 2013	CR-V
	Audi	
	2009 - 2010	A6
	2010 - 2012	Q7
	2010 - 2014	R8
2010	S6	

Part #	Year	Model
20103 (433 MHz) (cont.)	Bentley	
	2007 - 2014	Azure
	2012 - 2014	Continental
	2011 - 2014	Mulsanne
	Porsche	
	2011 - 2014	Cayenne
	Volkswagen	
	2011 - 2013	Touareg
	2010 - 2012	Touareg 2
	Cadillac	
2005 - 2006	Escalade	
20107 (315 MHz)	Chevrolet	
	2005 - 2006	Avalanche
	2005 - 2007	Silverado Series Pickup
	2005 - 2006	Suburban
	2005 - 2006	Tahoe
	GMC	
	2005 - 2007	Sierra Series Pickup
	2005 - 2006	Yukon
	Cadillac	
	2004	Escalade
20115 (315 MHz)	Chevrolet	
	2004	Avalanche
	2004	Silverado Series Pickup
	2004	Suburban
	2004	Tahoe
	GMC	
	2004	Sierra Series Pickup
	2004	Yukon
	Buick	
	2006 - 2007	Rainier
20116 (315 MHz)	Cadillac	
	2004 - 2007	CTS
	2004 - 2006	SRX
	Chevrolet	
	2006	SSR
	2006 - 2009	Trailblazer
	GMC	
	2006 - 2009	Envoy
	Isuzu	
	2006 - 2008	Ascender
20117 (315 MHz)	Saab	
	2005 - 2009	9-7X
	Cadillac	
	2001 - 2005	Deville
	2001 - 2004	Seville
Chevrolet		
2001 - 2004	Corvette	

SCHRADER 2014 TPMS APPLICATION GUIDE

NUMERICAL LISTING: Sensors/Transmitters

Part #	Year	Model
20131 (315 MHz)	Chevrolet	
	2007 - 2012	Colorado
	GMC	
	2007 - 2012	Canyon
	Hummer	
	2006 - 2010	H3
	2006 - 2010	H3T
	Isuzu	
	2007 - 2009	I-290
	2007 - 2009	I-370
20135 (315 MHz)	Ford	
	2005 - 2006	Expedition
	2004 - 2005	Freestar
	Lincoln	
	2005 - 2006	Navigator
	Mercury	
	2004 - 2005	Monterey Van
	Buick	
	2009	Allure
	2009 - 2014	Enclave
20153 (315 MHz)	2009	Lacrosse
	2007	LeSabre
	2007 - 2011	Lucerne
	Cadillac	
	2008 - 2013	CTS
	2007 - 2011	DTS
	2007 - 2013	Escalade
	2007 - 2009	SRX
	2009 - 2011	STS
	Chevrolet	
2007 - 2013	Avalanche	
2007 - 2012	Aveo	
2012 - 2013	Captiva	
2008 - 2009	Cobalt	
2010 - 2014	Express	
2008 - 2011	HHR	
2007 - 2013	Impala	
2008 - 2012	Malibu	
2007	Monte Carlo	
2007 - 2013	Silverado Series Pickup	
2007 - 2013	Suburban	
2007 - 2013	Tahoe	
2009 - 2014	Traverse	

Part #	Year	Model
20153 (315 MHz) (cont.)	GMC	
	2009 - 2014	Acadia
	2010 - 2014	Savana
	2007 - 2014	Sierra Series Pickup
	2007 - 2013	Yukon
	Hummer	
	2008 - 2010	H2
	Pontiac	
	2009 - 2010	G3
	2009	G3 Wave
20156 (315 MHz)	2009 - 2010	G5
	2009 - 2010	G6
	2008 - 2010	G8
	2008	Grand Prix
	2008 - 2009	Wave
	Saturn	
	2008 - 2010	Aura
	2009 - 2010	Outlook
	2007 - 2010	VUE
	Suzuki	
2007 - 2008	Forenza	
2007 - 2008	Reno	
Volvo		
2004 - 2009	S60	
2004 - 2006	S80	
2004 - 2007	V70	
2004 - 2007	XC70	
2004 - 2011	XC90	
Buick		
2007 - 2008	Allure	
2008	Enclave	
2007 - 2008	Lacrosse	
Cadillac		
2009 - 2013	CTS - V	
2006	DTS	
2007	Escalade	
2009	STS - V	
Chevrolet		
2007	Avalanche	
2011 - 2013	Caprice	
2008	Cobalt	
2010 - 2013	Corvette	
2007 - 2009	Equinox	
2008 - 2009	Express	
2008 - 2009	HHR	
2006 - 2007	Impala	

Part #	Year	Model
20158 (315 MHz) (cont.)	Chevrolet (cont.)	
	2008	Malibu
	2006 - 2007	Monte Carlo
	2007	Silverado Series Pickup
	2007	Suburban
	2007	Tahoe
	2008 - 2009	Uplander
	GMC	
	2007 - 2008	Acadia
	2008 - 2009	Savana
Pontiac		
2007	Sierra Series Pickup	
2007	Yukon	
GMC		
2008	G5	
2008	G6	
2007 - 2008	Grand Prix	
2008 - 2009	Montana	
2008 - 2010	Solstice	
2007 - 2009	Torrent	
Saturn		
2007	Aura	
2008 - 2009	Lambda	
2007 - 2008	Outlook	
2008 - 2010	Sky	
Suzuki		
2007 - 2011	XL-7	
Saab		
2008 - 2012	9-3	
2008 - 2012	9-5	
Infiniti		
2005 - 2007	QX56	
Nissan		
2005 - 2008	Armada	
2005 - 2008	Frontier	
2006 - 2007	Maxima	
2005 - 2006	Pathfinder	
2005 - 2006	Quest	
2007	Sentra	
2005 - 2007	Titan	
2005 - 2006	Xterra	
Chevrolet		
2014	Corvette	

SCHRADER 2014 TPMS APPLICATION GUIDE

NUMERICAL LISTING: Sensors/Transmitters

Part #	Year	Model	
20315 (315 MHz)	Ford		
	2012 - 2014	C-MAX	
	2010 - 2014	E Series Van	
	2010 - 2013	E350 Super Duty	
	2011 - 2014	Edge	
	2009 - 2014	Escape	
	2011 - 2014	Expedition	
	2011 - 2014	Explorer	
	2009 - 2014	F Series Pickup	
	2011 - 2014	Fiesta	
	2011 - 2014	Flex	
	2010 - 2014	Focus	
	2010 - 2014	Fusion	
	2010 - 2014	Mustang	
	2011 - 2014	Super Duty Pickup	
	2010 - 2011	Super Duty Van	
	2010 - 2014	Taurus	
	2010 - 2014	Transit Connect	
	20335 (315 MHz)	Lincoln	
		2009	Mark LT
2011 - 2014		MKS	
2011 - 2014		MKT	
2011 - 2014		MKX	
2010 - 2014		MKZ	
2011 - 2014		Navigator	
2011		Town Car	
Mazda			
2009 - 2011		Tribute	
20335 (315 MHz)	Mercury		
	2011	Grand Marquis	
	2009 - 2011	Mariner	
	2010 - 2011	Milan	
20335 (315 MHz)	Chrysler		
	2004 - 2005	Pacifica	
	2004 - 2005	Town & Country Van	
	Dodge		
2004 - 2005	Caravan		
2004 - 2005	Grand Caravan		
20398 (433 MHz)	Chrysler		
	2010 - 2014	300	
	2011 - 2014	Town & Country Van	
	Dodge		
	2010 - 2014	Challenger	
	2010 - 2014	Charger	
	2011 - 2014	Durango	
	2011 - 2014	Grand Caravan	
	2010 - 2014	Journey	
	2010 - 2011	Magnum	

Part #	Year	Model
20398 (433 MHz) (cont.)	Dodge (cont.)	
	2012	Ram 4500HD
	2012	Ram 5500HD
	2010 - 2013	Ram 1500
	2010 - 2013	Ram 2500
	Fiat	
	2011 - 2014	500
	2013 - 2014	500 Arbarth
	2013 - 2014	500c
	2013 - 2014	500e
2011 - 2014	500L	
20720 (433 MHz)	Jeep	
	2011 - 2014	Grand Cherokee
	2013 - 2014	Wrangler
28004 (315 MHz)	Mitsubishi	
	2011 - 2012	Lancer
28006 (315 MHz)	Acura	
	2009 - 2013	TL
28007 (433 MHz)	Chrysler	
	2010 - 2013	ZDX
28006 (315 MHz)	Chrysler	
	1997 - 2001	Prowler
28006 (315 MHz)	Chevrolet	
	1997 - 2000	Corvette
28078 (433 MHz)	Saab	
	2003 - 2007	9-3
	2003 - 2007	9-5
	Saturn	
2008 - 2009	Astra	
28081 (433 MHz)	BMW	
	2012	128i
	2012 - 2013	135i
	2013	135iS
	2010 - 2013	328i
	2010 - 2012	335D
	2010 - 2013	335i
	2012 - 2013	335iS
	2010	335xi
	2012 - 2013	528i
	2012 - 2014	535i
	2012 - 2013	550i
	2012 - 2014	640i
	2012 - 2014	650i
	2012 - 2013	740i
2012 - 2013	740Li	
2012 - 2013	750i	
2012 - 2013	750Li	
2012	ActiveE	

Part #	Year	Model
28081 (433 MHz) (cont.)	BMW (cont.)	
	2012	M1
	2010 - 2013	M3
	2013	M5
	2013 - 2014	M6
	2014	M6 Gran Coupe
	2012 - 2014	X1
	2012 - 2014	X3
	2012 - 2014	X5
	2012 - 2014	X6
2012 - 2014	Z4	
28082 (433 MHz)	Mini	
	2010 - 2013	Cooper
28087 (433 MHz)	BMW	
	2000 - 2004	X5
28087 (433 MHz)	Land Rover	
	2005	LR3
28087 (433 MHz)	Porsche	
	2002 - 2005	Range Rover
28087 (433 MHz)	Porsche	
	2010	911
	2010	Boxster
	2009 - 2010	Cayman
28096 (315 MHz)	Porsche	
	2010 - 2011	Panamera
28096 (315 MHz)	Mitsubishi	
	2008 - 2014	Lancer
28126 (433 MHz)	Mitsubishi	
	2007 - 2014	Outlander
28126 (433 MHz)	BMW	
	2014	328i
	2014	335i
28128 (315 MHz)	BMW	
	2014	335iS
28128 (315 MHz)	Acura	
	2014	MDX
	2013 - 2014	RDX
	Mitsubishi	
2006 - 2007	Eclipse	
2012	Eclipse	
2011 - 2012	Endeavor	
2007 - 2013	Galant	
28167 (315 MHz)	Nissan	
	2007	Pathfinder
	2007	Versa
28203 (315 MHz)	Nissan	
	2007	Xterra
	Subaru	
	2008 - 2014	Forester
	2008 - 2013	Impreza
	2008 - 2014	Legacy
	2008 - 2014	Outback
2008 - 2014	Tribeca	
2013	XV Crosstrek	

SCHRADER 2014 TPMS APPLICATION GUIDE

NUMERICAL LISTING: Sensors/Transmitters

Part #	Year	Model
28204 (315 MHz)	Infiniti	
	2007 - 2008	FX35
	2007 - 2008	FX45
	2007	G35
	2008 - 2012	M35
	2012	M35H
	2011 - 2012	M37
	2008 - 2010	M45
	2011 - 2012	M56
	2006	Q45
	2007 - 2008	QX56
	2009 - 2010	QX56
	Nissan	
	2007 - 2009	350Z
	2006 - 2012	Altima
	2008 - 2013	Armada
	2009 - 2010	Cube
	2011 - 2012	Cube (non-IKey)
	2008 - 2013	Frontier
	2009 - 2014	GT-R
	2011 - 2012	Juke (non-IKey)
	2007 - 2012	Maxima
	2007 - 2012	Murano
	2007 - 2012	Pathfinder
	2007 - 2009	Quest
	2008 - 2012	Rogue
	2007 - 2013	Sentra
	2007 - 2013	Titan
2007 - 2012	Versa	
2007 - 2013	Xterra	
Suzuki		
2009 - 2013	Equator	
Buick		
2010	Allure	
2013 - 2014	Encore	
2010 - 2014	Lacrosse	
2011 - 2014	Regal	
2012 - 2014	Verano	
Cadillac		
2013 - 2014	ATS	
2014	CTS	
2014	ELR	
2014	Escalade	
2010 - 2014	SRX	
2013 - 2014	XTS	

Part #	Year	Model
28206 (314.9 MHz) (cont.)	Chevrolet	
	2010 - 2014	Camaro
	2010	Cobalt
	2011 - 2014	Cruze
	2010 - 2014	Equinox
	2010	HHR
	2014	Impala
	2010	Malibu
	2013 - 2014	Malibu
	2012	Orlando
	2014	Silverado Series Pickup
	2012 - 2014	Sonic
	2013 - 2014	Spark
	2014	Spark EV
	2014	Suburban
	2014	Tahoe
	2011 - 2014	Volt
	GMC	
	2010 - 2014	Terrain
	2014	Yukon
Saab		
2011 - 2012	9-4X	
Saturn		
2010	Astra	
Infiniti		
2008 - 2010	EX35	
2009 - 2010	FX35	
2009 - 2010	FX50	
2007 - 2008	G35	
2008 - 2010	G37	
Nissan		
2009 - 2010	370Z	
Mercedes-Benz		
2012 - 2013	C250	
2007	C280	
2008 - 2012	C300	
2013	C300	
2007 - 2013	C350	
2008 - 2013	C63	
2010 - 2013	CL550	
2010 - 2013	CL600	
2010 - 2013	CL63	
2010 - 2013	CL65	
2006 - 2009	CLK350	
2006	CLK500	
2006	CLK55	
2007 - 2009	CLK550	
28210 (315 MHz)	Infiniti	
	2008 - 2010	EX35
	2009 - 2010	FX35
	2009 - 2010	FX50
	2007 - 2008	G35
	2008 - 2010	G37
	Nissan	
	2009 - 2010	370Z
	Mercedes-Benz	
	2012 - 2013	C250
2007	C280	
2008 - 2012	C300	
2013	C300	
2007 - 2013	C350	
2008 - 2013	C63	
2010 - 2013	CL550	
2010 - 2013	CL600	
2010 - 2013	CL63	
2010 - 2013	CL65	
2006 - 2009	CLK350	
2006	CLK500	
2006	CLK55	
2007 - 2009	CLK550	

Part #	Year	Model
28214 (433 MHz) (cont.)	Mercedes-Benz (cont.)	
	2007 - 2009	CLK63
	2012 - 2013	CLS550
	2012 - 2013	CLS63
	2010 - 2013	E350
	2010 - 2013	E550
	2010 - 2013	E63
	2007 - 2008	G500
	2007 - 2011	G55
	2009 - 2013	G550
	2010 - 2013	GL350
	2010 - 2013	GL450
	2010 - 2013	GL550
	2013	GL63
	2010 - 2013	GLK350
	2010 - 2013	ML350
	2010 - 2011	ML450
	2010 - 2011	ML550
	2010 - 2013	ML63
	2010 - 2013	R350
	2012 - 2013	S350
	2011 - 2013	S400
	2011 - 2013	S550
	2011 - 2013	S600
	2011 - 2013	S63
	2011 - 2013	S65
	2012 - 2013	SL550
	2012 - 2013	SL63
	2012 - 2013	SLK250
	2007 - 2009	SLK280
	2010 - 2011	SLK300
	2007 - 2013	SLK350
	2007 - 2010	SLK55
	2011 - 2013	SLS
	Smart	
	2008 - 2013	Fortwo
	Chrysler	
	2009 - 2010	300
	Dodge	
	2008 - 2012	Challenger
2009 - 2010	Charger	
2009	Magnum	
Toyota		
2004 - 2007	Sequoia	
2005	Tacoma	
2005 - 2006	Tundra	

SCHRADER 2014 TPMS APPLICATION GUIDE

NUMERICAL LISTING: Sensors/Transmitters

Part #	Year	Model
28305 (315 MHz)	Toyota	
	2004 - 2007	Sequoia
	2005	Tacoma
	2005 - 2006	Tundra
28308 (315 MHz)	Chrysler	
	2011 - 2014	200
	2005 - 2007	300
	2007 - 2009	Aspen
	2005	Crossfire
	2006 - 2008	Pacifica
	2008 - 2010	PT Cruiser
	2007 - 2010	Sebring
	2006 - 2008	Town & Country Van
	Dodge	
	2008 - 2014	Avenger
	2007 - 2012	Caliber
	2006 - 2007	Caravan
	2005 - 2007	Charger
	2011	Dakota
	2007 - 2010	Durango
	2006 - 2007	Grand Caravan
	2005 - 2007	Magnum
	2007 - 2012	Nitro
Jeep		
2006 - 2007	Commander	
2007 - 2014	Compass	
2005 - 2007	Grand Cherokee	
2005 - 2012	Liberty	
2007 - 2014	Patriot	
2007 - 2008	Wrangler	
2011 - 2012	Wrangler	
Suzuki		
2010 - 2012	Kizashi	
Lexus		
2002 - 2006	SC430	
Lexus		
2002 - 2006	SC430	
Lexus		
2002 - 2006	SC430	
Lexus		
2002 - 2006	SC430	

Part #	Year	Model
28335 (315 MHz)	Lexus	
	2006	GS300
	2005 - 2006	GS430
	2006	GX470
	2006	IS250
	2006	IS350
28342 (315 MHz)	Toyota	
	2006	4 Runner
28345 (315 MHz)	Nissan	
	2011 - 2013	NV
	2013	NV-200
28355 (315 MHz)	Lexus	
	2004 - 2006	GX470
28360 (315 MHz)	Toyota	
	2010 - 2012	HS250h
28362 (315 MHz)	Toyota	
	2003 - 2006	4 Runner
	Toyota	
	2005 - 2006	Tacoma
	Pontiac	
	2008 - 2010	Vibe
	Scion	
	2013	FR-S
	Subaru	
	2013 - 2014	BRZ
28365 (315 MHz)	Toyota	
	2006 - 2013	Avalon
	2007 - 2011	Camry (USA Mfg.)
	2007 - 2013	Corolla
	2011 - 2013	Highlander
	2007 - 2013	Matrix
	2012	RAV4 E
	2006 - 2011	Solara
	2006 - 2013	Tacoma
	2009 - 2013	Venza
2013	Yaris	
Volvo		
2012 - 2013	XC90	
Lexus		
2006	GX470	
2005 - 2006	LX470	
2006	LX470	
Scion		
2011 - 2013	iQ	
2006 - 2014	tC	
2007 - 2013	xB	
2008 - 2013	xD	

Part #	Year	Model
28365 (315 MHz) (cont.)	Toyota	
	2006 - 2009	4 Runner
	2007 - 2011	Camry (Japan Mfg.)
	2008 - 2011	Camry Hybrid
	2007 - 2013	Corolla
	2008 - 2013	FJ Cruiser
	2007 - 2010	Highlander
	2008 - 2010	Highlander Hybrid
	2005 - 2013	Land Cruiser
	2007 - 2013	Matrix
	2005 - 2013	Prius
	2012	Prius V
	2006	RAV4
	2007 - 2012	Yaris
	Lexus	
2011 - 2013	CT200h	
2013 - 2014	ES300h	
2007 - 2014	ES350	
2007 - 2011	GS350	
2006 - 2007	GS430	
2007 - 2013	GS450h	
2008 - 2012	GS460	
2013	GX460	
2007 - 2009	GX470	
2006 - 2012	IS C	
2006 - 2013	IS F	
2006 - 2013	IS250	
2006 - 2013	IS300H	
2006 - 2014	IS350	
2011 - 2013	LFA	
2007 - 2013	LS460	
2008 - 2013	LS600h	
2006 - 2007	LX470	
2008 - 2014	LX570	
2006	RX330	
2007 - 2013	RX350	
2006 - 2012	RX400h	
2010 - 2014	RX450h	
2013	RXF Sport	
2006 - 2010	SC430	
Toyota		
2006 - 2013	4 Runner	
2009 - 2012	Corolla	
2007 - 2013	RAV4	

SCHRADER 2014 TPMS APPLICATION GUIDE

NUMERICAL LISTING: Sensors/Transmitters

Part #	Year	Model
28380 (315 MHz)	Toyota	
	2005 - 2013	Tacoma
	Ford	
	2006 - 2011	Crown Victoria
	2007	E Series Van
	2007 - 2008	Edge
	2005 - 2008	Escape
	2006 - 2010	Explorer
	2006 - 2010	Explorer Sport Trac
	2007 - 2008	F Series Pickup
	2007	Focus
	2006 - 2007	Freestar
	2007 - 2009	Fusion
	2006 - 2011	Grand Marquis
	2007 - 2009	Mustang
	2007 - 2011	Ranger
	Lincoln	
	2007 - 2008	Mark LT
	2007 - 2008	MKX
2007 - 2009	MKZ	
2006 - 2010	Town Car	
Mazda		
2007 - 2009	B2300 Pickup	
2007 - 2008	B3000 Pickup	
2007 - 2009	B4000 Pickup	
2006	Tribute	
2008	Tribute	
Mercury		
2006 - 2010	Grand Marquis	
2005 - 2008	Mariner	
2007 - 2009	Milan	
2006 - 2007	Monterey Van	
2006 - 2010	Mountaineer	
Ford		
2007 - 2010	Edge	
2007 - 2010	Expedition	
2006 - 2007	Five Hundred	
2009 - 2010	Flex	
2008 - 2009	Focus	
2008 - 2010	Taurus	
2008 - 2009	Taurus X	
Lincoln		
2009 - 2010	MKS	
2010	MKT	
2007 - 2010	MKX	
2007 - 2010	Navigator	

Part #	Year	Model
28390 (315 MHz) (cont.)	Mercury	
	2006 - 2007	Montego
	2008 - 2009	Sable
28395 (315 MHz)	Ford	
	2008 - 2010	E Series Van
	2007 - 2009	E350 Super Duty
	2008	F Series Pickup
	2008 - 2010	F450 Super Duty
	2010	F550 Super Duty
	2008 - 2010	Super Duty Pickup
	2008 - 2010	Super Duty Van
	Cadillac	
	2014	ATS-V
2014	CTS - V	
Chevrolet		
2012 - 2014	Camaro - ZL1	
2014	SS	
Chrysler		
2007 - 2008	300	
2008 - 2010	Town & Country Van	
Dodge		
2008	Challenger	
2008	Charger	
2008 - 2010	Grand Caravan	
2009 - 2010	Journey	
2008	Magnum	
2009 - 2010	Ram 1500	
2009 - 2010	Ram 2500	
Jeep		
2008 - 2011	Commander	
2008 - 2010	Grand Cherokee	
2009	Liberty	
2009 - 2010	Wrangler	
Dodge		
2008 - 2010	Dakota	
2008	Ram 1500	
2008	Ram 2500	
Mitsubishi		
2008 - 2009	Raider	
Hyundai		
2012 - 2013	Veloster	
Dodge		
2012 - 2014	Dart	
Toyota		
2008 - 2013	Sequoia	
2006 - 2013	Sienna	
2006 - 2013	Tundra	

Part #	Year	Model
28720 (315 MHz)	Acura	
	2008 - 2011	CSX
	Honda	
	2008 - 2014	Civic
	2011 - 2014	CR-Z
	2009 - 2011	Element
	2009 - 2013	Fit
	2010 - 2014	Insight
	2011 - 2014	Odyssey
	Hyundai	
2008 - 2011	Accent	
2011 - 2013	Equus	
2011 - 2012	Genesis	
2009 - 2010	Sonata	
2010 - 2013	Tucson	
Kia		
2009 - 2011	Borrego	
2007 - 2011	Rio	
2006 - 2009	Spectra	
2009 - 2013	Sportage	
Acura		
2004 - 2006	MDX	
2005 - 2012	RL	
2005 - 2008	TL	
Honda		
2005 - 2007	Odyssey	
2005 - 2008	Pilot	
2006 - 2014	Ridgeline	
Honda		
2005	Pilot	
2006 - 2008	Ridgeline	
Honda		
2009 - 2010	Odyssey	
Hyundai		
2007 - 2008	Sonata	
2007 - 2008	Tiburon	
2006 - 2009	Tucson	
Kia		
2007 - 2009	Amanti	
2007 - 2009	Sorento	
2005 - 2008	Sportage	
Dodge		
2014	Ram 1500	
2014	Ram 2500	
2014	Ram 3500 SRW	
Jeep		
2014	Cherokee	

Application guides subject to change without notice. Please refer to the manufacturer's websites for the most up-to-date application data.

SCHRADER 2014 TPMS APPLICATION GUIDE

NUMERICAL LISTING: Service Packs

Part #	Year	Model
20002	Ford	
	2003 - 2006	Expedition
	2002 - 2005	Explorer
	2004 - 2005	Freestar
	Lincoln	
	2003 - 2005	Aviator
	2003 - 2006	Navigator
	Mercury	
	2004 - 2005	Monterey Van
	2002 - 2005	Mountaineer
	Cadillac	
	2001 - 2005	Deville
	2001 - 2004	Seville
	Chevrolet	
	2001 - 2004	Corvette
	2001 - 2004	Corvette C5
2001 - 2004	Corvette Z06	
Chrysler		
2002 - 2004	300M	
2002 - 2004	Concorde	
2004 - 2008	Crossfire	
2002 - 2004	Intrepid	
2003 - 2004	Pacifica	
2001 - 2002	Prowler	
2002 - 2003	Town & Country Van	
2002 - 2003	Voyager	
Dodge		
2002 - 2003	Caravan	
2002 - 2003	Grand Caravan	
2002 - 2004	Intrepid	
2003 - 2011	Viper	
Isuzu		
2004	Rodeo	
Jeep		
2002 - 2004	Grand Cherokee	
2002 - 2004	Liberty	
Mitsubishi		
2006 - 2012	Eclipse	
2004 - 2012	Endeavor	
2004 - 2013	Galant	
2003 - 2006	Montero	
Plymouth		
1997	Prowler	
1999 - 2002	Prowler	
Volvo		
2007 - 2013	C30	
2007 - 2013	C70	
2007 - 2013	S40	
2011 - 2013	S60	
2007 - 2013	S80	

Part #	Year	Model
20003 (cont.)	Volvo (cont.)	
	2005 - 2011	V50
	2008 - 2010	V70
	2009 - 2013	XC60
	2008 - 2013	XC70
	Buick	
	2007 - 2008	Allure
	2008	Enclave
	2007 - 2008	Lacrosse
	2006 - 2007	Rainier
Cadillac		
2014	ATS-V	
2004 - 2013	CTS	
2009 - 2014	CTS - V	
2006	DTS	
2004 - 2006	Escalade	
2004 - 2006	SRX	
2005 - 2008	STS	
2004 - 2009	XLR	
Chevrolet		
2004 - 2006	Avalanche	
2012 - 2014	Camaro ZL1	
2011 - 2013	Caprice	
2008 - 2009	Cobalt	
2005 - 2013	Corvette	
2006 - 2013	Corvette	
2005 - 2009	Corvette C6	
2005 - 2012	Corvette Z06	
2007 - 2009	Equinox	
2008 - 2009	Express	
2008 - 2009	HHR	
2006 - 2007	Impala	
2008	Malibu	
2006 - 2007	Monte Carlo	
2004 - 2007	Silverado Series Pickup	
2014	SS	
2006	SSR	
2004 - 2006	Suburban	
2004 - 2006	Tahoe	
2006 - 2009	Trailblazer	
2008 - 2009	Uplander	
GMC		
2007 - 2008	Acadia	
2006 - 2009	Envoy	
2008 - 2009	Savana	
2004 - 2007	Sierra Series Pickup	
2004 - 2006	Yukon	
Isuzu		
2006 - 2008	Ascender	

Part #	Year	Model
20004 (cont.)	Pontiac	
	2008	G5
	2008	G6
	2007 - 2008	Grand Prix
	2008 - 2009	Montana
	2008 - 2010	Solstice
	2007 - 2009	Torrent
	Saab	
	2005 - 2009	9-7X
	Saturn	
	2007	Aura
	2008 - 2009	Lambda
2007 - 2008	Outlook	
2008 - 2010	Sky	
Suzuki		
2007 - 2011	XL-7	
Infiniti		
2004 - 2006	QX56	
2005 - 2006	Armada	
Nissan		
2005 - 2007	Frontier	
2004	Pathfinder	
2004 - 2006	Quest	
2004 - 2005	Titan	
2006	Xterra	
Chevrolet		
2007 - 2012	Colorado	
GMC		
2007 - 2012	Canyon	
Hummer		
2006 - 2010	H3	
2006 - 2010	H3T	
Isuzu		
2007 - 2009	I-290	
2007 - 2009	I-370	
Infiniti		
2003 - 2007	FX35	
2003 - 2007	FX45	
2003 - 2006	G35	
2007	M35	
2003 - 2004	M45	
2006 - 2007	M45	
2003 - 2006	Q45	
2003	QX4	
2005 - 2007	QX56	
Nissan		
2003 - 2006	350Z	
2005 - 2008	Armada	
2003 - 2008	Frontier	
2006 - 2007	Maxima	

SCHRADER 2014 TPMS APPLICATION GUIDE

NUMERICAL LISTING: Service Packs

Part #	Year	Model
20007 (cont.)	Nissan (cont.)	
	2003 - 2006	Murano
	2003 - 2006	Pathfinder
	2005 - 2006	Quest
	2007	Sentra
	2005 - 2007	Titan
	2003 - 2006	Xterra
20008	Buick	
	2009 - 2010	Allure
	2010	Allure
	2009 - 2014	Enclave
	2013 - 2014	Encore
	2009 - 2014	Lacrosse
	2007	LeSabre
	2007 - 2011	Lucerne
	2011 - 2014	Regal
	2012 - 2014	Verano
	Cadillac	
	2013 - 2014	ATS
	2008 - 2014	CTS
	2007 - 2011	DTS
	2014	ELR
	2007 - 2014	Escalade
	2007 - 2014	SRX
	2009 - 2011	STS
	2013 - 2014	XTS
	Chevrolet	
	2007 - 2013	Avalanche
	2007 - 2012	Aveo
	2010 - 2014	Camaro
	2012 - 2013	Captiva
	2008 - 2010	Cobalt
	2011 - 2014	Cruze
	2010 - 2014	Equinox
	2010 - 2014	Express
	2008 - 2011	HHR
	2007 - 2014	Impala
	2008 - 2014	Malibu
	2007	Monte Carlo
2012	Orlando	
2007 - 2014	Silverado Series Pickup	
2012 - 2014	Sonic	
2013 - 2014	Spark	
2014	Spark EV	
2007 - 2014	Suburban	
2007 - 2014	Tahoe	
2009 - 2014	Traverse	
2011 - 2014	Volt	
Dodge		
2011	Dakota	

Part #	Year	Model
20008 (cont.)	GMC	
	2009 - 2014	Acadia
	2010 - 2014	Savana
	2007 - 2014	Sierra Series Pickup
	2010 - 2014	Terrain
	2007 - 2014	Yukon
	Hummer	
	2008 - 2010	H2
	Hyundai	
	2012 - 2013	Veloster
	Mitsubishi	
	2012	Lancer
	Pontiac	
	2009 - 2010	G3
	2009	G3 Wave
	2009 - 2010	G5
	2009 - 2010	G6
	2008 - 2010	G8
	2008	Grand Prix
	2008 - 2009	Wave
	Saab	
	2011 - 2012	9-4X
	Saturn	
	2010	Astra
	2008 - 2010	Aura
	2009 - 2010	Outlook
2007 - 2010	VUE	
Subaru		
2008 - 2014	Forester	
2008 - 2013	Impreza	
2008 - 2014	Legacy	
2008 - 2014	Outback	
2008 - 2014	Tribeca	
2013	XV Crosstrek	
Suzuki		
2007 - 2008	Forenza	
2007 - 2008	Reno	
Volvo		
2012 - 2013	XC90	
Saab		
2003 - 2012	9-3	
2003 - 2012	9-5	
Saturn		
2008 - 2009	Astra	
Suzuki		
2007 - 2013	Grand Vitara	
2007 - 2013	SX4	
2005 - 2006	Verona	
2005 - 2006	XL-7	
Mitsubishi		
2006 - 2007	Eclipse	
2011 - 2012	Endeavor	
2007 - 2013	Galant	

Part #	Year	Model
20010 (cont.)	Volvo	
	2004 - 2009	S60
	2004 - 2006	S80
	2004 - 2007	V70
	2004 - 2007	XC70
2004 - 2011	XC90	
20011	Subaru	
	2006 - 2011	B9 Tribeca
	2004 - 2008	Legacy
	2004 - 2007	Outback
2008 - 2009	Tribeca	
20012	Chevrolet	
	1997 - 2000	Corvette
	Chrysler	
	2001	Prowler
	Plymouth	
	1997	Prowler
	1999 - 2001	Prowler
Chrysler		
2011 - 2012	200	
2005 - 2008	300	
2007 - 2009	Aspen	
2005	Crossfire	
2006 - 2008	Pacifica	
2008 - 2010	PT Cruiser	
2007 - 2010	Sebring	
2006 - 2010	Town & Country Van	
20013	Dodge	
	2008 - 2012	Avenger
	2007 - 2012	Caliber
	2006 - 2007	Caravan
	2005 - 2008	Charger
	2008 - 2010	Dakota
	2007 - 2010	Durango
	2006 - 2010	Grand Caravan
	2009 - 2010	Journey
	2005 - 2009	Magnum
	2007 - 2012	Nitro
	2008 - 2010	Ram Series Pickup
	2007	Stratus
	2006 - 2011	Commander
	2007 - 2011	Compass
	2005 - 2010	Grand Cherokee
2005 - 2012	Liberty	
2007 - 2012	Patriot	
2007 - 2011	Wrangler	
2008 - 2009	Raider	
Suzuki		
2010 - 2012	Kizashi	
20014	Infiniti	
	2008 - 2010	EX35
	2007 - 2010	FX35
	2007 - 2008	FX45
2009 - 2010	FX50	

■ NUMERICAL LISTING: Service Packs

SCHRADER 2014 TPMS APPLICATION GUIDE

Part #	Year	Model
20014 (cont.)	Infiniti (cont.)	
	2007 - 2008	G35
	2008 - 2010	G37
	2008 - 2012	M35
	2012	M35H
	2011 - 2012	M37
	2008 - 2010	M45
	2011 - 2012	M56
	2006	Q45
	2007 - 2010	QX56
	Nissan	
	2007 - 2009	350Z
	2009 - 2010	370Z
	2006 - 2012	Altima
	2008 - 2013	Armada
	2009 - 2010	Cube
	2011 - 2012	Cube (non-IKey)
	2008 - 2013	Frontier
	2009 - 2014	GT-R
	2011 - 2012	Juke (non-IKey)
	2007 - 2012	Maxima
	2007	Murano
	2009 - 2012	Murano
	2011 - 2013	NV
	2013	NV-200
	2007 - 2012	Pathfinder
	2007 - 2009	Quest
	2008 - 2009	Rogue
	2011 - 2012	Rogue
	2007 - 2013	Sentra
	2007 - 2013	Titan
	2007 - 2012	Versa
2007 - 2013	Xterra	
Suzuki		
2009 - 2013	Equator	
Cadillac		
2007	Escalade	
Chevrolet		
2007	Avalanche	
2007	Silverado Series Pickup	
2007	Suburban	
2007	Tahoe	
GMC		
2007	Sierra Series Pickup	
2007	Yukon	
Chrysler		
2009 - 2010	300	
2012	300	
Dodge		
2008 - 2012	Challenger	
2009 - 2010	Charger	
2009	Magnum	

Part #	Year	Model
20016 (cont.)	Mercedes-Benz	
	2012 - 2013	C250
	2007	C280
	2008 - 2013	C300
	2007 - 2013	C350
	2008 - 2013	C63
	2010 - 2013	CL550
	2010 - 2013	CL600
	2010 - 2013	CL63
	2010 - 2013	CL65
	2006 - 2009	CLK350
	2006	CLK500
	2006	CLK55
	2007 - 2009	CLK550
	2007 - 2009	CLK63
	2012 - 2013	CLS550
	2012 - 2013	CLS63
	2010 - 2013	E350
	2010 - 2013	E550
	2010 - 2013	E63
	2007 - 2008	G500
	2007 - 2011	G55
	2009 - 2013	G550
	2010 - 2013	GL350
	2010 - 2013	GL450
	2010 - 2013	GL550
	2013	GL63
	2010 - 2013	GLK350
	2010 - 2013	ML350
	2010 - 2011	ML450
	2010 - 2011	ML550
	2010 - 2013	ML63
	2010 - 2013	R350
	2012 - 2013	S350
	2011 - 2013	S400
	2011 - 2013	S550
	2011 - 2013	S600
	2011 - 2013	S63
	2011 - 2013	S65
	2012 - 2013	SL550
	2012 - 2013	SL63
	2012 - 2013	SLK250
	2007 - 2008	SLK280
	2009 - 2011	SLK300
	2007 - 2013	SLK350
	2007 - 2010	SLK55
	2011 - 2013	SLS
	2012 - 2013	SLS
	Smart	
	2008 - 2013	Fortwo

Part #	Year	Model
20017	Audi	
	2008 - 2012	A3
	2009 - 2012	A4
	2008 - 2012	A5
	2009 - 2012	Q5
	2010 - 2011	S4
	2008 - 2012	S5
	2008 - 2011	TT
	Volkswagen	
	2008 - 2010	Beetle
	2009 - 2012	CC
	2007 - 2013	Eos
	2008 - 2009	GLI
	2006 - 2010	Golf
	2006 - 2010	GTI
	2006 - 2010	Jetta
	2006 - 2010	Passat
	2008	R32
	2006 - 2009	Rabbit
	2009 - 2012	Tiguan
Chrysler		
2012 - 2014	200	
2011 - 2014	300	
2011 - 2014	Town & Country Van	
Dodge		
2013 - 2014	Avenger	
2010 - 2014	Challenger	
2010 - 2014	Charger	
2011 - 2014	Durango	
2011 - 2014	Grand Caravan	
2010 - 2014	Journey	
2010 - 2011	Magnum	
2012	Ram 4500HD	
2012	Ram 5500HD	
2010 - 2013	Ram Series Pickup	
Fiat		
2011 - 2014	500	
2013 - 2014	500 Arbarth	
2013 - 2014	500c	
2013 - 2014	500e	
2011 - 2014	500L	
Ford		
2012 - 2014	C-MAX	
2010 - 2014	E Series Van	
2010 - 2013	E350 Super Duty	
2011 - 2014	Edge	
2009 - 2014	Escape	
2012 - 2014	Expedition	
2012 - 2014	Explorer	
2009 - 2014	F Series Pickup	

SCHRADER 2014 TPMS APPLICATION GUIDE

NUMERICAL LISTING: Service Packs

Part #	Year	Model
20018 (cont.)	Ford (cont.)	
	2011 - 2014	Fiesta
	2011 - 2014	Flex
	2010 - 2014	Focus
	2010 - 2014	Fusion
	2010 - 2014	Mustang
	2012 - 2014	Super Duty Pickup
	2010	Super Duty Van
	2010 - 2014	Taurus
	2014	Transit
	2010 - 2014	Transit Connect
	Jeep	
	2006 - 2011	Commander
	2007 - 2014	Compass
	2005 - 2014	Grand Cherokee
2010 - 2012	Liberty	
2012 - 2014	Patriot	
2012 - 2014	Wrangler	
Lincoln		
2011 - 2014	MKS	
2011 - 2014	MKT	
2011 - 2014	MKX	
2010 - 2014	MKZ	
2011 - 2014	Navigator	
2011	Town Car	
Mazda		
2009 - 2010	Tribute	
Mercury		
2009 - 2011	Mariner	
2010 - 2011	Milan	
Acura		
2008 - 2011	CSX	
2009 - 2013	TL	
2010 - 2013	ZDX	
Honda		
2008 - 2014	Civic	
2011 - 2014	CR-Z	
2009 - 2011	Element	
2009 - 2013	Fit	
2010 - 2014	Insight	
2011 - 2014	Odyssey	
Hyundai		
2010 - 2013	Elantra	
Kia		
2012 - 2013	Rio	
Chrysler		
2011 - 2012	200	
2005 - 2012	300	
2007 - 2009	Aspen	
2005	Crossfire	
2006 - 2008	Pacifica	
2008 - 2010	PT Cruiser	
2007 - 2010	Sebring	
2006 - 2010	Town & Country Van	

Part #	Year	Model
20020 (cont.)	Dodge	
	2008 - 2012	Avenger
	2007 - 2012	Caliber
	2006 - 2007	Caravan
	2008 - 2012	Challenger
	2005 - 2010	Charger
	2008 - 2010	Dakota
	2007 - 2010	Durango
	2006 - 2010	Grand Caravan
	2009 - 2010	Journey
	2005 - 2008	Magnum
	2007 - 2012	Nitro
	2008 - 2010	Ram Series Pickup
	2007	Stratus
	Jeep	
2006 - 2011	Commander	
2007 - 2011	Compass	
2005 - 2010	Grand Cherokee	
2005 - 2012	Liberty	
2007 - 2012	Patriot	
2007 - 2011	Wrangler	
Mercedes-Benz		
2012 - 2013	C250	
2007	C280	
2008 - 2013	C300	
2007 - 2013	C350	
2008 - 2013	C63	
2010 - 2013	CL550	
2010 - 2013	CL600	
2010 - 2013	CL63	
2010 - 2013	CL65	
2006 - 2009	CLK350	
2006	CLK500	
2006	CLK55	
2007 - 2009	CLK550	
2007 - 2009	CLK63	
2012 - 2013	CLS550	
2012 - 2013	CLS63	
2010 - 2013	E350	
2010 - 2013	E550	
2010 - 2013	E63	
2007 - 2008	G500	
2007 - 2011	G55	
2009 - 2013	G550	
2010 - 2013	GL350	
2010 - 2013	GL450	
2010 - 2013	GL550	
2013	GL63	
2010 - 2013	GLK350	
2010 - 2013	ML350	

Part #	Year	Model
20020 (cont.)	Mercedes-Benz (cont.)	
	2010 - 2011	ML450
	2010 - 2011	ML550
	2010 - 2013	ML63
	2010 - 2013	R350
	2012 - 2013	S350
	2011 - 2013	S400
	2011 - 2013	S550
	2011 - 2013	S600
	2011 - 2013	S63
	2011 - 2013	S65
	2012 - 2013	SL550
	2012 - 2013	SL63
	2012 - 2013	SLK250
	2007 - 2008	SLK280
2009 - 2011	SLK300	
2007 - 2013	SLK350	
2007 - 2010	SLK55	
2011 - 2013	SLS	
Mitsubishi		
2008 - 2009	Raider	
Smart		
2008 - 2013	Fortwo	
Suzuki		
2010 - 2012	Kizashi	
Hyundai		
2008 - 2011	Accent	
2011 - 2014	Equus	
2009	Genesis	
2011 - 2012	Genesis	
2009 - 2010	Sonata	
2010 - 2013	Tucson	
Kia		
2009 - 2011	Borrego	
2007 - 2011	Rio	
2006 - 2009	Spectra	
2009 - 2013	Sportage	
Toyota		
2008 - 2013	Sequoia	
2006 - 2013	Sienna	
2006 - 2013	Tundra	
Audi		
2002 - 2008	A4	
2005 - 2011	A6	
2001 - 2010	A8	
2001 - 2005	Allroad Quattro	
2007 - 2012	Q7	
2008 - 2014	R8	
2007 - 2008	RS4	
2004 - 2009	S4	
2007 - 2011	S6	
2001 - 2003	S8	
2007 - 2009	S8	

NUMERICAL LISTING: Service Packs

SCHRADER 2014 TPMS APPLICATION GUIDE

Part #	Year	Model
Bentley		
2007 - 2009	Azure	
2012 - 2014	Azure	
2003 - 2010	Continental	
2004 - 2010	Continental	
2012 - 2014	Continental	
2011 - 2014	Mulsanne	
BMW		
2008 - 2012	128I	
2008 - 2013	135I	
2013	135IS	
2001 - 2005	320I	
2000	323CI	
2000	323I	
2006 - 2010	323I	
2001 - 2006	325CI	
2001 - 2006	325I	
2001 - 2006	325XI	
2000	328CI	
2000	328I	
2007 - 2014	328I	
2007 - 2008	328XI	
2001 - 2006	330CI	
2001 - 2006	330I	
2001 - 2006	330XI	
2009 - 2012	335D	
2007 - 2014	335I	
2012 - 2014	335IS	
2007 - 2010	335XI	
2001 - 2007	525I	
2006 - 2007	525XI	
1997 - 2000	528I	
2008 - 2013	528I	
2008 - 2009	528XI	
2001 - 2007	530I	
2006 - 2007	530XI	
2008 - 2014	535I	
2008	535XI	
2010	535XI	
1997 - 2003	540I	
2004 - 2013	545I	
2012 - 2014	640I	
2004 - 2005	645CI	
2006 - 2010	650I	
2012 - 2014	650I	
1997 - 2001	740I	
2011 - 2013	740I	
1997 - 2001	740IL	
2011 - 2013	740LI	
2002 - 2005	745I	
2002 - 2005	745LI	

Part #	Year	Model
BMW (cont.)		
2006 - 2013	750I	
1997 - 2001	750IL	
2006 - 2013	750LI	
2004 - 2006	760I	
2003 - 2008	760LI	
2010 - 2011	760LI	
2007 - 2008	Alpina B7	
2011	Alpina B7	
2012	M1	
2001 - 2006	M3	
2008 - 2013	M3	
2000 - 2003	M5	
2006 - 2010	M5	
2013	M5	
2006 - 2010	M6	
2013 - 2014	M6	
2014	M6 Gran Coupe	
2012 - 2014	X1	
2006 - 2014	X3	
2000 - 2014	X5	
2008 - 2014	X6	
2000 - 2002	Z3	
2003 - 2014	Z4	
2000 - 2003	Z8	
Bugatti		
2006	Veyron	
Ferrari		
2001 - 2002	550 Maranello	
2002 - 2005	575M Maranello	
2004 - 2009	612 Scaglietti	
2003 - 2004	Enzo	
2005 - 2009	F430	
Land Rover		
2005	LR3	
2002 - 2005	Range Rover	
Maserati		
2004 - 2006	Coupe	
2004 - 2006	Gransport	
2006	MC12	
2004 - 2006	Quattroporte	
2004 - 2006	Spyder	
Mercedes-Benz		
2000 - 2006	CL500	
2001 - 2006	CL55	
2001 - 2006	CL600	
2005 - 2006	CL65	
2001 - 2005	E320	
2001 - 2002	E430	
2003 - 2005	E500	
1999 - 2005	E55	
2008	R550	

Part #	Year	Model
Mercedes-Benz (cont.)		
2006	S350	
2000 - 2006	S430	
2000 - 2006	S500	
2001 - 2006	S55	
2001 - 2006	S600	
2001 - 2005	SL500	
2003 - 2005	SL55	
2001 - 2005	SL600	
2005	SL65	
2004 - 2007	SLR McLaren	
Mini		
2008 - 2013	Cooper	
Porsche		
2005 - 2011	911	
2005 - 2011	Boxster	
2004 - 2006	Carrera GT	
2003 - 2006	Cayenne	
2008 - 2010	Cayenne	
2006 - 2011	Cayman	
Rolls-Royce		
2007 - 2010	Phantom	
Volkswagen		
2004 - 2006	Phaeton	
2004 - 2007	Touareg	
2011 - 2013	Touareg	
2008 - 2012	Touareg 2	
Buick		
2007 - 2008	Allure	
2008	Enclave	
2007 - 2008	Lacrosse	
Chevrolet		
2007 - 2009	Equinox	
2008 - 2009	Express	
Chrysler		
2005 - 2008	300	
2002 - 2004	300M	
2007 - 2009	Aspen	
2002 - 2004	Concorde	
2004 - 2008	Crossfire	
2002 - 2004	Intrepid	
2004 - 2008	Pacifica	
2002	Prowler	
2008 - 2010	PT Cruiser	
2007 - 2009	Sebring	
2004 - 2010	Town & Country Van	
Dodge		
2008 - 2009	Avenger	
2007 - 2010	Caliber	
2004 - 2007	Caravan	
2005 - 2008	Charger	
2007 - 2008	Durango	
2004 - 2010	Grand Caravan	

SCHRADER 2014 TPMS APPLICATION GUIDE

NUMERICAL LISTING: Service Packs

Part #	Year	Model
Dodge (cont.)		
2009 - 2010		Journey
2005 - 2009		Magnum
2007 - 2008		Nitro
GMC		
2007 - 2008		Acadia
2008 - 2009		Savana
Jaguar		
2008		S-Type
2005 - 2009		Super V8
2004 - 2009		Vanden Plas
2009 - 2012		XF
2010 - 2011		XFR
2010 - 2012		XJ
2004 - 2009		XJ8
2004 - 2009		XJR
2007 - 2012		XK
2007 - 2011		XKR
2008		X-Type
Jeep		
2006 - 2007		Commander
2007 - 2010		Compass
2005 - 2007		Grand Cherokee
2005 - 2008		Liberty
2007 - 2010		Patriot
2007 - 2008		Wrangler
Land Rover		
2012 - 2013		Evoque
2008 - 2013		LR2
2006 - 2009		LR3
2010 - 2013		LR4
2006 - 2013		Range Rover
Mazda		
2011 - 2013		2
2004 - 2013		3
2006 - 2013		5
2008 - 2013		6
2007 - 2011		CX-7
2007 - 2013		CX-9
2006 - 2012		MX-5 Miata
2004 - 2011		RX-8
2011		Tribute
Mitsubishi		
2008 - 2014		Lancer
2007 - 2014		Outlander
Plymouth		
2002		Prowler
Pontiac		
2008		G5
2008		G6
2007		Grand Prix
2008 - 2009		Montana
2008 - 2010		Solstice
2007 - 2009		Torrent

20030 (cont.)

Part #	Year	Model
Saturn		
2007		Aura
2007 - 2008		Outlook
2008 - 2010		Sky
Suzuki		
2010 - 2012		Kizashi
2007 - 2011		XL-7
Lexus		
2006		GS300
2005 - 2006		GS430
2004 - 2006		GX470
2006		IS250
2006		IS350
2005 - 2006		LX470
2006		RX330
Toyota		
2003 - 2006		4 Runner
2005 - 2006		Land Cruiser
2004 - 2007		Sequoia
2005 - 2006		Tacoma
2005 - 2006		Tundra
Honda		
2008 - 2012		Accord
2012 - 2014		Crosstour
2007 - 2013		CR-V
2008		Fit
2009 - 2014		Pilot
2008 - 2009		S2000
Lexus		
2011 - 2013		CT200h
2013 - 2014		ES300h
2007 - 2014		ES350
2007 - 2011		GS350
2006 - 2007		GS430
2007 - 2013		GS450h
2008 - 2013		GS460
2006 - 2009		GX470
2010 - 2012		HS250h
2006 - 2012		IS C
2008 - 2013		IS F
2006 - 2013		IS250
2006 - 2013		IS300H
2006 - 2014		IS350
2006 - 2013		IS F
2011 - 2013		LFA
2007 - 2013		LS460
2008 - 2013		LS600h
2006 - 2007		LX470
2008 - 2014		LX570
2006		RX330
2007 - 2013		RX350
2006 - 2012		RX400h
2010 - 2014		RX450h
2013		RXF Sport
2006 - 2010		SC430

20030 (cont.)

20031

20032

Part #	Year	Model
Nissan		
2010 - 2013		370Z
Pontiac		
2008 - 2010		Vibe
Scion		
2013		FR-S
2011 - 2013		iQ
2006 - 2014		tC
2007 - 2013		xB
2008 - 2013		xD
Subaru		
2013 - 2014		BRZ
Toyota		
2006 - 2013		4 Runner
2006 - 2013		Avalon
2007 - 2013		Camry
2008 - 2011		Camry Hybrid
2007 - 2013		Corolla
2008 - 2013		FJ Cruiser
2007 - 2013		Highlander
2008 - 2011		Highlander Hybrid
2006 - 2013		Land Cruiser
2007 - 2013		Matrix
2005 - 2013		Prius
2012		Prius V
2006 - 2013		RAV4
2012		RAV4 E
2006 - 2011		Solara
2006 - 2013		Tacoma
2009 - 2013		Venza
2007 - 2013		Yaris
Honda		
2005		Pilot
2006 - 2008		Ridgeline
Acura		
2004 - 2006		MDX
2005 - 2012		RL
2005 - 2008		TL
Dodge		
2007 - 2008		Sprinter
Honda		
2007 - 2008		Element
2005 - 2010		Odyssey
2005 - 2008		Pilot
2006 - 2014		Ridgeline
Hyundai		
2006 - 2013		Azera
2007 - 2010		Elantra
2007 - 2009		Entourage
2007 - 2010		Santa Fe
2007 - 2008		Sonata
2007 - 2008		Tiburon
2006 - 2009		Tucson
2007 - 2012		Veracruz

20032 (cont.)

20035

20036

■ NUMERICAL LISTING: Service Packs

SCHRADER 2014 TPMS APPLICATION GUIDE

Part #	Year	Model
20036 (cont.)	Kia	
	2007 - 2009	Amanti
	2008 - 2010	Magentis
	2006 - 2010	Optima
	2006 - 2011	Rondo
	2006 - 2013	Sedona
	2007 - 2009	Sorento
	2005 - 2008	Sportage
	Mercedes-Benz	
	2007 - 2009	CL550
	2007 - 2009	CL600
	2007 - 2009	CL63
	2008 - 2009	CL65
	2006	CLS500
	2006	CLS55
	2007 - 2011	CLS550
	2007 - 2011	CLS63
	2006 - 2009	E320
	2006 - 2009	E350
	2006	E500
	2006	E55
	2007 - 2009	E550
	2007 - 2009	E63
	2007 - 2009	GL320
	2007 - 2009	GL450
	2008 - 2009	GL550
	2007 - 2009	ML320
	2006 - 2009	ML350
	2006 - 2007	ML500
	2008 - 2009	ML550
	2007 - 2009	ML63
	2007 - 2009	R320
	2006 - 2009	R350
	2006 - 2007	R500
	2007	R63
	2010	S400
	2007 - 2010	S550
	2007 - 2010	S600
	2007 - 2010	S63
	2007 - 2010	S65
	2006	SL500
	2006 - 2008	SL55
	2007 - 2009	SL550
	2006 - 2009	SL600
	2009	SL63
2006 - 2009	SL65	
2008 - 2009	SLR McLaren	
20037	Audi	
	2002 - 2008	A4
	2005 - 2011	A6
	2001 - 2010	A8

Part #	Year	Model
20037	Audi (cont.)	
	2001 - 2005	Allroad Quattro
	2007 - 2012	Q7
	2008 - 2012	R8
	2014	R8
	2007 - 2008	RS4
	2004 - 2009	S4
	2007 - 2011	S6
	2001 - 2003	S8
	2007 - 2009	S8
	Bentley	
	2007 - 2009	Azure
	2012 - 2014	Azure
	2003 - 2014	Continental
	2011 - 2014	Mulsanne
	BMW	
	2008 - 2012	128i
	2008 - 2013	135i
	2013	135iS
	2001 - 2005	320i
	2000	323Ci
	2000	323i
	2006 - 2010	323i
	2001 - 2006	325Ci
	2001 - 2006	325i
	2001 - 2006	325Xi
	2000	328Ci
	2000	328i
	2007 - 2014	328i
	2007 - 2008	328Xi
	2001 - 2006	330Ci
	2001 - 2006	330i
	2001 - 2006	330Xi
	2009 - 2012	335D
	2007 - 2014	335i
	2012 - 2014	335iS
	2007 - 2008	335Xi
	2010	335Xi
	2001 - 2007	525i
	2006 - 2007	525Xi
	1997 - 2000	528i
	2008 - 2013	528i
	2008 - 2009	528Xi
	2001 - 2007	530i
	2006 - 2007	530Xi
	2008 - 2014	535i
	2008	535Xi
	2010	535Xi
	1997 - 2005	540i
	2006 - 2013	550i

Part #	Year	Model
20037	BMW (cont.)	
	2012 - 2014	640i
	2004 - 2005	645Ci
	2006 - 2014	650i
	1997 - 2001	740i
	2011 - 2013	740i
	1997 - 2001	740iL
	2011 - 2013	740Li
	2002 - 2005	745i
	2002 - 2005	745Li
	2006 - 2013	750i
	1997 - 2001	750iL
	2006 - 2013	750Li
	2004 - 2006	760i
	2003 - 2008	760Li
	2010 - 2011	760Li
	2007 - 2008	Alpina B7
	2011	Alpina B7
	2012	M1
	2001 - 2006	M3
	2008 - 2013	M3
	2000 - 2003	M5
	2006 - 2013	M5
	2006 - 2010	M6
	2013 - 2014	M6
	2014	M6 Gran Coupe
	2012 - 2014	X1
	2006 - 2014	X3
	2000 - 2014	X5
	2008 - 2014	X6
	2000 - 2002	Z3
	2003 - 2014	Z4
	2000 - 2003	Z8
	Bugatti	
	2006	Veyron
	Ferrari	
	2001 - 2002	550 Maranello
	2002 - 2005	575M Maranello
	2004 - 2009	612 Scaglietti
	2003 - 2004	Enzo
	2005 - 2009	F430
	Land Rover	
	2005	LR3
	2002 - 2005	Range Rover
	Maserati	
	2004 - 2006	Coupe
	2004 - 2006	Gransport
	2006	MC12
	2004 - 2006	Quattroporte
	2004 - 2006	Spyder

SCHRADER 2014 TPMS APPLICATION GUIDE

NUMERICAL LISTING: Service Packs

Part #	Year	Model
20037 (cont.)	Mercedes-Benz	
	2000 - 2006	CL500
	2001 - 2006	CL55
	2001 - 2006	CL600
	2005 - 2006	CL65
	2001 - 2005	E320
	2001 - 2002	E430
	2003 - 2005	E500
	1999 - 2005	E55
	2008	R550
	2006	S350
	2000 - 2006	S430
	2000 - 2006	S500
	2001 - 2006	S55
	2001 - 2005	S600
	2006	S600
	2006	S65
	2001 - 2005	SL500
	2003 - 2005	SL55
	2001 - 2002	SL600
	2004 - 2005	SL600
	2005	SL65
	2004 - 2007	SLR McLaren
	Mini	
	2008 - 2013	Cooper
	Porsche	
	2005 - 2011	911
	2005 - 2011	Boxster
	2004 - 2006	Carrera GT
	2003 - 2006	Cayenne
	2008 - 2014	Cayenne
	2006 - 2011	Cayman
	2010 - 2011	Panamera
	Rolls-Royce	
	2007 - 2010	Phantom
	Volkswagen	
	2004 - 2006	Phaeton
	2004 - 2007	Touareg
	2011 - 2013	Touareg
	2008 - 2012	Touareg 2
	Audi	
	2002 - 2008	A4
	2005 - 2011	A6
	2001 - 2010	A8
	2001 - 2005	Allroad Quattro
	2007 - 2012	Q7
	2008 - 2012	R8
	2014	R8
2007 - 2008	RS4	
2004 - 2009	S4	
2007 - 2011	S6	
2001 - 2003	S8	
2007 - 2009	S8	

Part #	Year	Model
20038 (cont.)	Bentley	
	2007 - 2009	Azure
	2012 - 2014	Azure
	2003 - 2014	Continental
	2011 - 2014	Mulsanne
	BMW	
	2008 - 2012	128i
	2008 - 2013	135i
	2013	135iS
	2001 - 2005	320i
	2000	323Ci
	2000	323i
	2006 - 2010	323i
	2001 - 2006	325Ci
	2001 - 2006	325i
	2001 - 2006	325Xi
	2000	328Ci
	2000	328i
	2007 - 2014	328i
	2007 - 2008	328Xi
	2001 - 2006	330Ci
	2001 - 2006	330i
	2001 - 2006	330Xi
	2009 - 2012	335D
	2007 - 2014	335i
	2012 - 2014	335iS
	2007 - 2008	335Xi
	2010	335Xi
	2001 - 2007	525i
	2006 - 2007	525Xi
	1997 - 2000	528i
	2008 - 2013	528i
	2008 - 2009	528Xi
	2001 - 2007	530i
	2006 - 2007	530Xi
	2008 - 2014	535i
	2008	535Xi
	2010	535Xi
	1997 - 2005	540i
	2006 - 2013	550i
	2012 - 2014	640i
	2004 - 2005	645Ci
	2006 - 2014	650i
	1997 - 2001	740i
	2011 - 2013	740i
	1997 - 2001	740iL
	2011 - 2013	740Li
	2002 - 2005	745i
2002 - 2005	745Li	
2006 - 2013	750i	
1997 - 2001	750iL	

Part #	Year	Model
20038 (cont.)	BMW	
	2006 - 2013	750Li
	2004 - 2006	760i
	2003 - 2008	760Li
	2010 - 2011	760Li
	2007 - 2008	Alpina B7
	2011	Alpina B7
	2012	M1
	2001 - 2006	M3
	2008 - 2013	M3
	2000 - 2003	M5
	2006 - 2013	M5
	2006 - 2010	M6
	2013 - 2014	M6
	2014	M6 Gran Coupe
	2012 - 2014	X1
	2006 - 2014	X3
	2000 - 2014	X5
	2008 - 2014	X6
	2000 - 2002	Z3
	2003 - 2014	Z4
	2000 - 2003	Z8
	Bugatti	
	2006	Veyron
	Ferrari	
	2001 - 2002	550 Maranello
	2002 - 2005	575M Maranello
	2004 - 2009	612 Scaglietti
	2003 - 2004	Enzo
	2005 - 2009	F430
	Land Rover	
	2005	LR3
	2002 - 2005	Range Rover
	Maserati	
	2004 - 2006	Coupe
	2004 - 2006	Gransport
	2006	MC12
	2004 - 2006	Quattroporte
	2004 - 2006	Spyder
	Mercedes-Benz	
	2000 - 2006	CL500
	2001 - 2006	CL55
	2001 - 2006	CL600
	2005 - 2006	CL65
	2001 - 2005	E320
	2001 - 2002	E430
	2003 - 2005	E500
	1999 - 2005	E55
2008	R550	
2006	S350	
2000 - 2006	S430	
2000 - 2006	S500	
2001 - 2006	S55	

■ NUMERICAL LISTING: Service Packs

SCHRADER 2014 TPMS APPLICATION GUIDE

Part #	Year	Model
20038 (cont.)	Mercedes-Benz (cont.)	
	2001 - 2005	S600
	2006	S600
	2006	S65
	2001 - 2005	SL500
	2003 - 2005	SL55
	2001 - 2002	SL600
	2004 - 2005	SL600
	2005	SL65
	2004 - 2007	SLR McLaren
	Mini	
	2008 - 2013	Cooper
	Porsche	
	2005 - 2011	911
	2005 - 2011	Boxster
2004 - 2006	Carrera GT	
2003 - 2006	Cayenne	
2008 - 2014	Cayenne	
2006 - 2011	Cayman	
2010 - 2011	Panamera	
Rolls-Royce		
2007 - 2010	Phantom	
Volkswagen		
2004 - 2006	Phaeton	
2004 - 2007	Touareg	
2011 - 2013	Touareg	
2008 - 2012	Touareg 2	
20039	Audi	
	2002 - 2008	A4
	2005 - 2011	A6
	2001 - 2010	A8
	2001 - 2005	Allroad Quattro
	2007 - 2012	Q7
	2008 - 2012	R8
	2014	R8
	2007 - 2008	RS4
	2004 - 2009	S4
	2007 - 2011	S6
	2001 - 2003	S8
	2007 - 2009	S8
	Bentley	
	2007 - 2009	Azure
	2012 - 2014	Azure
	2003 - 2014	Continental
	2011 - 2014	Mulsanne
	BMW	
	2008 - 2012	128i
	2008 - 2013	135i
	2013	135iS
	2001 - 2005	320i
	2000	323Ci
	2000	323i
2006 - 2010	323i	

Part #	Year	Model
20039 (cont.)	BMW (cont.)	
	2001 - 2006	325Ci
	2001 - 2006	325i
	2001 - 2006	325Xi
	2000	328Ci
	2000	328i
	2007 - 2014	328i
	2007 - 2008	328Xi
	2001 - 2006	330Ci
	2001 - 2006	330i
	2001 - 2006	330Xi
	2009-2012	335D
	2007 - 2014	335i
	2012 - 2014	335iS
	2007 - 2008	335Xi
	2010	335Xi
	2001 - 2007	525i
	2006 - 2007	525Xi
	1997 - 2000	528i
	2008 - 2013	528i
	2008 - 2009	528Xi
	2001 - 2007	530i
	2006 - 2007	530Xi
	2008 - 2014	535i
	2008	535Xi
	2010	535Xi
	1997 - 2005	540i
	2006 - 2013	550i
	2012 - 2014	640i
	2004 - 2005	645Ci
	2006 - 2014	650i
	1997 - 2001	740i
	2011 - 2013	740i
	1997 - 2001	740iL
	2011 - 2013	740Li
	2002 - 2005	745i
	2002 - 2005	745Li
	2006 - 2013	750i
	1997 - 2001	750iL
	2006 - 2013	750Li
	2004 - 2006	760i
	2003 - 2008	760Li
	2010 - 2011	760Li
	2007 - 2008	Alpina B7
	2011	Alpina B7
2012	M1	
2001 - 2006	M3	
2008 - 2013	M3	
2000 - 2003	M5	
2006 - 2013	M5	
2006 - 2010	M6	
2013 - 2014	M6	
2014	M6 Gran Coupe	
2012 - 2014	X1	

Part #	Year	Model
20039 (cont.)	BMW (cont.)	
	2006 - 2014	X3
	2000 - 2014	X5
	2008 - 2014	X6
	2000 - 2002	Z3
	2003 - 2014	Z4
	2000 - 2003	Z8
	Bugatti	
	2006	Veyron
	Ferrari	
	2001 - 2002	550 Maranello
	2002 - 2005	575M Maranello
	2004 - 2009	612 Scaglietti
	2003 - 2004	Enzo
	2005 - 2009	F430
	Land Rover	
	2005	LR3
	2002 - 2005	Range Rover
	Maserati	
	2004 - 2006	Coupe
	2004 - 2006	Gransport
	2006	MC12
	2004 - 2006	Quattroporte
	2004 - 2006	Spyder
	Mercedes-Benz	
	2000 - 2006	CL500
	2001 - 2006	CL55
	2001 - 2006	CL600
	2005 - 2006	CL65
	2001 - 2005	E320
	2001 - 2002	E430
	2003 - 2005	E500
	1999 - 2005	E55
	2008	R550
	2006	S350
	2000 - 2006	S430
	2000 - 2006	S500
	2001 - 2006	S55
	2001 - 2005	S600
	2006	S600
	2006	S65
	2001 - 2005	SL500
	2003 - 2005	SL55
	2001 - 2002	SL600
	2004 - 2005	SL600
2005	SL65	
2004 - 2007	SLR McLaren	
Mini		
2008 - 2013	Cooper	
Porsche		
2005 - 2011	911	
2005 - 2011	Boxster	
2004 - 2006	Carrera GT	
2003 - 2006	Cayenne	

SCHRADER 2014 TPMS APPLICATION GUIDE

NUMERICAL LISTING: Service Packs

Part #	Year	Model
20039 (cont.)	Porsche (cont.)	
	2008 - 2014	Cayenne
	2006 - 2011	Cayman
	2010 - 2011	Panamera
	Rolls-Royce	
	2007 - 2010	Phantom
	Volkswagen	
	2004 - 2006	Phaeton
	2004 - 2007	Touareg
	2011 - 2013	Touareg
2008 - 2012	Touareg 2	
20040	Audi	
	2002 - 2008	A4
	2005 - 2011	A6
	2001 - 2010	A8
	2001 - 2005	Allroad Quattro
	2007 - 2012	Q7
	2008 - 2012	R8
	2014	R8
	2007 - 2008	RS4
	2004 - 2009	S4
	2007 - 2011	S6
	2001 - 2003	S8
	2007 - 2009	S8
	Bentley	
	2007 - 2009	Azure
	2012 - 2014	Azure
	2003 - 2014	Continental
	2011 - 2014	Mulsanne
	BMW	
	2008 - 2012	128I
	2008 - 2013	135I
	2013	135IS
	2001 - 2005	320I
	2000	323CI
	2000	323I
2006 - 2010	323I	
2001 - 2006	325CI	
2001 - 2006	325I	
2001 - 2006	325XI	
2000	328CI	
2000	328I	
2007 - 2014	328I	
2007 - 2008	328XI	
2001 - 2006	330CI	
2001 - 2006	330I	
2001 - 2006	330XI	
2009 - 2012	335D	
2007 - 2014	335I	
2012 - 2014	335IS	
2007 - 2008	335XI	
2010	335XI	
2001 - 2007	525I	
2006 - 2007	525XI	

Part #	Year	Model
20040 (cont.)	BMW (cont.)	
	1997 - 2000	528I
	2008 - 2013	528I
	2008 - 2009	528XI
	2001 - 2007	530I
	2006 - 2007	530XI
	2008 - 2014	535I
	2008	535XI
	2010	535XI
	1997 - 2005	540I
	2006 - 2013	550I
	2012 - 2014	640I
	2004 - 2005	645CI
	2006 - 2014	650I
	1997 - 2001	740I
	2011 - 2013	740I
	1997 - 2001	740IL
	2011 - 2013	740LI
	2002 - 2005	745I
	2002 - 2005	745LI
	2006 - 2013	750I
	1997 - 2001	750IL
	2006 - 2013	750LI
	2004 - 2006	760I
	2003 - 2008	760LI
	2010 - 2011	760LI
	2012	M1
	2001 - 2006	M3
	2008 - 2013	M3
	2000 - 2003	M5
	2006 - 2013	M5
	2006 - 2010	M6
	2013 - 2014	M6
	2014	M6 Gran Coupe
	2012 - 2014	X1
	2006 - 2014	X3
	2000 - 2014	X5
	2008 - 2014	X6
	2000 - 2002	Z3
	2003 - 2014	Z4
2000 - 2003	Z8	
Bugatti		
2006	Veyron	
Ferrari		
2001 - 2002	550 Maranello	
2002 - 2005	575M Maranello	
2004 - 2009	612 Scaglietti	
2003 - 2004	Enzo	
2005 - 2009	F430	
Land Rover		
2005	LR3	
2002 - 2005	Range Rover	

Part #	Year	Model
20040	Maserati	
	2004 - 2006	Coupe
	2004 - 2006	Gransport
	2006	MC12
	2004 - 2006	Quattroporte
	2004 - 2006	Spyder
	Mercedes-Benz	
	2000 - 2006	CL500
	2001 - 2006	CL55
	2001 - 2006	CL600
	2005 - 2006	CL65
	2001 - 2005	E320
	2001 - 2002	E430
	2003 - 2005	E500
	1999 - 2005	E55
	2008	R550
	2006	S350
	2000 - 2006	S430
	2000 - 2006	S500
	2001 - 2006	S55
	2001 - 2005	S600
	2006	S600
	2006	S65
	2001 - 2005	SL500
	2003 - 2005	SL55
	2001 - 2002	SL600
	2004 - 2005	SL600
	2005	SL65
	2004 - 2007	SLR McLaren
	Mini	
	2008 - 2013	Cooper
	Porsche	
	2005 - 2011	911
	2005 - 2011	Boxster
	2004 - 2006	Carrera GT
	2003 - 2006	Cayenne
	2008 - 2014	Cayenne
	2006 - 2011	Cayman
	2010 - 2011	Panamera
	Rolls-Royce	Rolls-Royce
2007 - 2010	Phantom	
Volkswagen		
2004 - 2006	Phaeton	
2004 - 2007	Touareg	
2011 - 2013	Touareg	
2008 - 2012	Touareg 2	
Dodge		
2012 - 2014	Dart	
2014	Ram Series Pickup	
Jeep		
2014	Cherokee	

DILL 2014 TPMS APPLICATION GUIDE

DILL 2014 TPMS APPLICATION GUIDE

Model	Model Year	Torque In-Lbs	Multi-App Sensor	Multi-App Kit	Dill Sensor	Dill Kit	Kit Color	OE Sensor Part #	Valve Stem Repl.	
Acura	CSX	08-11	35	7002	7020K	1212	2045K	Lt Blue	42753-SNA-A83	NO
	ILX	13-14	71	7002	7020K	5513	7000K	◆	42753-TX6-A81	VS70
	MDX	04-06	40	—	—	1057	2000K	Yellow	06421-S3V-A04	1096
		07-13	35	—	—	1209	1100K	Purple	42753-STK-A04	NO
		14	71	—	—	5512	7000K	◆	42753-TX4-A51	VS70
	RDX	07-12	35	—	—	1209	1100K	Purple	42753-STK-A04	NO
		13-14	71	—	—	5512	7000K	◆	42753-TX4-A51	VS70
	RL	05-08	40	—	—	1057	2000K	Yellow	06421-S3V-A04	1096
		09-12	35 or 40	—	—	1057	2045K or 2000K	Lt Blue Yellow	42753-SHJ-A53	NO OR 1096
	RLX	13-14	35	—	—	1214	2045K	Lt Blue	42753-TY2-A51	NO
	TL	05-08	40	—	—	1057	2000K	Yellow	06421-S3V-A04	1096
	TL (Hi-Line)	09-14	35	—	—	1214	2045K	Lt Blue	42753-TK4-A01/ 42753-TY2-A51	NO
	TSX	07-14	35	—	—	1209	1100K	Purple	42753-TL2-A52	NO
	ZDX (Hi-Line)	10-13	35	—	—	1214	2045K	Lt Blue	42753-TK4-A01/ 42753-TY2-A51	NO
Audi	Allroad (315 Mhz)	01-05	35	—	—	9004	1090K	Gray	4D0 907 275A	1092
	A6 Allroad (433 Mhz)	01-06	35	—	—	9001	1090K	Gray	4D0 907 275C	1092
		07-09	35	—	—	9007 or 9011	1090K	Gray	4F0 907 275B	1092
	A6 Allroad (433 Mhz) Post-June 2009	10	40	—	—	9011	1096	Gray	4F0 907 275D	1096
	A3 (315 Mhz)	06-11	71	7003	7020K	1053	1030K	Orange	1K0907253D	NO
	A4 (315 Mhz)	09-11	71	7003	7020K	1053	1030K	Orange	1K0907253D	NO
	A4 (433 Mhz)	05-08	35	—	—	9007 or 9011	1090K	Gray	4F0 907 275B	1092
	A5 (315 Mhz)	08-11	71	7003	7020K	1053	1030K	Orange	1K0907253D	NO
	A6 (315 Mhz)	02-04	35	—	—	9004	1090K	Gray	4D0 907 275A	1092
	A6 (433 Mhz)	05-09	35	—	—	9007 or 9011	1090K	Gray	4F0 907 275B	1092
	A6 (433 Mhz) Post-June 2009	10-12	40	—	—	9011	1096	Gray	4F0 907 275D	1096
	A8 (315 Mhz)	00-07	35	—	—	9004	1090K	Gray	4D0 907 275A	1092
	A8 (433 Mhz)	00-12	35	—	—	9001	1090K	Gray	4D0 907 275C	1092
	Q5 (315 Mhz)	09	71	7003	7020K	1053	1030K	Orange	1K0907253D	NO

1091-1099-1099L are valve options on some special wheel packages. ◆ The 7020K Service Kit is used.

DILL 2014 TPMS APPLICATION GUIDE

	Model	Model Year	Torque In-Lbs	Multi-App Sensor	Multi-App Kit	Dill Sensor	Dill Kit	Kit Color	OE Sensor Part #	Valve Stem Repl.
Audi (cont.)	Q7 (433 Mhz)	06-09	35	—	—	9007 or 9011	1090K	Gray	4F0 907 275B	1092
	Q7 (433 Mhz) <i>Post-June 2009</i>	10-12	40	—	—	9011	1096	Gray	4F0 907 275D	1096
	R8 (433 Mhz)	08-09	35	—	—	9007 or 9011	1090K	Gray	4F0 907 275B	1092
	R8 (433 Mhz) <i>Post-June 2009</i>	10-12	40	—	—	9011	1096	Gray	4F0 907 275D	1096
	RS4 (433 Mhz)	07-08	35	—	—	9007 or 9011	1090K	Gray	4F0 907 275B	1092
	RS6 (315 Mhz)	01-05	35	—	—	9004	1090K	Gray	4D0 907 275A	1092
	RS6 (433 Mhz)	01-04	35	—	—	9001	1090K	Gray	4D0 907 275C	1092
	S4 (315 Mhz)	10-11	71	7003	7020K	1053	1030K	Orange	1K0907253D	NO
	S4 (433 Mhz)	05-07	35	—	—	9007 or 9011	1090K	Gray	4F0 907 275B	1092
	S5 (315 Mhz)	08-11	71	7003	7020K	1053	1030K	Orange	1K0907253D	NO
	S6 (433 Mhz)	05-09	35	—	—	9007 or 9011	1090K	Gray	4F0 907 275B	1092
	S6 (433 Mhz) <i>Post-June 2009</i>	10-12	40	—	—	9011	1096	Gray	4F0 907 275D	1096
	S8 (315 Mhz)	00-08	35	—	—	9004	1090K	Gray	4D0 907 275A	1092
	S8 (433 Mhz)	00-09	35	—	—	9001	1090K	Gray	4D0 907 275C	1092
	TT (315 Mhz)	08-11	71	7003	7020K	1053	1030K	Orange	1K0907253D	NO
Bentley	Continental GT	03-05	35	—	—	9001	1090K	Gray	4D0 907 275C	1092-1095
	Continental GT <i>Post-May 2005</i>	05-10	35	—	—	9007 or 9011	1090K	Gray	4F0 907 275B	1092-1095
	Continental GT	11-14	40	—	—	9011	1096	—	4F0 907 275B	1096
	Azure	07-10	35	—	—	9007 or 9011	1090K	Gray	4F0 907 275B	1092-1095
		11-14	40	—	—	9011	1096	—	4F0 907 275B	1096
	Mulsanne	11-14	40	—	—	9011	1096	—	4F0 907 275B	1096
	Flying Spur	06-10	35	—	—	9007 or 9011	1090K	Gray	4F0 907 275B	1092-1095
	Flying Spur	11-14	40	—	—	9011	1096	—	4F0 907 275B	1096
BMW	1 Series (433 Mhz)	07-10	35	—	—	1027	1090K	Gray	36 23 6 781 847	1092-1095
	1 Series (433 Mhz) <i>Post-September 2010</i>	11-13	40	—	—	9012	1096	Yellow	36 10 6 856 227	1096
	3 Series (315 Mhz)	00-04	35	—	—	9004	1090K	Gray	36 11 8 378 681	1092-1095
	3 Series (433 Mhz)	00-04	35	—	—	9002	1090K	Gray	36 11 8 378 682	1092-1095
		07-10	35	—	—	1027	1090K	Gray	36 23 6 781 847	1092-1095
	3 Series (433 Mhz) <i>Post-September 2009</i>	10-12	40	—	—	9012	1096	Yellow	36 10 6 856 227	1096

1091-1099-1099L are valve options on some special wheel packages.

DILL 2014 TPMS APPLICATION GUIDE

Model	Model Year	Torque In-Lbs	Multi-App Sensor	Multi-App Kit	Dill Sensor	Dill Kit	Kit Color	OE Sensor Part #	Valve Stem Repl.
3 Series (433 Mhz) <i>Post-October 2011</i>	12-14	40	—	—	9017	1096	Yellow	36 10 6 798 872	1096
4 Series (433 Mhz)	14	40	—	—	9017	1096	Yellow	36 10 6 798 872	1096
5 Series (315 Mhz)	00-02	35	—	—	9004	1090K	Gray	36 11 8 378 681	1092-1095
5 Series (433 Mhz)	02-05	35	—	—	9002	1090K	Gray	36 11 8 378 682	1092-1095
	06-10	35	—	—	1027	1090K	Gray	36 23 6 781 847	1092-1095
5 Series (433 Mhz) <i>Post-September 2010</i>	11-14	40	—	—	9012	1096	Yellow	36 10 6 856 227	1096
6 Series (433 Mhz)	06-10	35	—	—	1027	1090K	Gray	36 23 6 781 847	1092-1095
6 Series (433 Mhz) <i>Post-March 2011</i>	12-14	40	—	—	9012	1096	Yellow	36 10 6 856 227	1096
7 Series (315 Mhz)	00-01	35	—	—	9004	1090K	Gray	36 11 8 378 681	1092-1095
7 Series (433 Mhz)	02-05	35	—	—	9002	1090K	Gray	36 11 8 378 682	1092-1095
	06-10	35	—	—	1027	1090K	Gray	36 23 6 781 847	1092-1095
7 Series (433 Mhz) <i>Post-September 2010</i>	11-14	40	—	—	9012	1096	Yellow	36 10 6 856 227	1096
M Series (433 Mhz)	06-10	35	—	—	1027	1090K	Gray	36 23 6 781 847	1092-1095
	11-14	40	—	—	9012	1096	Yellow	36 10 6 856 227	1096
X1 (433 Mhz)	12-14	40	—	—	9012	1096	Yellow	36 10 6 856 227	1096
X3 (433 Mhz)	06-10	35	—	—	1027	1090K	Gray	36 23 6 781 847	1092-1095
X3 (433 Mhz) <i>Post-November 2010</i>	11-14	40	—	—	9012	1096	Yellow	36 10 6 856 227	1096
X5 (433 Mhz)	01-04	35	—	—	9003	1090K	Gray	36 14 6 752 128	1092-1095
	07-10	35	—	—	1027	1090K	Gray	36 23 6 781 847	1092-1095
X5 (433 Mhz) <i>Post-October 2010</i>	11-14	40	—	—	9012	1096	Yellow	36 10 6 856 227	1096
X6 (433 Mhz)	08-11	35	—	—	1027	1090K	Gray	36 23 6 781 847	1092-1095
X6 (433 Mhz) <i>Post-October 2010</i>	11-14	40	—	—	9012	1096	Yellow	36 10 6 856 227	1096
Z Series (433 Mhz)	06-10	35	—	—	1027	1090K	Gray	36 23 6 781 847	1092-1095
	11-14	40	—	—	9012	1096	Yellow	36 10 6 856 227	1096
Alpina (433 Mhz)	07-08	35	—	—	9002	1090K	Gray	36 11 8 378 682	1092-1095
Veyron	05-06	NA			NA	1090K	Gray	NA	1092-1095
Allure	07-08	71	7001/HP	7020K	NA	1050K	White	15921013	NO
	09	—	7001-R/ HP-R	VS80	9153	VS950	NA	12768826	VS950
Enclave	08	71	7001/HP	7020K	NA	1050K	White	15921013	NO
	09-14	—	7001-R/ HP-R	VS80	9153	VS950	NA	22853741	VS950
Encore	13-14	—	7001-R/ HP-R	VS80	9153	VS950	NA	22854866	VS950
	07-08	71	7001/HP	7020K	NA	1050K	White	15921013	NO
LaCrosse	09-14	—	7001-R/ HP-R	VS80	9153	VS950	NA	22854866	VS950
	07	—	7001-R/ HP-R	VS80	9153	VS950	NA	25799331	VS950
Lucerne	07-11	—	7001-R/ HP-R	VS80	9153	VS950	NA	25920615	VS950

1091-1099-1099L are valve options on some special wheel packages. The 1050K is to be used on the Siemens sensors and the 1070K is to be used on the Schrader sensors.

DILL 2014 TPMS APPLICATION GUIDE

	Model	Model Year	Torque In-Lbs	Multi-App Sensor	Multi-App Kit	Dill Sensor	Dill Kit	Kit Color	OE Sensor Part #	Valve Stem Repl.	
Burck (cont.)	Rainier	06-07	62	7001/HP	7020K	9116	1070K	Blue	25774006	NO	
		07	—	7001-R/HP-R	VS80	9153	VS950	NA	25799331	VS950	
	Regal	11-14	—	7001-R/HP-R	VS80	9153	VS950	NA	22854866	VS950	
	Verano	12-14	—	7001-R/HP-R	VS80	9153	VS950	NA	22854866	VS950	
Cadillac	ATS	13	—	7001-R/HP-R	VS80	NEW	VS90	—	22959744	VS90	
		14	—	7001-R/HP-R	VS80	9153	VS950	NA	13581558	VS950	
	ATS Sport	13	71	7001/HP	7020K	NEW	7020K	◆	22959748	VS70	
		14	62	7001/HP	7020K	9158	1070K	—	20964159	NO	
	CTS	04-07	62	7001/HP	7020K	9116	1070K	Blue	25774006	NO	
		08-14	—	7001-R/HP-R	VS80	9153	VS950	NA	13581558	VS950	
	CTS-V	09-10	71	7001/HP	7020K	NA	1050K	White	15268606	NO	
		11-14	62	7001/HP	7020K	9158	1070K	White	15268606	NO	
	Deville	01-05	62			9117	1080K	Green	25773946	NO	
	DTS	06		7001/HP	7020K	9158	1070K	White	15268606	NO	
								Blue			
		07-11	—	7001-R/HP-R	VS80	9153	VS950	NA	25920615	VS950	
	ELR	14	—	7001-R/HP-R	VS80	9153	VS950	—	22854866	VS950	
	Escalade-ESV-EXT	04				9115	1070K	Blue	15136883	NO	
				62	7003	7020K	9107	1070K	Blue	15114379	NO
				62	7001/HP	7020K	NA	2020K	Pink	15825475	NO
Escalade-ESV-EXT (cont.)	07		7001/HP	7020K	9158	1070K	White	TRW Sensor Replacement	NO		
			—	7001-R/HP-R	VS80	9153	VS950	NA	13586335	VS950	
Seville	01-04	62		—	9117	1080K	Green	25773946	NO		
SRX	04-06		7001/HP	7020K	9116	1070K	Blue	25774006	NO		
			—	7001-R/HP-R	VS80	9153	VS950	NA	12768826	VS950	
STS	05-09		7001/HP	7020K	9076	1070K	Blue	25758220	NO		
			62	7001/HP	7020K	9158	1070K	White	15268606	NO	
		09	—	7001-R/HP-R	VS80	9153	VS950	NA	25920615	VS950	
XLR	04-09	62	7001/HP	7020K	9076	1070K	Blue	25758220	NO		
XTS	13-14	—	7001-R/HP-R	VS80	9153	VS950	NA	20922900	VS950		

The 1050K is to be used on the Siemens sensors and the 1070K is to be used on the Schrader sensors.

◆ The 7020K Service Kit is used.

DILL 2014 TPMS APPLICATION GUIDE

Model	Model Year	Torque In-Lbs	Multi-App Sensor	Multi-App Kit	Dill Sensor	Dill Kit	Kit Color	OE Sensor Part #	Valve Stem Repl.
Avalanche	04	62	—	—	9115	1070K	Blue	15136883	NO
	05-06	62	7003	7020K	9107	1070K	Blue	15114379	NO
	07	62	7001/HP	7020K	NA	2020K	Pink	15825475	NO
	07	62	7001/HP	7020K	9158	1070K	White	TRW Sensor Replacement	NO
	07-13	—	7001-R/HP-R	VS80	9153	VS950	NA	20923680	VS950
Aveo	07-11	—	—	—	9153	VS950	NA	25920615	VS950
Camaro	10-14	—	7001-R/HP-R	VS80	9153	VS950	NA	22854866	VS950
Camaro-Sport	12-14	62	7001/HP	7020K	9158	1070K	Blue	20964159	NO
Caprice	11-12	62	7001/HP	7020K	9158	1070K	White	15268606	NO
Captiva	12-13	—	7001-R/HP-R	VS80	9153	VS950	NA	20923680	VS950
Cobalt	08-10	71	7001/HP	7020K	NA	1050K	White	15268606	NO
	08-10	—	7001-R/HP-R	VS80	9153	VS950	NA	12768826	VS950
Colorado	07-12	62	7003	7020K	9131	1110K	Teal	15122618	NO
Corvette	97-00	62	—	—	8006	1077K	Lt Blue	10438853	NO
	10-14	62	7001/HP	7020K	9158	1070K	White	20925924	NO
							Blue		
Corvette-C6	05-09	62	7001/HP	7020K	9076	1070K	Blue	25758220	NO
Cruze	11-14	—	7001-R/HP-R	VS80	9153	VS950	NA	20922900	VS950
Equinox	07-09	71	7001/HP	7020K	NA	1050K	White	15921013	NO
	10-14	—	7001-R/HP-R	VS80	9153	VS950	NA	22854866	VS950
Express Series	08-09	71	7001HP	7020K	NA	1050K	White	15921013	NO
Express Series-1500	10-14	—	7001-R/HP-R	VS80	9153	VS950	NA	20923680	VS950
Express Series -2500/3500	10-14	—	7001HP-R	VS80	9153	VS950	NA	20923680	VS950
G Series	08	71	7001/HP	7020K	NA	1050K	White	15921013	NO
HHR	08-09	62	7001/HP	7020K	9158	1070K	White	15268606	NO
							Blue		
	08-11	—	7001-R/HP-R	VS80	9153	VS950	NA	25920615	VS950
Impala	06-07	62	7001/HP	7020K	9158	1070K	White	15268606	NO
							Blue		
	07-14	—	7001-R/HP-R	VS80	9153	VS950	NA	20923680	VS950
Malibu Pre-October 14, 2007	08	71	7001/HP	7020K	NA	1050K	White	15921013	NO
Malibu	08-14	—	7001-R/HP-R	VS80	9153	VS950	NA	13589255	VS950
Monte Carlo	06-07	62	7001/HP	7020K	9158	1070K	White	15268606	NO
							Blue		
	07	—	7001-R/HP-R	VS80	9153	VS950	NA	25920615	VS950

The 1050K is to be used on the Siemens sensors and the 1070K is to be used on the Schrader sensors.

DILL 2014 TPMS APPLICATION **GUIDE**

Model	Model Year	Torque In-Lbs	Multi-App Sensor	Multi-App Kit	Dill Sensor	Dill Kit	Kit Color	OE Sensor Part #	Valve Stem Repl.	
Orlando	12	—	7001-R/ HP-R	VS80	9153	VS950	NA	25920615	VS950	
Silverado (All)	04	62	7001HP-R	—	9115	1070K	Blue	15136883	NO	
	05-06	62	7003	7020K	9107	1070K	Blue	15114379	NO	
Silverado-1500	07	62	7001/HP	7020K	NA	2020K	Pink	15825475	NO	
	07	62	7001/HP	7020K	9158	1070K	White	TRW Sensor Replacement	NO	
	07-14	—	7001-R/ HP-R	VS80	9153	VS950	NA	13589255	VS950	
Silverado-2500/3500	07	—	7001HP	7020K	NA	2020K	Pink	15825475	NO	
	07	62	7001HP	7020K	9158	1070K	White	TRW Sensor Replacement	NO	
	07-14	—	7001HP-R	VS80	9153	VS950	NA	13589255	VS950	
Sonic	12-14	—	7001-R/ HP-R	VS80	9153	VS950	NA	20922900	VS950	
Spark	13-14	—	7001-R/ HP-R	VS80	9153	VS950	NA	22854866	VS950	
SS	14	62	7001/HP	7020K	9158	1070K	Blue	20964159	NO	
SSR	06-07	62	7001/HP	7020K	9116	1070K	Blue	25774006	NO	
Suburban	04	62			9115	1070K	Blue	15136883	NO	
	05-06	62	7003	7020K	9107	1070K	Blue	15114379	NO	
Suburban-1500	07	62	7001/HP	7020K	NA	2020K	Pink	15825475	NO	
	07	62	7001/HP	7020K	9158	1070K	White	TRW Sensor Replacement	NO	
	07-14	—	7001-R/ HP-R	VS80	9153	VS950	NA	20923680	VS950	
Suburban-2500	07	62	7001HP	7020K	NA	2020K	Pink	15825475	NO	
	07	62	7001HP	7020K	9158	1070K	White	TRW Sensor Replacement	NO	
	07-14	—	7001HP-R	VS80	9153	VS950	NA	20923680	VS950	
Tahoe	04	62	—	—	9115	1070K	Blue	15136883	NO	
	05-06	62	7003	7020K	9107	1070K	Blue	15114379	NO	
	07	62	7001/HP	7020K	NA	2020K	Pink	15825475	NO	
	07	62	7001/HP	7020K	9158	1070K	White	TRW Sensor Replacement	NO	
	07-14	—	7001-R/ HP-R	VS80	9153	VS950	NA	20923680	VS950	
Trailblazer	06-09	62	7001/HP	7020K	9116	1070K	Blue	25774006	NO	
Traverse	09-14	62	7001-R/ HP-R	VS80	9153	VS950	NA	20923680	VS950	
Uplander	08-09	62	7001/HP	7020K	9158	1070K	White	15268606	NO	
							Blue			
Volt	10-14	—	7001-R/ HP-R	VS80	9153	VS950	NA	22854866	VS950	
Chrysler	200	11-14	71	7001/HP	7020K	1051	7000K	◆	68078861AA	VS70
	300 (315 Mhz)	05-07	71	7001/HP	7020K	1051	1050K	White	68111696AA	NO
	300 (433 Mhz)	08	71	7004	7020K	1043	1050K	White	68001698AB	NO
		09-10	58	—	—	9214	9066K	NA	56029400AE	9066K
		11-14	53	—	—	9398	VS950	NA	56029398AB	VS950
	02-04	35	7004	7020K	9028	1080K	Green	52088990AC	NO	

The 1050K is to be used on the Siemens sensors and the 1070K is to be used on the Schrader sensors. ◆ The 7020K Service Kit is used.

DILL 2014 TPMS APPLICATION GUIDE

	Model	Model Year	Torque In-Lbs	Multi-App Sensor	Multi-App Kit	Dill Sensor	Dill Kit	Kit Color	OE Sensor Part #	Valve Stem Repl.
Chrysler (cont.)	Aspen	07-09	71 or 58	7001/HP	7020K	1051 **	1050K or 9066K	White	56029465AB	9066K
								Lt Grey		
	Concorde (433 Mhz)	02-04	35	7004	7020K	9028	1080K	Green	52088990AC	NO
	Crossfire	04-08	35	7004	7020K	9028	1080K	Green	52088990AC	NO
	Pacifica	04	35	7004	7020K	9028	1080K	Green	52088990AC	NO
		04-05	71	7001/HP	7020K	1052	1050K	White	04727392AB	NO
		06-08	71	7001/HP	7020K	1051	1050K	White	68001696AB	NO
	Prowler	01	35	—	—	8004	1080K	Green	4815132AB	NO
		02	35	7004	7020K	9028	1080K	Green	52088990AC	NO
	PT Cruiser	08-10	71	7001/HP	7020K	1051	1050K	White	68001696AB	NO
	Sebring	07-10	71	7001/HP	7020K	1051	1050K	White	68001696AB	NO
		10	71	7001/HP	7020K	1051	7000K	◆	68078861AA	VS70
	Town and Country	02-03	35	7004	7020K	9028	1080K	Green	52088990AC	NO
		04-05	71	7001/HP	7020K	1052	1050K	White	04727392AB	NO
		06-07	71	7001/HP	7020K	1051	1050K	White	56053030AB	NO
		08-10	71	7004	7020K	1043	1050K	White	68001698AB	NO
		10	71	7004	7020K	1043	7000K	◆	68078768AA	VS70
	11-14	—	—	—	—	9398	VS950	NA	56029398AB	VS950
Voyager (433 Mhz)	02-03	35	7004	7020K	9028	1080K	Green	52088990AC	NO	
Dodge	Avenger	08-10	71	7001/HP	7020K	1051	1050K	White	68001696AB	NO
								10-14		
	Caliber	07-10	71	7001/HP	7020K	1051	1050K	White	68001696AB	NO
		11-12	71	7001/HP	7020K	1051	7000K	◆	68078861AA	VS70
	Caliber-Export	12	71	7004	7020K	1043	7000K	◆	68078768AA	VS70
	Caravan	02-03	35	7004	7020K	9028	1080K	Green	52088990AC	NO
		04-05	71	7001/HP	7020K	1052	1050K	White	04727392AB	NO
		06-07	71	7001/HP	7020K	1051	1050K	White	56053030AB	NO
	Challenger	08	71	7004	7020K	1043	1050K	White	68078768AA	NO
		10-14	—	—	—	9398	VS950	NA	56029398AB	VS950
	Challenger SRT	08-14	58	—	—	9214	9066K	Lt Grey	56029400AE	9066K
	Charger	06-07	71	7001/HP	7020K	1051	1050K	White	68001696AB	NO
		08	71	7004	7020K	1043	1050K	White	68001698AB	NO
		10-14	—	—	—	9398	VS950	NA	56029398AB	VS950
	Charger SRT	09-14	58	—	—	9214	9066K	Lt Grey	56029400AE	9066K
	Dakota	08-10	58	7001/HP	7020K	9154	9066K	Lt Grey	56029319AC	9066K
		11	—	7001-R/ HP-R	VS80	9308	VS950	NA	56029479AB	VS950
	Dart	13-14	—	—	—	5775	VS90	NA	68193586AC	VS90
	Durango	07-09	71 or 58	7001/HP	7020K	1051 **	1050K or 9066K	White	56029465AB	9066K
Lt Grey										
Durango (433 Mhz)	11-14	—	—	—	9398	VS950	NA	56029398AB	VS950	

**The 1050K is to be used on the Siemens sensors and the 2030K is to be used on the Schrader sensors. ◆ The 7020K Service Kit is used.

DILL 2014 TPMS APPLICATION GUIDE

Model	Model Year	Torque In-Lbs	Multi-App Sensor	Multi-App Kit	Dill Sensor	Dill Kit	Kit Color	OE Sensor Part #	Valve Stem Repl.
Grand Caravan	02-03	35	7004	7020K	9028	1080K	Green	52088990AC	NO
	04-05	71	7001/HP	7020K	1052	1050K	White	04727392AB	NO
	06-07	71	7001/HP	7020K	1051	1050K	White	56053030AB	NO
	08-10	71	7004	7020K	1043	1050K	White	68001698AB	NO
	10	71	7004	7020K	1043	7000K	◆	68078768AA	VS70
	11-14	—	—	—	—	9398	VS950	NA	56029398AB
Intrepid (433 Mhz)	02-04	35	7004	7020K	9028	1080K	Green	52088990AC	NO
Journey (433 Mhz)	09-10	71	7004	7020K	1043	1050K	White	68001698AB	NO
	10-14	—	—	—	—	9398	VS950	NA	56029398AB
Magnum	05-07	71	7001/HP	7020K	1051	1050K	White	68001696AB	NO
	08	71	7004	7020K	1043	1050K	White	68001698AB	NO
Nitro	07-09	71 or 58	7001/HP	7020K	1051**	1050K or 9066K	White Lt Grey	56029465AB	9066K
Nitro (433 Mhz)	07-09	—	7004	7020K	1043	1050K	White	68001698AB	NO
	10-11	—	—	—	—	9481	VS950	NA	56029481AB
Ram Promaster	14	—	—	—	NEW	—	—	5154876AA	
Ram (HP-315 Mhz) -1500	08	58	—	—	9154	9066K	Lt Grey	56029319AC (Check VIN)	9066K
Ram (HP-315 Mhz) -2500	08-09	58	7001HP	7020K	9154	9066K	Lt Grey	56029319AC (Check VIN)	9066K
Ram (433 Mhz) -1500	09	71	7004	7020K	1043	1050K	White	56029359AC	NO
Ram (433 Mhz) -1500/2500	13-14	—	—	—	6815	NEW	—	68157568AB	NEW
Ram (433 Mhz) -1500/2500/3500	10-13	—	—	—	9398	VS950	NA	56029398AB	VS950
Stratus	07	71	7001/HP	7020K	1051	1050K	White	56053030AB	NO
Viper	08-14	—	—	—	9214	9066K	Lt Grey	56029400AE	9066K
Viper (433 Mhz)	03-07	35	7004	7020K	9028	1080K	Green	52088990AD	NO
F430/Spider (433 Mhz)	06-07	35	—	—	9001	1090K	Gray	22 45 49	1092
F430/Spider (433 Mhz) Post-July 2007	08-10	35	—	—	9007 or 9011	1090K	Gray	23 92 98	1092
458 (433 Mhz)	10-14	40	—	—	9011	1096	Gray	23 92 98	1096
550 (433 Mhz)	02-14	35	—	—	9001	1090K	Gray	22 45 49	1092
575 (315 Mhz)	02-05	35	—	—	9004	1090K	Gray	22 45 48	1092
575M (433 Mhz)	02-06	35	—	—	9001	1090K	Gray	22 45 49	1092
599 (433 Mhz)	04-14	35	—	—	9001	1090K	Gray	22 45 49	1092
612 Scaglinetta (433 Mhz)	04-12	35	—	—	9001	1090K	Gray	22 45 49	1092
California (433 Mhz)	09-10	35	—	—	9008 or 9011	1090K	Gray	22 88 87	1092
	11-14	40	—	—	9011	1096	—	23 92 98	1096
Enzo (433 Mhz)	03-04	35	—	—	9005	1090K	Gray	22 45 51	1092
F12 Berlinetta (433 Mhz)	13-14	—	—	—	9011	1096	—	23 92 98	1096
FF (433 Mhz)	12-14	—	—	—	9011	1096	—	23 92 98	1096
FXX (433 Mhz)	05-06	35	—	—	9005	1090K	Gray	22 45 51	1092

**The 1050K is to be used on the Siemens sensors and the 2030K is to be used on the Schrader sensors. ◆ The 7020K Service Kit is used.

DILL 2014 TPMS APPLICATION GUIDE

Model	Model Year	Torque In-Lbs	Multi-App Sensor	Multi-App Kit	Dill Sensor	Dill Kit	Kit Color	OE Sensor Part #	Valve Stem Repl.
500 (433 Mhz)	11-14	—	—	—	9398	VS950	—	56029398AB	VS950
Crown Victoria	06-11	—	7001-R/HP-R	VS80	1048	NA	NA	6F2Z-1A189A	NO
C-Max	12-14	—	7001-R/HP-R	VS80	9315	VS950	NA	DE8T-1A180-AA	VS950
E Series	07-09	—	7001HP-R	VS80	1048-HP	NA	NA	8C2Z-1A189A	NO
E Series (HP)	10-14	—	7001HP-R	VS80	9315	VS950	NA	9L3Z-1A-189A	VS950
Edge	07-10	—	7001-R/HP-R	VS80	1048	NA	NA	7L1Z-1A189A	NO
	11-14	—	7001-R/HP-R	VS80	9315	VS950	NA	DE8T-1A180-AA	VS950
Escape	06-08	—	7001-R/HP-R	VS80	1048	NA	NA	6F2Z-1A189A	NO
	09-14	—	7001-R/HP-R	VS80	9315	VS950	NA	9L3Z-1A-189A	VS950
Expedition	03-04	44	7004	7020K	9096	1060K	Rubine Red	4L2T1A150BA	NO
	05-06	44	7001/HP	7020K	9135	1060K	Rubine Red	5L1ZA150AB	NO
	07-10	—	7001-R/HP-R	VS80	1048	NA	NA	7L1Z-1A189A	NO
	11-14	—	7001-R/HP-R	VS80	9315	VS950	NA	9L3Z-1A-189A	VS950
Explorer	02-05	44	7004	7020K	9096	1060K	Rubine Red	4L2T1A150BA	NO
	06-10	—	7001-R/HP-R	VS80	1048	NA	NA	6F2Z-1A189A	NO
	11-14	—	7001-R/HP-R	VS80	9315	VS950	NA	9L3Z-1A-189A	VS950
Explorer Sport Trac	07-10	—	7001-R/HP-R	VS80	1048	NA	NA	6F2Z-1A189A	NO
F-150	07-08	—	7001-R/HP-R	VS80	1048	NA	NA	6F2Z-1A189A	NO
	09-14	—	7001-R/HP-R	VS80	9315	VS950	NA	9L3Z-1A-189A	VS950
Fiesta	11-14	—	7001-R/HP-R	VS80	9315	VS950	NA	9L3Z-1A-189A	VS950
500	08-09	—	7001-R/HP-R	VS80	1048	NA	NA	6F2Z-1A189A	NO
Flex	09-10	—	7001-R/HP-R	VS80	1048	NA	NA	7L1Z-1A189A	NO
	11-14	—	7001-R/HP-R	VS80	9315	VS950	NA	9L3Z-1A-189A	VS950
Focus	07-09	—	7001-R/HP-R	VS80	1048	NA	NA	6F2Z-1A189A/ 7L1Z-1A189A	NO
	10-14	—	7001-R/HP-R	VS80	9315	VS950	NA	9L3Z-1A-189A	VS950
Freestar	04-05	44	7001/HP	7020K	9135	1060K	Rubine Red	5L1ZA150AB	NO
	06-07	—	7001-R/HP-R	VS80	1048	NA	NA	6F2Z-1A189A	NO
Fusion	07-09	—	7001-R/HP-R	VS80	1048	NA	NA	6F2Z-1A189A	NO
	10-14	—	7001-R/HP-R	VS80	9315	VS950	NA	9L3Z-1A-189A	VS950

*Redi-Sensor relearn must be performed with scan tool and not magnet.

DILL 2014 TPMS APPLICATION GUIDE

	Model	Model Year	Torque In-Lbs	Multi-App Sensor	Multi-App Kit	Dill Sensor	Dill Kit	Kit Color	OE Sensor Part #	Valve Stem Repl.
Ford (cont.)	Mustang	07-09	—	7001-R/ HP-R	VS80	1048	NA	NA	6F2Z-1A189A	NO
		10-14	—	7001-R/ HP-R	VS80	9315	VS950	NA	9L3Z-1A-189A	VS950
		14	—	7004	7020K	NEW	VS950	—	BB5Z-1A189A	
	Ranger	07-11	—	7001-R/ HP-R	VS80	1048	NA	NA	6F2Z-1A189A	NO
		12	—	7001-R/ HP-R	VS80	9315	VS950	NA	9L3Z-1A-189A	VS950
	Shelby GT <i>Post-April 2012</i>	13	—	7001-R/ HP-R	VS80	9315	VS925C	NA	DR3Z-1A189A	VS925C
	Super Duty <i>Pre-June 2009</i>	07-10	—	7001HP-R	VS80	1048-HP	NA	NA	8C2Z-1A189A	NO
	Super Duty <i>Post-June 2009</i>	10-14	—	7001HP-R	VS80	9315	VS950	NA	9L3Z-1A-189A	VS950
	Taurus <i>Pre-May 2010</i>	08-10	—	7001-R/ HP-R	VS80	1048	NA	NA	7L1Z-1A189A	NO
	Taurus <i>Post-May 2010</i>	11-14	—	7001-R/ HP-R	VS80	9315	VS950	NA	9L3Z-1A-189A	VS950
Taurus X	08-09	—	7001-R/ HP-R	VS80	1048	NA	NA	7L1Z-1A189A	NO	
Transit	10-14	—	7001-R/ HP-R	VS80	9315	VS950	NA	9L3Z-1A-189A	VS950	
GMC	Acadia	07-08	71	7001/HP	7020K	NA	1050K	White	15921013	NO
		09-14	—	7001-R/ HP-R	VS80	9153	VS950	NA	20923680	VS950
	Canyon	07-12	62	7003	7020K	9131	1110K	Teal	15122618	NO
	Envoy	05-07	62	7001/HP	7020K	9116	1070K	Blue	25774006	NO
		07-09	—	7001-R/ HP-R	VS80	9153	VS950	NA	25920615	VS950
	Savana	08-09	71	7001/HP	7020K	NA	1050K	White	15921013	NO
		10-14	—	7001-R/ HP-R	VS80	9153	VS950	NA	20923680	VS950
	Sierra (All)	04	62	—	—	9115	1070K	Blue	15136883	NO
		05-06	62	7003	7020K	9107	1070K	Blue	15114379	NO
	Sierra-1500	07	62	7001/HP	7020K	NA	2020K	Pink	15825475	NO
		07	62	7001/HP	7020K	9158	1070K	White	TRW Sensor Replacement	NO
		07-14	—	7001-R/ HP-R	VS80	9153	VS950	NA	13589255	VS950
	Sierra-2500/3500	07	—	7001HP	7020K	NA	2020K	Pink	15825475	NO
		07	—	7001HP	7020K	9158	1070K	White	TRW Sensor Replacement	NO
		07-14	—	7001HP-R	VS80	9153	VS950	NA	13589255	VS950
Terrain	10-14	—	7001-R/ HP-R	VS80	9153	VS950	NA	20923680	VS950	
Yukon (All)	04	62	—	—	9115	1070K	Blue	15136883	NO	
	05-06	62	7003	7020K	9107	1070K	Blue	15114379	NO	

*Redi-Sensor relearn must be performed with scan tool and not magnet.

Note: Use "TRW LoLine Fxd Dly" function on BarTec 400 or 400P to program the sensors.

DILL 2014 TPMS APPLICATION GUIDE

	Model	Model Year	Torque In-Lbs	Multi-App Sensor	Multi-App Kit	Dill Sensor	Dill Kit	Kit Color	OE Sensor Part #	Valve Stem Repl.
GMC (cont.)	Yukon	07	62	7001/HP	7020K	NA	2020K	Pink	15825475	NO
		07	62	7001/HP	7020K	9158	1070K	White	TRW Sensor Replacement	NO
		07-14	—	7001-R/HP-R	VS80	9153	VS950	NA	20923680	VS950
	Yukon-2500	07	—	7001HP	7020K	NA	2020K	Pink	15825475	NO
		07	—	7001HP	7020K	9158	1070K	White	TRW Sensor Replacement	NO
		07-14	—	7001HP-R	VS80	9153	VS950	NA	13589255	VS950
Honda	Accord	08-12	35	7002	7020K	1208	1100K	Purple	42753-SWA-315/316	NO
	Civic	08-11	35	7002	7020K	1212	2045K	Lt Blue	42753-TR3-A81	NO
		12-13	35	7002	7020K	1212	2045K	Lt Blue	42753-TR3-A81	NO
	CR-V	07-11	35	7002	7020K	1208	1100K	Purple	42753-SWA-315/316	NO
	CR-V	12-13	71	7002	7020K	5511	7020K	◆	42753-TP6-A82	VS70
	CR-Z	11-12	35	7002	7020K	1212	2045K	Lt Blue	42753-TR3-A81	NO
	Crosstour	10-14	71	7002	7020K	5511	7020K	◆	42753-TP6-A82	VS70
	Element	06-07	40	7002	7020K	1058	2000K	Yellow	06421-SCV-A01	1096
		08	35 or 40	7002	7020K	1058	2045K or 2000K	Lt Blue	42753-SHJ-A82	NO or 1096
			09-11	35	7002	7020K	1212	2045K		Lt Blue
	Fit	08	35	7002	7020K	1208	1100K	Purple	42753-SWA-315/316	NO
		09-13	35	7002	7020K	1212	2045K	Lt Blue	42753-TR3-A81	NO
	Insight	10-13	35	7002	7020K	1212	2045K	Lt Blue	42753-TR3-A81	NO
	Odyssey EX, EX-L, LX	06-07	40	7002	7020K	1058	2000K	Yellow	06421-SCV-A00	1096
		08-10	35 or 40	7002	7020K	1058	2045K or 2000K	Lt Blue	42753-SHJ-A82	NO or 1096
	09-11		35	7002	7020K	1212	2045K	Lt Blue		42753-TR3-A81
	Odyssey Touring	05-07	40	—	—	1057	2000K	Yellow	06421-S3V-A04	1096
		08-10	35 or 40	—	—	1057	2045K or 2000K	Lt Blue	42753-SHJ-A53	NO or 1096
			11-14	35	7002	7020K	1212	2045K		Lt Blue
	Pilot (Alloy Wheels)	05-08	40	—	—	1057	2000K	Yellow	06421-S3V-A04	1096
09-14		35	—	—	1209	1100K	Purple	42753-STK-A04	NO	
Pilot (Steel Wheels)	05	40	—	—	1059	2000K	Yellow	06421-S9V-A02	1097	
	09-14	35	—	—	1219	1100K	Purple	42753-SZA-A13	NO	
Ridgeline (Alloy Wheels)	06-08	40	—	—	1057	2000K	Yellow	06421-S3V-A04	1096	
	09-14	35 or 40	—	—	1057	2045K or 2000K	Lt Blue	42753-SHJ-A53	NO or 1096	
11-14		35	7002	7020K	1212	2045K	Lt Blue		42753-TR3-A81	NO
Ridgeline (Steel Wheels)	06-08	40	—	—	1059	2000K	Yellow	06421-S9V-A02	1097	
S2000	08-09	35	7002	7020K	1208	1100K	Purple	42753-S2A-315	NO	
Hummer	H2	08-09	—	7001-R/HP-R	VS80	9153	VS950	NA	25920615	VS950
	H3	06-10	62	7003	7020K	9131	1110K	Teal	15122618	NO
	H3T	09-10	62	7003	7020K	9131	1110K	Teal	15122618	NO

◆ The 7020K Service Kit is used.

Note: Use "TRW LoLine Fxd Dly" function on BarTec 400 or 400P to program the sensors.

DILL 2014 TPMS APPLICATION
GUIDE

Model	Model Year	Torque In-Lbs	Multi-App Sensor	Multi-App Kit	Dill Sensor	Dill Kit	Kit Color	OE Sensor Part #	Valve Stem Repl.
Accent	12-13	71	7001/HP	7020K	5507	7020K	—	52933-2M000	VS70
	14		7001/HP	7020K	5507	7020K	—	52933-2M550	VS70
Accent (Lo-Line)	08-11	31-40	7002 or 1206A	7020K or 1100K	1029**	2040K	Lt Blue	52933-2F000	NO
Azera	06-12	40	7002	7020K	1068	2000K	Yellow	52933-2G200	1096
	13-14	—			9505	VS950	NA	52933-2V000	VS950
Elantra	07-10	40	7002	7020K	1068	2000K	Yellow	52933-2G200	1096
	11-14	—	7002	7020K	NEW	VS965	Lt Blue	52933-3X200	VS965
Elantra (Touring)	09-12	71	7001/HP	7020K	5507	1050K or 7020K	White ◆	52933-2L700	VS70
Elantra GT	13	71	7001/HP	7020K	5507	7020K	◆	52933-A5000	VS70
Entourage	07-09	40	—	—	1028	2000K	Yellow	52933-4D200	1096
Equus (Hi-Line)	11-13	31-40	—	—	1029	2040K	Lt Blue	52933-2F000	NO
	14		7001/HP	7020K	5507	7020K	—	52933-A5000	VS70
Genesis (Hi-line)	09-14	31-40	—	—	1029	2040K	Lt Blue	52933-2F000	NO
Genesis Coupe	10-14	71	7001/HP	7020K	5507	7020K	◆	52933-2M550	VS70
Santa Fe Thru July 2007	07-08	40	—	—	1028	2000K	Yellow	52933-4D200	1096
Santa Fe Thru September 2009	08-10	40	7002	7020K	1068	2000K	Yellow	52933-2G200	1096
Santa Fe Post-October 2009	10-12	11	7002	7020K	1068	VS1010	—	52933-0W100	VS1010
Santa Fe	13-14	71	7001/HP	7020K	5507	7020K	◆	52933-A5000	VS70
Sonata	07-08	40			1058	2000K	Yellow	52933-3E000	1096
Sonata	11-14	71	7001/HP	7020K	5507	7020K	◆	52933-A5000	VS70
Sonata (Lo-Line) Late 2008-2010	08-10	31-40	7002 or 1206A	7020K or 1100K	1029**	2040K	Lt Blue	52933-2F000	NO
Tiburon	07-08	40	—	—	1058	2000K	Yellow	52933-3E000	1096
Tucson	06-07	40	—	—	1058	2000K	Yellow	52933-3E000	1096
	08-10	—	7002	7020K	1058	2000K	Yellow	52933-3E000	1096
	10-13	31-40	7002 or 1206A	7020K or 1100K	1029**	2040K	Lt Blue	52933-2F000	NO
	14	—	7002	7020K	NEW	VS965	—	52933-2S500	VS965
Veloster	12-14	—	—	—	9505	VS950	NA	52933-2V000	VS950
Veracruz	07-08	40	—	—	1028	2000K	Yellow	52933-4D200	1096
	08-12	40	7002	7020K	1068	2000K	Yellow	52933-2G200	1096
EX35	08-10	35	7001/HP	7020K	9204	1100K	Purple	40700-JK00C	NO
	11-12	35	7003	7020K	1216	1100K	Purple	40700-1LA0E	NO
EX37	13		7003	7020K	1216	1100K	Purple	40700-1LA0E	NO
	03-08	45-60	7001/HP	7020K	9064	1080K	Green	40700-CD001	NO
FX35	11-12	35	7003	7020K	1216	1100K	Purple	40700-1LA0E	NO
	09-10	35	7001/HP	7020K	9204	1100K	Lt Grey	40700-JK00C	NO
FX35 Post-June 2008	09-10	35	7001/HP	7020K	9204	1100K	Lt Grey	40700-JK00C	NO
FX37	13	35	7003	7020K	1216	1100K	Purple	40700-1LA0E	NO

**The 1050K is to be used on the Siemens sensors and the 2030K is to be used on the Schrader sensors. ◆ The 7020K Service Kit is used.
Note: Use "TRW LoLine Fxd Dly" function on BarTec 400 or 400P to program the sensors.

DILL 2014 TPMS APPLICATION GUIDE

Model	Model Year	Torque In-Lbs	Multi-App Sensor	Multi-App Kit	Dill Sensor	Dill Kit	Kit Color	OE Sensor Part #	Valve Stem Repl.	
FX45 <i>Pre-June 2007</i>	03-07	45-60	7001/HP	7020K	9064	1080K	Green	40700-CD001	NO	
FX45 <i>Post-June 2007</i>	07-08	66	7001/HP	7020K	9204	2030K	Lt Grey	40700-JA00C	NO	
FX50	09-10	35	7001/HP	7020K	9204	1100K	Lt Grey	40700-JK00C	NO	
	11-13	35	7003	7020K	1216	1100K	Purple	40700-1LA0E	NO	
G25	11-12	35	7003	7020K	1216	1100K	Purple	40700-1LA0E	NO	
G35	03-06	45-60	7001/HP	7020K	9064	1080K	Green	40700-CD001	NO	
G35 (Sedan)	07-08	35	7001/HP	7020K	9204	1100K	Lt Grey	40700-JK00C	NO	
G35 (Coupe)	08	66	7001/HP	7020K	9204	2030K	Lt Grey	40700-1AA0C	NO	
G37	08-10	35	7001/HP	7020K	9204	1100K	Lt Grey	40700-JK00C	NO	
	11-13	35	7003	7020K	1216	1100K	Purple	40700-1LA0E	NO	
JX35 (433 Mhz)	13	71	—	—	5556	7020K	◆	40700-3JA0A	VS70	
M35	06-07	45-60	7001/HP	7020K	9064	1080K	Green	40700-CD001	NO	
	08-10	66	7001/HP	7020K	9204	2030K	Lt Grey	40700-1AA0C	NO	
M35h	13	—	7003	7020K	1216	1100K	—	40700-1LA0E	NO	
M37	11-13	35	7003	7020K	1216	1100K	—	40700-1LA0E	NO	
M45	03-07	45-60	7001/HP	7020K	9064	1080K	Green	40700-CD001	NO	
	08-10	66	7001/HP	7020K	9204	2030K	Lt Grey	40700-1AA0C	NO	
M56	11-13	35	7003	7020K	1216	1100K	Purple	40700-1LA0E	NO	
Q45 <i>Pre-July 2006</i>	03-06	45-60	7001/HP	7020K	9064	1080K	Green	40700-CD001	NO	
Q45 <i>Post-August 2006</i>	06	66	7001/HP	7020K	9204	2030K	Lt Grey	40700-JA01B	NO	
Q50	14	71	—	—	NEW	7020K	—	40700-4GA0A	VS70	
Q60	14	35	7003	7020K	1216	1100K	—	40700-1LA0E	NO	
QX4	03	45-60	7001/HP	7020K	9064	1080K	Green	40700-CD001	NO	
QX50	14	35	7003	7020K	1216	1100K	—	40700-1LA0E	NO	
QX56	11-13	35	7003	7020K	1216	1100K	Purple	40700-1LA0E	NO	
QX56 <i>Post-April 2007</i>	07-10	66	7001/HP	7020K	9204	2030K	Lt Grey	40700-JA00C	NO	
QX56 (Steel)	05-06	49	7001/HP	7020K	9069	1130K	Burgundy	40700-CK002	NO	
QX56 (Alloy)	04-07	49	7001/HP	7020K	9161	1080K	Green	40700-CK001	NO	
QX60 (433 Mhz)	14	71	—	—	5556	7020K	◆	40700-3JA0A	VS70	
QX70	14	35	7003	7020K	1216	1100K	—	40700-1LA0E	NO	
QX80	14	35	7003	7020K	1216	1100K	—	40700-1LA0E	NO	
ITEC Trucks (433 Mhz)	—		—	—	9010	VS9013 or VS9980	—	—	VS9013 or VS9980	
ISUZU Ascender	06-08	62	7001/HP	7020K	9116	1070K	Blue	25774006	NO	
	I-290	07-08	62	7003	7020K	9131	1110K	Teal	15122618	NO
	I-370	07-08	62	7003	7020K	9131	1110K	Teal	15122618	NO
	Rodeo (433 Mhz)	04	35	7004	7020K	9028	1080K	Green	52088990AC	NO

**The 1050K is to be used on the Siemens sensors and the 2030K is to be used on the Schrader sensors. ◆ The 7020K Service Kit is used.

DILL 2014 TPMS APPLICATION **GUIDE**

Model	Model Year	Torque In-Lbs	Multi-App Sensor	Multi-App Kit	Dill Sensor	Dill Kit	Kit Color	OE Sensor Part #	Valve Stem Repl.	
Jaguar	F (315 Mhz)	14	71	—	—	1045	7020K	—	CSD21601	VS70
	F (433 Mhz)	14	71	—	—	1046	7020K	—	C2D21599	VS70
	Super V8 (315 Mhz)	05-09	71	—	7020K	1055	1050K	—	C2Z15017	NO
	Super V8 (433 Mhz)	05-09	71	—	7020K	1046	1050K	White	C2Z15016	NO
	Vanden Plas (315 Mhz)	04-09	71	—	7020K	1055	1050K	—	C2Z15017	NO
	Vanden Plas (433 Mhz)	04-09	71	—	7020K	1046	1050K	White	C2Z15016	NO
	X Type (315 Mhz)	08	71	—	7020K	1055	1050K	—	C2Z15017	NO
	X Type (433 Mhz)	08	71	—	7020K	1046	1050K	White	C2Z15016	NO
	XF (315 Mhz)	09-10	71	—	7020K	1055	1050K	White	C2Z15017	NO
		11-14	71	—	7020K	1055	7020K	◆	C2C41656	VS70
	XF (433 Mhz)	09-10	71	—	7020K	1046	1050K	White	C2Z15016	NO
		11-14	71	—	7020K	1046	7020K	◆	C2C41655	NO
	XJ (315 Mhz)	04-09	71	—	7020K	1055	1050K	White	C2Z15017	NO
		10-11	71	—	7020K	1055	7020K	◆	C2Z15017	VS70
		12-14	71	—	7020K	1045	7020K	White	C2D21601	NO
	XJ (433 Mhz)	04-09	71	—	7020K	1046	1050K	White	C2Z15016	NO
		10-13	71	—	7020K	1046	7020K	◆	C2D21599	NO
	XK (315 Mhz)	05-10	71	—	7020K	1055	1050K	◆	C2Z15017	NO
		10-14	71	—	7020K	1055	7020K	◆	C2C41656	VS70
	XK (433 Mhz)	05-10	71	—	7020K	1046	1050K	White	C2Z15016	NO
10-14		71	—	7020K	1046	7020K	◆	C2C41655	NO	
Jeep	Cherokee	14	—	—	—	6815	NEW	—	68157568AB	NEW
	Commander	06	71	7001/HP	7020K	1051	1050K	White	56029465AB	NO
		07	71 or 58	7001/HP	7020K	1051 **	1050K or 9066K	White Lt Grey	56029465AB	9066K
		07-10	71 or	7004	7020K	1043 **	1050K or	White Lt Grey	56029359AB	9066K
	Compass	07-09	71	7001/HP	7020K	1051	1050K	White	68001696AB	NO
		10	71 or 58	7001/HP	7020K	1051 **	1050K or 9066K	◆ L	68078861AA	9066K
		11-12	71 or 58	7001/HP	7020K	1051 **	7000K or 9066K	◆ Lt Grey	68078861AA	9066K
		13-14	—	7001-R/ HP-R	VS80	9308	VS950	—	56029479AB	VS950
		13-14	—	—	—	9481	VS950	NA	56029481AB	VS950
	Grand Cherokee	02-04	64	7004	7020K	9028	1080K	Green	52088990AC	NO
		05-06	71	7001/HP	7020K	1051	1050K	White	68001696AB	NO
		07	71 or 58	7001/HP	7020K	1051	1050K or 9066K	White Lt Grey	56029465AB	9066K
		08-10	71 or 58	7004	7020K	1043 **	1050K or 9066K	White Lt Grey	56029359AB	9066K
		11-14	—	—	—	9398	VS950	NA	56029398AB	VS950

**The 1050K is to be used on the Siemens sensors and the 2030K is to be used on the Schrader sensors. ◆ The 7020K Service Kit is used.

DILL 2014 TPMS APPLICATION GUIDE

Model	Model Year	Torque In-Lbs	Multi-App Sensor	Multi-App Kit	Dill Sensor	Dill Kit	Kit Color	OE Sensor Part #	Valve Stem Repl.	
Jeep (cont.)	Grand Cherokee SRT	12-14	53	—	—	9214	9066K	Lt Grey	56029400AE	9066K
	Liberty	02-04	64	7004	7020K	9028	1080K	Green	52088990AC	NO
		05-07	71	7001/HP	7020K	1051	1050K	White	56029465AB	NO
		08-10	71 or 58	7001/HP	7020K	1051**	1050K or 9066K	White	56029465AB	9066K
								Lt Grey		
	11-12	—	7001-R/HP-R	VS80	9308	VS950	NA	56029479AB	VS950	
	Liberty (433 Mhz)	07-09	71 or 58	7004	7020K	1043**	1050K or 9066K	White	56029359AB	9066K
								Lt Grey		
		10-12	—	—	—	9481	VS950	NA	56029481AB	VS950
	Patriot	07-09	71	7001/HP	7020K	1051	1050K	White	68001696AB	NO
		10-12	71 or 58	7001/HP	7020K	1051**	1050K or 9066K	White	56029465AB	9066K
								Lt Grey		
	13-14	—	7001-R/HP-R	VS80	9308	VS950	NA	56029479AB	VS950	
	Patriot (433 Mhz)	12-14	—	—	—	9481	VS950	NA	56029481AB	VS950
	Wrangler	07-10	71 or 58	7001/HP	7020K	1051**	1050K or 9066K	White	56029465AB	9066K
								Lt Grey		
10-12		—	7001-R/HP-R	VS80	9308	VS950	NA	56029479AB	VS950	
Wrangler (433 Mhz)	08-10	71 or 58	7004	7020K	1043**	1050K or 9066K	White	56029359AB	9066K	
							Lt Grey			
	11-12	—	—	—	9481	VS950	NA	56029481AB	VS950	
13-14	—	—	—	9398	VS950	NA	56029398AB	VS950		
KIA	Amanti	07-08	40	—	—	1058	2000K	Yellow	52933-3E000	1096
		09	—	7002	7020K	1058	2000K	Yellow	52933-3E000	1096
	Borrego (Lo-Line)	09	31-40	7002 or 1206A	7020K or 1100K	1029**	2040K	Lt Blue	52933-2F000	NO
	Cadenza	14	71	7001/HP	7020K	5507	7020K	—	52933-A5000	VS70
	Forte	10-13	71	7001/HP	7020K	5507	7020K	◆	52933-2M000	VS70
		14	—	—	—	NEW	VS965	—	52933-A7000	VS965
	Magentis	08-10	40	7002	7020K	1068	2000K	Yellow	52933-2G200	1096
	Mohave	09	31-40	7002 or 1206A	7020K or 1100K	1029**	2040K	Lt Blue	52933-2F000	NO
	Optima	11-14	71	7001/HP	7020K	5507	7020K	◆	52933-2M000/ 52933-2M550	VS70
	Optima (Lo-Line)	06-10	40	7002	7020K	1068	2000K	Yellow	52933-2G200	1096
	Rio5 (Lo-Line)	08-11	31-40	7002 or 1206A	7020K or 1100K	1029**	2040K	Lt Blue	52933-2F000	NO
		12-14	—	7002	7020K	NEW	VS965	Lt Blue	52933-3X200	VS965
	Rondo (Lo-Line)	07-09	40	7002	7020K	1068	2000K	Yellow	52933-2G200	1096
	Sedona (Hi-Line)	06-08	40	—	—	1028	2000K	Yellow	52933-4D200	1096
	Sedona (Lo-Line)	09-14	40	7002	7020K	1068	2000K	Yellow	52933-2G200	1096

**The 1050K is to be used on the Siemens sensors and the 2030K is to be used on the Schrader sensors. ◆ The 7020K Service Kit is used.

DILL 2014 TPMS APPLICATION GUIDE

	Model	Model Year	Torque In-Lbs	Multi-App Sensor	Multi-App Kit	Dill Sensor	Dill Kit	Kit Color	OE Sensor Part #	Valve Stem Repl.
KIA (cont.)	Sorento	05-07	40			1058	2000K	Yellow	52933-3E000	1096
		08-09		7002	7020K	1058	2000K	Yellow	52933-3E000	1096
		11-14	71	7001/HP	7020K	5507	7020K	◆	52933-2M000	VS70
	Soul	10-13	71	7001/HP	7020K	5507	7020K	◆	52933-2M000	VS70
	Soul (433 Mhz)	14	—	—	—	NEW	—	—	52933-B2100	—
	Spectra-5 (Lo-Line)	07-09	31-40	7002 or 1206A	7020K or 1100K	1029**	2040K	Lt Blue	52933-2F000	NO
	Sportage	06-07	40	—	—	1058	2000K	Yellow	52933-3E000	1096
		08		7002	7020K	1058	2000K	Yellow	52933-3E000	1096
		14	—	—	—	NEW	VS965	—	52933-2S500	VS965
	Sportage(Lo-Line)	09-13	31-40	7002 or 1206A	7020K or 1100K	1029**	2040K	Lt Blue	52933-2F000	NO
Tuscany	07-08	40	—	—	1058	2000K	Yellow	Enhanced/Basic	1096	
Land Rover	LR2 (315 Mhz)	08-10	71	—	—	1045	1050K	White	LR032833	NO
		10-14	71	—	—	1045	7020K	◆	LR032833	VS70
	LR2 (433 Mhz)	10-12	71	—	—	1046	7020K	◆	LR018861	VS70
	LR3 (315 Mhz)	06-09	71	—	—	1055	1050K	White	LR018860	NO
	LR3 (433 Mhz)	02-05	58	—	—	9003	1090K	Gray	YDB 0000 60	1092-1095
		06-09	71	—	—	1046	1050K	White	LR018861	NO
	LR4 (315 Mhz)	10-13	71	—	—	1045*	7020K	◆	LR032833	VS70
	LR4 (433 Mhz)	10-14	71	—	—	1046*	7020K	◆	LR018861	VS70
	Evoque (315 Mhz)	11-14	71	—	—	1045	7020K	◆	LR032833	NO
	Range Rover (315 Mhz)	06-09	71	—	—	1055	1050K	White	LR018860	NO
		10-14	71	—	—	1045*	7020K	◆	LR032833	VS70
	Range Rover (433 Mhz)	06-09	71	—	—	1046	1050K	White	LR018861	NO
		10-14	71	—	—	1046*	7020K	◆	LR018861	VS70
	Range Rover Sport (315 Mhz)	06-09	71	—	—	1055	1050K	White	LR021936	NO
		10-14	71	—	—	1045*	7020K	◆	LR032833	VS70
Range Rover Sport (433 Mhz)	06-09	71	—	—	1046	1050K	White	LR018861	NO	
	10-14	71	—	—	1046*	7020K	◆	LR018861	VS70	
Lexus	CT	11-13	35	7002 or 1204A	7020K	1204	1100K	Purple	42607-33021	NO
	ES	07-12	35	7002 or 1204A	7020K	1204	1100K	Purple	42607-33021	NO
		13-14	35	7003	7020K	1218	1100K	Purple	42607-30060	NO
	GS	05-12	35	7002 or 1204A	7020K	1204	1100K	Purple	42607-33021	NO
		13-14	35	7003	7020K	1218	1100K	Purple	42607-30060	NO
	GX	07-14	35	7002 or 1204A	7020K	1204	1100K	Purple	42607-33021	NO
	GX470	04-06	35	7002 or 1204A	7020K	1204	1110K	Teal	42607-35010	NO

*Utilize the VIN on MY 2013-14 vehicles in determining the correct sensor frequency. ◆ The 7020K Service Kit is used.

DILL 2014 TPMS APPLICATION GUIDE

	Model	Model Year	Torque In-Lbs	Multi-App Sensor	Multi-App Kit	Dill Sensor	Dill Kit	Kit Color	OE Sensor Part #	Valve Stem Repl.
Lexus (cont.)	HS Series	11-12	35	7002 or 1204A	7020K	1204	1100K	Purple	42607-75010	NO
	IS Series	06-14	35	7002 or 1204A	7020K	1204	1100K	Purple	42607-33021	NO
	LFA	12	35	7002 or 1204A	7020K	1204	1100K	Purple	42607-33021	NO
	LS	07-12	35	7002 or 1204A	7020K	1204	1100K	Purple	42607-33021	NO
	LS	13-14	35	7003	7020K	1218	1100K	Purple	42607-30060	NO
	LX	05-14	35	7002 or 1204A	7020K	1204	1100K	Purple	42607-33021	NO
	RX	06-14	35	7002 or 1204A	7020K	1204	1100K	Purple	42607-33021	NO
	SC	07-10	35	7002 or 1204A	7020K	1204	1100K	Purple	42607-33021	NO
	SC430	02-06	27	—	—	1217-WH 1217-BL 1217-RD 1217-YL	1120K	Gold	42607-24010 42607-24020 42607-24030 42607-24040	NO
Lincoln	Aviator (433 Mhz)	03-05	44	*7004	7020K	9096	1060K	Rubine Red	4L2T1A150-BA	NO
	Mark LT	07-08	—	7001-R/ HP-R	VS80	1048	NA	NA	6F2Z-1A189A	NO
	MKS	09-10	—	7001-R/ HP-R	VS80	1048	NA	NA	7L1Z-1A189A	NO
		11-14	—	7001-R/ HP-R	VS80	9315	VS950	NA	CM5T-1A150AA	VS950
	MKT	10	—	7001-R/ HP-R	VS80	1048	NA	NA	7L1Z-1A189A	NO
		11-14	—	7001-R/ HP-R	VS80	9315	VS950	NA	CM5T-1A150AA	VS950
	MKT (433 Mhz)	14	—	7004	7020K	NEW	VS950	—	BB5Z-1A189A	VS950
	MKX	07-10	—	7001-R/ HP-R	VS80	1048	NA	NA	7L1Z-1A189A	NO
		11-13	—	7001-R/ HP-R	VS80	9315	VS950	NA	9L3Z-1A189A	VS950
	MKZ	07-09	—	7001-R/ HP-R	VS80	1048	NA	NA	6F2Z-1A189A	NO
		10-14	—	7001-R/ HP-R	VS80	9315	VS950	NA	CM5T-1A150AA	VS950
	Navigator	03-04	44	*7004	7020K	9096	1060K	Rubine Red	4L2T1A150-BA	NO
		05-06	44	7001/HP	7020K	9135	1060K	Rubine Red	5L1Z1A150-AB	NO
		07-10	—	7001-R/ HP-R	VS80	1048	NA	NA	7L1Z-1A189A	NO
		11-14	—	7001-R/ HP-R	VS80	9315	VS950	NA	CM5T-1A150AA	VS950
	Town Car	06-11	—	7001-R/ HP-R	VS80	1048	NA	NA	6F2Z-1A189A	NO

*Redi-Sensor relearn must be performed with scan tool and not magnet.

DILL 2014 TPMS APPLICATION GUIDE

	Model	Model Year	Torque In-Lbs	Multi-App Sensor	Multi-App Kit	Dill Sensor	Dill Kit	Kit Color	OE Sensor Part #	Valve Stem Repl.
Maserati	Quattroporte Thru December 2009	04-09	35	—	—	9001	1090K	—	22 45 49	1092
	Quattroporte Post-January 2010	10-14	40	—	—	9011	1096	—	24 88 87	1096
	Coupe Thru June 2009	09	35	—	—	9001	1090K	—	22 45 49	1092
	Coupe Post-July 2009	09-14	40	—	—	9011	1096	—	24 88 87	1096
Mazda	B Series	07-09	—	7001/HP	7020K	1048	NA	NA	6F2Z-1A189A	NO
	2	11-14	71	7001/HP	7020K	1056	7020K	◆	BHA4-37-140	VS70
	3	04	71	7001/HP	7020K	1056	NA	NA	FE01-37-140A/ GN3A-37-140B	NO
		05-09	71	7001/HP	7020K	1056	1050K	White	BBM2-37-140B	NO
		10-13	71	7001/HP	7020K	1056	7020K	◆	BHA4-37-140	VS70
	5	06-09	71	7001/HP	7020K	1056	1050K	White	BBM2-37-140B	NO
		10-12	71	7001/HP	7020K	1056	7020K	◆	BHA4-37-140	VS70
	6	05-10	71	7001/HP	7020K	1056	1050K	White	BBM2-37-140B	NO
		10-13	71	7001/HP	7020K	1056	7020K	◆	BHA4-37-140	VS70
	CX-7	07-09	71	7001/HP	7020K	1056	1050K	White	BBM2-37-140B	NO
		10-12	71	7001/HP	7020K	1056	7020K	◆	BHA4-37-140	VS70
	CX-9	07-09	71	7001/HP	7020K	1056	1050K	White	BBM2-37-140B	NO
		10-14	71	7001/HP	7020K	1056	7020K	◆	BHA4-37-140	VS70
	MX-5 Miata	06-09	71	7001/HP	7020K	1056	1050K	White	BBM2-37-140B	NO
		10-14	71	7001/HP	7020K	1056	7020K	◆	BHA4-37-140	VS70
	RX8	04	71	7001/HP	7020K	1056	NA	NA	FE01-37-140A/ GN3A-37-140B	NO
		05-09	71	7001/HP	7020K	1056	1050K	White	BBM2-37-140B	NO
		10-11	71	7001/HP	7020K	1056	7020K	◆	BHA4-37-140	VS70
	Speed 3	10-12	71	7001/HP	7020K	1056	7020K	◆	BHA4-37-140	VS70
	Speed 6	07-08	71	7001/HP	7020K	1056	1050K	White	BBM2-37-140B	NO
Tribute	06-08	—	7001/HP	7020K	1048	NA	NA	6F2Z-1A189A	NO	
	09-11	—	7001-R/ HP-R	VS80	9315	VS950	NA	9L3Z-1A189A	VS950	
Mercedes-Benz	C Class (433 Mhz)	07-14	53	—	—	9214	2030K	Lt Grey	000 905 7200	9066K
	CLA	14	53	—	—	9214	2030K	—	000 905 7200	9066K
	CL Class (315 Mhz)	00-06	35	—	—	9004	1090K	Gray	000 822 34 06	1094
	CL Class (433 Mhz)	00-06	35	—	—	9001	1090K	Gray	000 822 3306	1094
		09-14	53	—	—	9214	2030K	Lt Grey	000 905 7200	9066K
	CL 63-65-550-600 (315 Mhz)	07-11	53	7003	7020K	1054	1040K	Pantone Brown	002 540 7917	1040K
	CL 63-65-550-600 (433 Mhz)	07-11	53	—	—	1049	1040K	Pantone Brown	002 540 8017	1040K
	CLK Class (315 Mhz)	06-07	35	—	—	9004	1090K	Gray	000 822 34 06	1094
	CLK Class (433 Mhz)	08-09	53	—	—	9214	2030K	Lt Grey	000 905 4100	9066K
	CLS 55-63-500-550 (315 Mhz)	06-11	53	7003	7020K	1054	1040K	Pantone Brown	002 540 7917	1040K

*Redi-Sensor relearn must be performed with scan tool and not magnet. ◆ The 7020K Service Kit is used.

DILL 2014 TPMS APPLICATION GUIDE

Model	Model Year	Torque In-Lbs	Multi-App Sensor	Multi-App Kit	Dill Sensor	Dill Kit	Kit Color	OE Sensor Part #	Valve Stem Repl.
CLS 55-63-500-550 (433 Mhz)	06-09	53	—	—	1049	1040K	Pantone Brown	002 540 8017	1040K
CLS Class (433 Mhz)	08-14	53	—	—	9214	2030K	Lt Grey	000 905 4100	9066K
	11	53	—	—	1049	1040K	Pantone Brown	002 540 8017	1040K
E Class (315 Mhz)	00-05	35	—	—	9004	1090K	Gray	000 822 34 06	1094
	06-10	53	7003	7020K	1054	1040K	Pantone Brown	002 540 7917	1040K
E Class (433 Mhz)	00-05	35	—	—	9001	1090K	Gray	000 822 33 06	1094
	06-10	53	—	—	1049	1040K	Pantone Brown	002 540 8017	1040K
	10-14	53	—	—	9214	2030K	Lt Grey	000 905 7200	9066K
G Class (433 Mhz)	07-14	53	—	—	9214	2030K	Lt Grey	000 905 4100	9066K
GL (433 Mhz)	10-14	53	—	—	9214	2030K	Lt Grey	000 905 7200	9066K
GL Class (315 Mhz)	07-09	53	7003	7020K	1054	1040K	Pantone Brown	002 540 7917	1040K
GL Class (433 Mhz)	07-09	53	—	—	1049	1040K	Pantone Brown	002 540 8017	1040K
GLK (433 Mhz)	10-14	53	—	—	9214	2030K	Lt Grey	000 905 7200	9066K
ML Class (315 Mhz)	06-10	53	7003	7020K	1054	1040K	Pantone Brown	002 540 7917	1040K
ML Class (433 Mhz)	06-10	53	—	—	1049	1040K	Pantone Brown	002 540 8017	1040K
	10-14	53	—	—	9214	2030K	Lt Grey	000 905 7200	9066K
	12	35	—	—	9214	2030K	Lt Grey	000 905 4100	9066K
R Class (315 Mhz)	06-09	53	7003	7020K	1054	1040K	Pantone Brown	002 540 7917	1040K
R Class (433 Mhz)	06-09	53	—	—	1049	1040K	Pantone Brown	002 540 8017	1040K
	10	35	—	—	9214	2030K	Lt Grey	000 905 4100	9066K
	11	53	—	—	1049	1040K	Pantone Brown	002 540 8017	1040K
	12	35	—	—	9214	2030K	Lt Grey	000 905 4100	9066K
S (433 Mhz)	10-14	53	—	—	9214	2030K	Lt Grey	000 905 4100	9066K
S Class (315 Mhz)	00-06	35	—	—	9004	1090K	Gray	000 822 34 06	1094
	07-11	53	7003	7020K	1054	1040K	Pantone Brown	002 540 7917	1040K
S Class (433 Mhz)	00-06	35	—	—	9001	1090K	Gray	000 822 33 06	1094
	07-10	53	—	—	1049	1040K	Pantone Brown	002 540 8017	1040K
SL Class (315 Mhz)	00-05	35	—	—	9004	1090K	Gray	000 822 34 06	1094
	06-12	53	7003	7020K	1054	1040K	Pantone Brown	002 540 7917	1040K
SL Class (433 Mhz)	00-05	35	—	—	9001	1090K	Gray	000 822 33 06	1094
	06-09	53	—	—	1049	1040K	Pantone Brown	002 540 8017	1040K
	13-14	53	—	—	9214	2030K	Lt Grey	000 905 7200	9066K
SLK Class (433 Mhz)	08-14	53	—	—	9214	2030K	Lt Grey	000 905 7200	9066K
SLR Class (315 Mhz)	04-06	35	—	—	9004	1090K	Gray	000 822 34 06	1094
	08-09	53	7003	7020K	1054	1040K	Pantone Brown	002 540 7917	1040K

*Redi-Sensor relearn must be performed with scan tool and not magnet.

DILL 2014 TPMS APPLICATION GUIDE

	Model	Model Year	Torque In-Lbs	Multi-App Sensor	Multi-App Kit	Dill Sensor	Dill Kit	Kit Color	OE Sensor Part #	Valve Stem Repl.
Mercedes-Benz (cont.)	SLR Class (433 Mhz)	00-06	35	—	—	9001	1090K	Gray	000 822 33 06	1094
		08-09	53	—	—	1049	1040K	Pantone Brown	002 540 8017	1040K
	SLS (433 mhz)	11-14	53	—	—	9214	2030K	Lt Grey	000 905 7200	9066K
	Sprinter	07-13	54	—	—	1042	1098K	Reddish / Purple	68038945AA	1098K
		14	—	—	—	9214	2030K	Lt Grey	000 905 7200	9066K
Mercury	Grand Marquis	07-10	—	7001-R/HP-R	VS80	1048	NA	NA	6F2Z-1A189A	NO
	Mariner	06-08	—	7001-R/HP-R	VS80	1048	NA	NA	6F2Z-1A189A	NO
		09-11	—	7001-R/HP-R	VS80	9315	VS950	NA	9L3Z-1A189-A	VS950
	Milan	08-09	—	7001-R/HP-R	VS80	1048	NA	NA	6F2Z-1A189A	NO
		10-11	—	7001-R/HP-R	VS80	9315	VS950	NA	9L3Z-1A189-A	VS950
	Montego	06-07	—	7001-R/HP-R	VS80	1048	NA	NA	6F2Z-1A189A	NO
	Monterey	04-05	44	7001/HP	7020K	9135	1060K	Rubine Red	5L1Z1A150-AB	NO
		06-07	—	7001-R/HP-R	VS80	1048	NA	NA	6F2Z-1A189A	NO
	Mountaineer	02-05	44	7004	7020K	9096	1060K	Rubine Red	4L2T1A150-BA	NO
		06-10	—	7001-R/HP-R	VS80	1048	NA	NA	6F2Z-1A189A	NO
	Sable	08-09	—	7001-R/HP-R	VS80	1048	NA	NA	7L1Z-1A189A	NO
	Mini	All (433 Mhz)	07-09	35	—	—	1027	1090K	Gray	36 23 6 781 847
All (433 Mhz) September 2009		10-14	40	—	—	9012	1096	Yellow	36 10 6 856 227	1096
Mitsubishi	Eclipse (Alloy)	06-12	45-53	7001HP	7020K	9034	1080K	Green	425 0B 877	NO
	Eclipse (Steel)	06-07	45-53	7001/HP	7020K	9069	1130K	Burgundy	4250A030	NO
	Endeavor Pre-September 2006	04-06	45-53	7004	7020K	9028	1080K	Green	MN103033	NO
	Endeavor Post-September 2006	06-12	45-53	7001/HP	7020K	9034	1080K	Green	425 0B 877	NO
	Galant	04-06	45-53	7004	7020K	9028	1080K	Green	MN103033	NO
	Galant (Alloy)	07-12	45-53	7001/HP	7020K	9034	1080K	Green	425 0B 877	NO
	Galant (Steel)	07-12	45-53	7001/HP	7020K	9069	1130K	Burgundy	425 0B 875	NO
	i-MiEV	12-13	—	—	—	**	7020K	White	425 0B 975	VS70
	Lancer**	08-10	71	—	—	**	1050K	White	425 0B 975	NO
		10-14	71	—	—	**	7020K	◆	425 0B 975	VS70
	Mirage	14	—	—	—	NEW	VS90	—	425 0C 276	VS90
	Mirage Post-September 2013	14	—	—	—	**	7020K	—	425 0B 975	VS70
Montero	03-05	45-53	7001/HP	7020K	9034	1080K	Green	MN103081	NO	

*Redi-Sensor relearn must be performed with scan tool and not magnet. **See dealer for replacement sensor and relearn. ◆ The 7020K Service Kit is used.

DILL 2014 TPMS APPLICATION GUIDE

	Model	Model Year	Torque In-Lbs	Multi-App Sensor	Multi-App Kit	Dill Sensor	Dill Kit	Kit Color	OE Sensor Part #	Valve Stem Repl.
Mitsubishi (cont.)	Outlander**	07-10	71	—	—	**	1050K	White	425 0B 975	NO
		10-14	71	—	—	**	7020K	◆	425 0B 975	VS70
	Outlander Sport	14	—	—	—	**	7020K	◆	425 0B 975	VS70
	Raider	08-09	53	7001/HP	7020K	9154	9066K	Lt Grey	56029319AB	9066K
Nissan	350Z	04-06	45-60	7001/HP	7020K	9064	1080K	Green	40700-CD001	NO
		07-09	50-70	7001/HP	7020K	9204	2030K	Lt Grey	40700-JA00C	NO
	370Z	08-10	35	7001/HP	7020K	9204	1100K	Lt Grey	40700-JK00C	NO
		11-14	35	7003	7020K	1216	1100K	Purple	40700-1LA0E	NO
	Altima	06-11	50-70	7001/HP	7020K	9204	2030K	Lt Grey	40700-1AA0D	NO
		12	71	7001/HP	7020K	5555	7020K	◆	40700-3AN0A	VS70
	Altima (433 Mhz)	13-14	71	—	—	5556	7020K	◆	40700-3JA0A	VS70
	Altima Coupe	13	71	7001/HP	7020K	5555	7020K	◆	40700-3AN0A	VS70
	Armada (Alloy)-SE	05-08	49	7001/HP	7020K	9161	1080K	Green	40700-CK001	NO
	Armada (Steel)	05-06	49	7001/HP	7020K	9069	1130K	Burgundy	40700-CK002	NO
	Armada-LE	09-14	50-70	7001/HP	7020K	9204	2030K	Lt Grey	40700-1AA0D	NO
	Cube Pre-November 2011	09-12	50-70	7001/HP	7020K	9204	2030K	Lt Grey	40700-1AA0D	NO
	Cube-1.8 & 1.8 S CVT 11/11-3/12	12	—	7001/HP	7020K	9204	2030K	Lt Grey	40700-1AA0D	NO
	Cube-1.8 SL 10/10-11/11	11-12	—	—	—	5557	7020K	◆	40700-3AN1A	VS70
	Cube-1.8 & 1.8S 3/12-9/13	12-13	35	7001/HP	7020K	9204	1100K	—	40700-JK01B	NO
	Cube-1.8 S CVT Post-November 2011	12-14	—	7003	7020K	1216	1100K	Purple	40700-1LA0E	NO
	Frontier	03-04	45-60	7001/HP	7020K	9064	1080K	Green	40700-CD001	NO
	Frontier (Alloy)	05-08	49	7001/HP	7020K	9161	1080K	Green	40700-CK001	NO
	Frontier (Steel)	05-07	49	7001/HP	7020K	9069	1130K	Burgundy	40700-CK002	NO
	Frontier 5/08-10/13	09-13	50-70	7001/HP	7020K	9204	2030K	Lt Grey	40700-1AA0D	NO
	Frontier 1/12-10/13	11-13	71	7001/HP	7020K	5555	7020K	◆	40700-3AN0A	VS70
	GT-R	09-14	50-70	7001/HP	7020K	9204	2030K	Lt Grey	40700-1AA0D	NO
	Juke (With I-Key) 7/11-9/11	11	—	—	—	5557	7020K	◆	40700-3AN1A	VS70
Juke (With I-Key) Post-February 2012	12-14	—	7003	7020K	1216	1100K	Purple	40700-1LA0E	NO	
Juke Base (Without I-Key) Pre-March 2012	11	50-70	7001/HP	7020K	9204	2030K	Lt Grey	40700-1AA0D	NO	
Juke Base (Without I-Key) Post-March 2012	12-14	35	7001/HP	7020K	9204	1100K	—	40700-JK01B	NO	
Juke SV & SL (With I-Key) 7/10-7/11	11	—	7003	7020K	1216	1100K	Purple	40700-1LA0E	NO	
Leaf	11-13	35	7003	7020K	1216	1100K	Purple	40700-1LA0E	NO	
Leaf Post-December 2012	13-14	71	—	—	5557	7020K	◆	40700-3AN1A	VS70	

The 1050K is to be used on the Siemens sensors and the 1070K is to be used on the Schrader sensors. **See dealer for replacement sensor and relearn. ◆ The 7020K Service Kit is used.

DILL 2014 TPMS APPLICATION GUIDE

Model	Model Year	Torque In-Lbs	Multi-App Sensor	Multi-App Kit	Dill Sensor	Dill Kit	Kit Color	OE Sensor Part #	Valve Stem Repl.
Maxima	06-07	49	7001/HP	7020K	9161	1080K	Green	40700-CK001	NO
	07-12	50-70	7001/HP	7020K	9204	2030K	Lt Grey	40700-1AA0D	NO
	12-14	71	7001/HP	7020K	5555	7020K	◆	4070-3AN0A	VS70
Murano	03-06	45-60	7001/HP	7020K	9064	1080K	Green	40700-CD001	NO
	07-12	50-70	7001/HP	7020K	9204	2030K	Lt Grey	40700-1AA0D	NO
Murano <i>Pre-November 2011</i>	12-14	35	7001/HP	7020K	9204	1100K	—	40700-JK01B	NO
NV200	13-14	50-70	7001/HP	7020K	9204	2030K	—	40700-1AA0D	NO
NV -1500/2500HD/3500HD	12-14	50-70	—	—	NEW	2030K	Lt Grey	40700-1PA0A	
Pathfinder	03-04	45-60	7001/HP	7020K	9064	1080K	Green	40700-CD001	NO
	05-06	49	7001/HP	7020K	9161	1080K	Green	40700-CK001	NO
	07-12	50-70	7001/HP	7020K	9204	2030K	Lt Grey	40700-1AA0D	NO
Pathfinder (433 Mhz)	13-14	71	—	—	5556	7020K	◆	40700-3JA0A	VS70
Pathfinder (Steel)	04	49	7001/HP	7020K	9069	1130K	Burgundy	40700-CK002	NO
Quest	07-09	50-70	7001/HP	7020K	9204	2030K	Lt Grey	40700-1AA0D	NO
	11-14	35	7003	7020K	1216	1100K	Purple	40700-1LA0E	NO
Quest (Steel)	04-07	49	7001/HP	7020K	9069	1130K	Burgundy	40700-CK002	NO
Quest (Alloy)	05-06	78	7001/HP	7020K	9161	1080K	Green	40700-CK001	NO
Rogue	08-11	50-70	7001/HP	7020K	9204	2030K	Lt Grey	40700-1AA0D	NO
Rogue <i>Post-November 2011</i>	12-13	35	7001/HP	7020K	9204	1100K	—	40700-JK01B	NO
Rogue (433 Mhz)	14	—	—	—	NEW	7020K	—	40700-3VU0A	VS70
Sentra	07-12	50-70	7001/HP	7020K	9204	2030K	Lt Grey	40700-1AA0D	NO
Sentra <i>Post-January 2012</i>	12-13	35	7001/HP	7020K	9204	1100K	—	40700-JK01B	NO
Sentra (Without I-Key) <i>Post-September 2012</i>	13-14	71	7001/HP	7020K	5555	7020K	◆	40700-3AN0A	VS70
Sentra (With I-Key) <i>Post-December 2012</i>	13-14	71	—	—	5557	7020K	—	40700-3AN1A	VS70
Sentra (Alloy)	07-08	75	7001/HP	7020K	9161	1080K	Green	40700-CK001	NO
Titan <i>Post-April</i>	07-14	50-70	7001/HP	7020K	9204	2030K	Lt Grey	40700-1AA0D	NO
Titan (Alloy)	05-07	49	7001/HP	7020K	9161	1080K	Green	40700-CK001	NO
Titan (Steel)	04-05	49	7001/HP	7020K	9069	1130K	Burgundy	40700-CK002	NO
Versa <i>December 2011</i>	07-11	50-70	7001/HP	7020K	9204	2030K	Lt Grey	40700-1AA0D	NO
Versa Sedan	12	71	7001/HP	7020K	5555	7020K	◆	40700-3AN0A	VS70
Versa Sedan-Low/Base	13-14	—	7001/HP	7020K	5555	7020K	◆	40700-3AN0A	VS70
Versa Sedan-Mid	13-14	—	—	—	5557	7020K	—	40700-3AN1A	VS70
Versa Hatchback <i>Post-January 2012</i>	12	—	7001/HP	7020K	9204	1100K	—	40700-JK01B	NO
Versa Note-S & SV	14	—	7001/HP	7020K	5555	7020K	◆	40700-3AN0A	VS70
Versa Note-SL	14	—	—	—	5557	7020K	—	40700-3AN1A	VS70
Xterra	03-04	45-60	7001/HP	7020K	9064	1080K	Green	40700-CD001	NO
	05-06	49	7001/HP	7020K	9161	1080K	Green	40700-CK001	NO

Nissan (cont.)

DILL 2014 TPMS APPLICATION GUIDE

	Model	Model Year	Torque In-Lbs	Multi-App Sensor	Multi-App Kit	Dill Sensor	Dill Kit	Kit Color	OE Sensor Part #	Valve Stem Repl.	
Nissan (cont.)	Xterra <i>Pre-October 2013</i>	07-12	50-70	7001/HP	7020K	9204	2030K	Lt Grey	40700-1AA0D	NO	
	Xterra (Steel)	06-07	49	7001/HP	7020K	9069	1130K	Burgundy	40700-CK002	NO	
	Xterra Pro-S-4X <i>12/12-10/13</i>	13	71	7001/HP	7020K	5555	7020K	◆	40700-3AN0A	VS70	
Pontiac	G3	09	—	—	—	9153	VS950	NA	25920615	VS950	
	G5	08	71	7001/HP	7020K	NA	1050K	White	15921013	NO	
		09-10	—	7001-R/ HP-R	VS80	9153	VS950	NA	25920615	VS950	
	G6 <i>Pre-October 15, 2007</i>	08	71	7001/HP	7020K	NA	1050K	White	15921013	NO	
	G6 <i>Post-October 15, 2007</i>	08-10	—	7001-R/ HP-R	VS80	9153	VS950	NA	25920615	VS950	
	G8	08-09	—	7001-R/ HP-R	VS80	9153	VS950	NA	25920615	VS950	
		Grand Prix	07-08	71	7001/HP	7020K	NA	1050K	White	15921013	NO
	Montana	08	62	7001/HP	7020K	9158	1070K	White	15268606	NO	
								Blue			
	Solstice	08-09	71	7001/HP	7020K	NA	1050K	White	15921013	NO	
	Torrent	07-09	71	7001/HP	7020K	NA	1050K	White	10394110	NO	
	Vibe	08-10	35	1204A	1100K	1204	1100K	Purple	88974915	NO	
	Wave	08	—	—	—	9153	VS950	NA	25920615	VS950	
	Porsche	911 Carrera (315 Mhz)	05-08	31-40	—	—	9004	1090K	Gray	997 606 023 21	1092
		911 Carrera (433 Mhz)	05-08	31-40	—	—	9001	1090K	Gray	997 606 021 01	1092
12-14			40	—	—	9011	1096	Yellow	958 361 661 00	1096	
911 Carrera (433 Mhz) <i>Post-April 2008</i>		09-11	31-40	—	—	9008 or 9011	1090K	Gray	997 606 021 20	1092	
911 Turbo (315 Mhz)		07-09	31-40	—	—	9004	1090K	Gray	997 606 023 21	1092	
		10-14	—	—	—	NEW	—	—	—	—	
911 Turbo (433 Mhz)		07-09	31-40	—	—	9001	1090K	Gray	997 606 021 01	1092	
		10-14	40	—	—	9011	1096	Yellow	958 361 661 00	1096	
Boxster (315 Mhz)		05-08	31-40	—	—	9004	1090K	Gray	997 606 023 21	1092	
Boxster (315 Mhz) <i>Post-November 2008</i>						NEW	—	—	—	—	
Boxster (433 Mhz)		05-08	31-40	—	—	9001	1090K	Gray	997 606 021 01	1092	
		12-14	40	—	—	9011	1096	Yellow	958 361 661 00	1096	
Boxster (433 Mhz) <i>Thru July 2011</i>		09-11	31-40	—	—	9008 or 9011	1090K	Gray	997 606 021 20	1092	
Carrera GT (315 Mhz)		04-06	31-40	—	—	9004	1090K	Gray	997 606 023 21	1092	
Carrera GT (433 Mhz)		03-06	31-40	—	—	9001	1090K	Gray	997 606 021 01	1092	
Cayenne (315 Mhz)	09-10	31-40	—	—	9004	1090K	Gray	955 606 023 01	1092		

The 1050K is to be used on the Siemens sensors and the 1070K is to be used on the Schrader sensors. ◆ The 7020K Service Kit is used.

DILL 2014 TPMS APPLICATION GUIDE

	Model	Model Year	Torque In-Lbs	Multi-App Sensor	Multi-App Kit	Dill Sensor	Dill Kit	Kit Color	OE Sensor Part #	Valve Stem Repl.
Porsche (cont.)	Cayenne (433 Mhz)	03-06	31-40	—	—	9005	1090K	Gray	955 361 661 01	1092
		07-10	31-40	—	—	9007 or 9011	1090K	Gray	955 606 021 00	1092
		11-14	40	—	—	9011	1096	Yellow	958 361 661 00	1096
	Cayman (315 Mhz)	05-08	31-40	—	—	9004	1090K	Gray	997 606 023 21	1092
		09-14			—	—	NEW	—		
	Cayman (433 Mhz)	05-08	31-40	—	—	9001	1090K	Gray	997 606 021 01	1092
		09-10	31-40	—	—	9008 or 9011	1090K	Gray	997 606 021 20	1092
		11-14	40	—	—	9011	1096	Yellow	958 361 661 00	1096
	997 GT3 (315 Mhz)	07-09	31-40	—	—	9004	1090K	Gray	997 606 023 21	1092
		10-14			—	—	NEW	—		
	997 GT3 (433 Mhz)	07-09	31-40	—	—	9001	1090K	Gray	997 606 021 01	1092
		10-14	40	—	—	9011	1096	Gray	958 361 661 00	1096
	Panamera (315 Mhz)	10-14	31-40	—	—	9004	1090K	Gray	997 606 023 21	1092
Panamera (433 Mhz)	10-11	31-40	—	—	9008 or 9011	1090K	Gray	997 606 021 20	1092	
	12-13	40	—	—	9011	1096	Gray	958 361 661 00	1096	
	14	—	—	—	9018	1096	—	500 907 275	1096	
Rolls Royce	Cabrio (433 Mhz)	10-12	31-40	—	—	1027	1090K	Gray	NA	1092 or 1094
		07-11	31-40	—	—	1027	1090K	Gray	NA	1092 or 1094
	12-14	40	—	—	9012	1096	Yellow	36 10 6 856 227	1096	
Saab	9-3 (433 Mhz)	04-07	62	—	—	9078	2010K	Lt Brown	13172567	NO
		08-12	88	—	—		2010K	Lt Brown	13227143	NO
	9-5 (433 Mhz)	04-07	62	—	—	9078	2010K	Lt Brown	13172567	NO
		08-12	88	—	—	—	2010K	Lt Brown	13227143	NO
	9-7X (315 Mhz)	05-09	62	7001/HP	7020K	9116	1070K	Blue	25774006	NO
Saturn	Astra (433 Mhz)	08-09	62			9078	2010K	Lt Brown	13172567	NO
	Aura Pre-October 14, 2007	07-08	71	7001/HP	7020K	NA	1050K	White	15921013	NO
	Aura Post-October 14, 2007	08-09	—	7001-R/HP-R	VS80	9153	VS950	NA	25920615	VS950
	Lamda Crossover	07-08	80	7001/HP	7020K	9158	1070K	White	15268606	NO
								Blue		
	Outlook	07-08	71	7001/HP	7020K	NA	1050K	White	15921013	NO
		09-10	—	7001-R/HP-R	VS80	9153	VS950	NA	25920615	VS950
	Sky	08-09	71	7001/HP	7020K	NA	1050K	White	15921013	NO
Vue	07-10	—	7001-R/HP-R	VS80	9153	VS950	NA	25920615	VS950	

The 1050K is to be used on the Siemens sensors and the 1070K is to be used on the Schrader sensors.

DILL 2014 TPMS APPLICATION GUIDE

	Model	Model Year	Torque In-Lbs	Multi-App Sensor	Multi-App Kit	Dill Sensor	Dill Kit	Kit Color	OE Sensor Part #	Valve Stem Repl.
Scion	tC	06-14	35	7002 or 1204A	7020K	1204	1100K	Purple	42607-33011	NO
	FR-S	13-14	35	7003	7020K	1218	1100K	Purple	SU003-00754	NO
	iQ	12-14	35	7002 or 1204A	7020K	1204	1100K	Purple	42607-33011	NO
	xB	08-14	35	7002 or 1204A	7020K	1204	1100K	Purple	42607-33011	NO
	xD	08-14	35	7002 or 1204A	7020K	1204	1100K	Purple	42607-33011	NO
Smart	Fortwo (433 Mhz)	08	53	—	—	1049	1040K	Pantone Brown	004 542 1518	1040K
		08-14	53	—	—	9214	2030K	Lt Grey	000 905 7200	9066K
Subaru	B9 Tribeca	06-07	66	7003	7020K	9081	1080K	Green	28103AG00A	NO
	BRZ	13-14	35	7003	7020K	1218	1100K	Purple	28103-CA000	NO
	Forester	08-14	—	7003	7020K	9203	VS950	NA	28103AG01C	VS950
	Impreza	08-13	—	7003	7020K	9203	VS950	NA	28103AG01C	VS950
	Legacy	04-07	66	7003	7020K	9081	1080K	Green	28103AG00A	NO
		08-14	—	7003	7020K	9203	VS950	NA	28103AG01C	VS950
	Outback	04-07	66	7003	7020K	9081	1080K	Green	28103AG00A	NO
		08-14	—	7003	7020K	9203	VS950	NA	28103AG01C	VS950
	Tribeca	08-14	—	7003	7020K	9203	VS950	NA	28103AG01C	VS950
	XV Crosstrek	13-14	—	7003	7020K	9203	VS950	NA	28103AG01C	VS950
	Suzuki	Equator	09-13	68	7001/HP	7020K	9204	2030K	Lt Grey	43211-82Z10
Forenza		07-08	—	7001-R/HP-R	VS80	9153	VS950	NA	43130-85Z03	VS950
Grand Vitara		07-13	80	—	—	9087	2010K	Lt Brown	43130-54J21	NO
Kizashi		10-13	71	7001/HP	7020K	1051	7020K	◆	43130-57L00	VS70
Reno		07-08	—	7001-R/HP-R	VS80	9153	VS950	NA	43130-85Z00	VS950
SX4		07-13	80	—	—	9087	2010K	Lt Brown	43130-54J21	NO
Verona		05-06	80	—	—	9082	2010K	Lt Brown	43130-86Z20	NO
XL-7		05-06	80	—	—	9087	2010K	Lt Brown	43130-54J21	NO
	07-09	71	7001/HP	7020K	NA	1050K	White	43130-78J10	NO	
Tesla	ALL**	10-13	40-50	—	—	2112	2020K	Pink	6004985	TP416
Toyota	4 Runner	03-14	35	7002 or 1204A	7020K	1204	1110K	Teal	42607-33021	NO
	Avalon	07-13	35	7002 or 1204A	7020K	1204	1100K	Purple	42607-06011/33011	NO
	Avalon Post-November 2012	13	35	7003	7020K	1218	1100K	Purple	42607-06020	NO
	Camry	07-11	35	7002 or 1204A	7020K	1204	1100K	Purple	42607-06011/33011	NO
		12-14	35	7003	7020K	1218	1100K	Purple	42607-06020	NO

**For vehicle relearns, must utilize a Tesla relearn tool. ◆ The 7020K Service Kit is used.

DILL 2014 TPMS APPLICATION
GUIDE

Model	Model Year	Torque In-Lbs	Multi-App Sensor	Multi-App Kit	Dill Sensor	Dill Kit	Kit Color	OE Sensor Part #	Valve Stem Repl.
Corolla	07-13	35	7002 or 1204A	7020K	1204	1100K	Purple	42607-06011/ 33011/33021	NO
Corolla <i>Post-August 2013</i>	13-14	35	7003	7020K	1218	1100K	Purple	42607-06020	NO
FJ Cruiser	08-14	35	7002 or 1204A	7020K	1204	1100K	Purple	42607-33011	NO
Highlander	07-14	35	7002 or 1204A	7020K	1204	1100K	Purple	42607-06011	NO
Highlander (Smart Key) <i>Post-January 2014</i>	14	35	7003	7020K	1218	1100K	Purple	42607-06020	NO
Highlander-RKE (Made in Canada) <i>Post-January 2014</i>	14	35	—	—	NEW	—	—	42607-0R010	—
Land Cruiser	05-14	35	7002 or 1204A	7020K	1204	1100K	Purple	42607-33011	NO
Matrix	07-13	35	7002 or 1204A	7020K	1204	1100K	Purple	42607- 06011/33011	NO
Prius	06-13	35	7002 or 1204A	7020K	1204	1100K	Purple	42607-06011	NO
Prius C	12-14	35	7003	7020K	1218	1100K	Purple	42607-06020	NO
Prius V	12-14	35	7002 or 1204A	7020K	1204	1100K	Purple	42607-33011	NO
RAV 4	06-13	35	7002 or 1204A	7020K	1204	1100K	Purple	42607-06011	NO
RAV 4 (Smart Key) <i>Post-January 2014</i>	13-14	35	7003	7020K	1218	1100K	Purple	42607-06020	NO
RAV 4-RKE (Made in Canada) <i>Post-January 2013</i>	13-14	35	—	—	NEW	—	—	42607-0R010	—
Sequoia (20 Degrees)	04-07	35	7002 or 1204A	7020K	1204	1110K	Teal	42607-0C020	NO
	08-14	35	7002 or 1206A	7020K	1206	1110K	Teal	42607- 0C070/08010	NO
Sequoia (40 Degrees)	04-07	35	7002 or 1204A	7020K	1203	1110K	Teal	42607-0C010	NO
	08	35	7002 or 1206A	7020K	1206	1110K	Teal	42607-0C060	NO
Sienna (20 Degrees)	06-14	35	7002 or 1206A	7020K	1206	1110K	Teal	42607- 0C070/08010	NO
Solara	06-08	35	7002 or 1204A	7020K	1204	1100K	Purple	42607-06011	NO

Toyota (cont.)

DILL 2014 TPMS APPLICATION GUIDE

	Model	Model Year	Torque In-Lbs	Multi-App Sensor	Multi-App Kit	Dill Sensor	Dill Kit	Kit Color	OE Sensor Part #	Valve Stem Repl.
Toyota (cont.)	Tacoma (20 Degrees)	05-06	35	7002 or 1204A	7020K	1204	1110K	Teal	42607-0C020/ AD020	NO
		07-14	35	7002 or 1204A	7020K	1204	1100K	Purple	42607-06011	NO
	Tacoma (40 Degrees)	05-14	35	7002 or 1204A	7020K	1203	1110K	Teal	42607-0C010/ AD010/04010	NO
	Tundra (20 Degrees)	05-06	35	7002 or 1204A	7020K	1204	1110K	Teal	42607-0C020	NO
		06-14	35	7002 or 1206A	7020K	1206	1110K	Teal	42607- 0C070/08010	NO
	Tundra (40 Degrees)	05-06	35	7002 or 1204A	7020K	1203	1110K	Teal	42607-0C010	NO
		06-11	35	7002 or 1206A	7020K	1206	1110K	Teal	42607-0C060	NO
	Venza	09-14	35	7002 or 1204A	7020K	1204	1100K	Purple	42607-06011	NO
	Yaris	07-11	35	7002 or 1204A	7020K	1204	1100K	Purple	42607-33011	NO
Yaris	12-14	35	7003	7020K	1218	1100K	Purple	42607-06020	NO	
Volkswagen	Beetle	08-10	71	7003	7020K	1053	1030K	Orange	1K0907253D	NO
	CC	09-10	71	7003	7020K	1053	1030K	Orange	1K0907253D	NO
		11-14	40	—	—	9013	1096	Yellow	3AA 907 275D	1096
	EOS	07-14	71	7003	7020K	1053	1030K	Orange	1K0907253D	NO
	GLI	08-09	71	7003	7020K	1053	1030K	Orange	1K0907253D	NO
	Golf	10-11	71	7003	7020K	1053	1030K	Orange	1K0907253D	NO
	GTI (Standard Hex)	06-11	71	7003	7020K	1053	1030K	Orange	1K0907253D	NO
	GTI (O-ring Hex)	06-07	71	7003	7020K	1041	1031K	Lt Green	1K0907253E	NO
	Jetta (Standard Hex)	06-11	71	7003	7020K	1053	1030K	Orange	1K0907253D	NO
	Jetta Sportwagen	13	40	—	—	9018	1096	Yellow	5Q0 907 275	1096
	Passat CC (Standard Hex)	06-10	71	7003	7020K	1053	1030K	Orange	1K0907253D	NO
	Passat (433 Mhz)	12-13	40	—	—	9013	1096	Yellow	3AA 907 275D	1096
	Passat (O-ring Hex)	06-08	71	7003	7020K	1041	1031K	Lt Green	1K0907253E	NO
	Phaeton (315 Mhz)	03 -07	35	—	—	9004	1090K	Gray	4D0 907 275A	1092
	Phaeton (433 Mhz) Thru May 2007	02-07	35	—	—	9001	1090K	Gray	4D0 907 275C	1092
	Phaeton (433 Mhz) June 2007	07-10	35	—	—	9007 or 9011	1090K	Gray	4F0 907 275B	1092
	Phaeton (433 Mhz) Post-June 2010	11-13	40	—	—	9011	1096	Yellow	4F0 907 275D	1096
	R32	08	71	7003	7020K	1053	1030K	Orange	1K0907253D	NO
	Rabbit (Standard Hex)	06-09	71	7003	7020K	1053	1030K	Orange	1K0907253D	NO
	Rabbit (O-ring Hex)	06-07	71	7003	7020K	1041	1031K	Lt Green	1K0907253E	NO

DILL 2014 TPMS APPLICATION GUIDE

	Model	Model Year	Torque In-Lbs	Multi-App Sensor	Multi-App Kit	Dill Sensor	Dill Kit	Kit Color	OE Sensor Part #	Valve Stem Repl.
Volkswagen (cont.)	Routan (433 Mhz)	09-10	71	7004	7020K	1043	1050K	White	7B0907253A	NO
		11-12	—	—	—	9398	VS950	—	7B0907253C	VS950
	Tiguan	09-11	71	7003	7020K	1053	1030K	Orange	1K0907253D	NO
		12-13	40	—	—	9013	1096	Yellow	3AA 907 275D	1096
	Touareg	11-14	40	—	—	9011	1096	Yellow	4F0 907 275D	1096
	Touareg (433 Mhz) December 2006	03-07	35	—	—	9005	1090K	Gray	7L0 907 275B	1092
Touareg (433 Mhz) January 2007	07-10	35	—	—	9007 or 9011	1090K	Gray	4F0 907 275B	1092	
Volvo	C30 (433 Mhz)	07-10	71	—	7020K	1044	1050K	White	31302096	NO
		11-13	71	—	7020K	1044	7020K	◆	31302096	VS70
	C70 (433 Mhz)	07-10	71	—	7020K	1044	1050K	White	31302096	NO
		11-13	71	—	7020K	1044	7020K	◆	31302096	VS70
	S40 (433 Mhz)	07-10	71	—	7020K	1044	1050K	White	31302096	NO
		11	71	—	7020K	1044	7020K	◆	31302096	VS70
	S60 (315 Mhz)	04-08	44	7003	7020K	9156	2010K	Lt Brown	86517000	NO
		09-10	—	7003	7020K	NEW	VS950	NA	31200923	VS950
		09-10	44	7003	7020K	9156	2010K	Lt Brown	OE Sensor Replacement	NO
	S60 (433 Mhz)	11-14	71	—	7020K	1044	7020K	White	31302096	VS70
	S80 (315 Mhz)	04-06	44	7003	7020K	9156	2010K	Lt Brown	86517000	NO
	S80 (433 Mhz)	07-10	71	—	7020K	1044	1050K	White	31302096	NO
		11-14	71	—	7020K	1044	7020K	◆	31302096	VS70
	V50 (433 Mhz)	08-10	71	—	7020K	1044	1050K	White	31302096	NO
		11	71	—	7020K	1044	7020K	◆	31302096	VS70
	V70 (315 Mhz)	04-07	44	7003	7020K	9156	2010K	Lt Brown	86517000	NO
	V70 (433 Mhz)	08-10	71	—	7020K	1044	1050K	White	31302096	NO
	XC60	10-14	71	—	7020K	1044	7020K	◆	31302096	VS70
	XC70 (315 Mhz)	04-07	44	7003	7020K	9156	2010K	Lt Brown	86517000	NO
	XC70 (433 Mhz)	08-10	71	—	7020K	1044	1050K	White	31302096	NO
		11-14	71	—	7020K	1044	7020K	◆	31302096	VS70
	XC90 (315 Mhz)	05-11	44	7003	7020K	9156	2010K	Lt Brown	86517000	NO
		12-14	—	7003	7020K	NEW	VS950	—	31200923	VS950
		12-14	44	7003	7020K	9156	2010K	Lt Brown	OE Sensor Replacement	NO
XC90 (433 Mhz)	08	71	—	7020K	1044	1050K	White	31302096	NO	
MV-1	11-13	—	7001-R/ HP-R	VS80	9315	VS950	NA	SP000437	VS950	
Volvo Bus	—	—	—	—	9010	VS9013 or VS9980	—	—	VS9013 or VS9980	
Prevost Bus	—	—	—	—	9010	VS9013 or VS9980	—	—	VS9013 or VS9980	
Nova Bus	—	—	—	—	9010	VS9013 or VS9980	—	—	VS9013 or VS9980	

◆ The 7020K Service Kit is used.

Application guides subject to change without notice. Please refer to the manufacturer's websites for the most up-to-date application data.

ALPHABETICAL INDEX

1/4" Socket Driver _____	30	Multipro Multi-Protocol TPMS Sensors _____	21
315MHz Redi-Sensor Universal Transmitter (Clamp-In Style) _____	14	Nissan Reset Tool _____	9
Aftermarket TPMS Accessory Kits _____	26	REDI-Sensor Universal Transmitter _____	14
Ateq VT55 OBDII TPMS Tool Kit _____	12	REDI-Sensor Valve Stems _____	15
Ateq VT56 OBDII TPMS Tool Kit _____	12	Replacement Rubber Valve & Screw for 7001HP-R Redi-Sensor _____	15
Band Transmitter for Ford _____	32	Replacement Sensors and Replacement Stems for the Smart Sensor Pro+ Programming/Scanning Tool _____	20
Bartec EZ-Sensor Starter Kits _____	9	Replacement Snap-In Valve for Schrader Snap-In Transmitters _____	13
Bartec Mechanical Tool Kit _____	31	Replacement Stem for Chrysler/Dodge TPMS Applications _____	25
Bartec Mitsubishi OBDII Relearn Adapter _____	5	Rubber TPMS Snap-In Replacement Valves _____	15
Bartec Programming Fixture _____	7	Rubber TPMS Snap-In Replacement Valves _____	25
Bartec Tech200 Base Activation Tool _____	5	Schrader Accessory Kit Assortments _____	22
Bartec Tech400 Smart Sensor Programming Fixture _____	6	Schrader Accessory Kits _____	22
Bartec Tech500 Smart Sensor Programming Fixture _____	6	Schrader TPMS Retrofit Kits _____	35
Bartec Wheelrite Tech300SD _____	8	Schrader TPMS Training DVD _____	33
Bartec Wheelrite Tech400SD TPMS Tool _____	7	Schrader TPMS Transmitters _____	16
Bartec Wheelrite Tech500 All-In-One TPMS Service Tool w/ OBD and Wireless Connectivity _____	5	Schrader TPMS Valve Caps _____	25
Beru TPMS Valve Inserts _____	27	Schrader TPMS Valve Core _____	27
Complete Dill Universal Sensor Package _____	24	Smart Sensor Pro+ Programming/Scanning Tool _____	20
Complete Replacement Kit for Chrysler/Dodge TPMS Applications _____	25	Speed Torque Tools for TPMS _____	29
Consumer Awareness Counter Mat _____	34	T-10 Torque Tools _____	28
Core/Cap Removal Tool _____	30	T-20 Torque Tool with Replaceable Tip _____	28
Digital Tire Inflator Gauge _____	31	TIA TPMS Relearn Chart _____	4
Dill Aluminum Replacement TPMS Stems _____	15	Tire Deflator/Valve Core Remover _____	29
Dill OEM Replacement Bands _____	32	Tire Deflator Set for TPMS Valve Stems _____	28
Dill TPMS Accessory Kits _____	23	Tire Pressure Monitoring System Reset Tool _____	10
Dill TPMS Cabinets _____	34	Tire Pressure Monitoring System Reset Tool Master Kit _____	10
Dill TPMS Master Tool Kit _____	31	Toyota Loop Reset Tool _____	9
Dill TPMS Replacement Stem Assortment _____	24	TPMS Band Transmitter Accessories _____	32
Dill TPMS Startup Assortment _____	24	TPMS Consumer Kit _____	33
Dill TPMS Transmitters _____	18	TPMS Countertop Displays _____	34
Dill TPMS Valve Caps & Cores _____	27	TPMS Hub _____	6
Dill Trailer TPMS System _____	35	TPMS Kit for REDI-Sensor _____	15
Electronic TPMS Torque Wrench _____	29	TPMS Pad _____	6
EZ-Sensor Programmable TPMS Sensors _____	13	TPMS Torque Wrenches and Sockets _____	27
EZ-Sensor Replacement Aluminum Valve Stem _____	13	TPMS Training Package _____	33
EZ Tire TPMS Sensor Kit _____	13	TPMS Transmitter Check Box _____	12
Ford Complete Banded High Pressure Sensor Package _____	32	TPMS Tri-Fold Consumer Brochure, Brochure Holder _____	34
Ford Complete Banded Transmitter Package _____	32	TPMS Valve System Fishing Tool _____	30
Genisys EVO® USA 2012 Kit with Tire Pressure Reset Tool _____	11	TPR Tool with EZ-Sensor™ Programming _____	11
Grommet Installation/Removal Tool _____	30	Universal Master TPMS Transmitter Hardware & Tool Service Set _____	24
Grommet Removal Tool _____	30	Valve Core Tools: Screwdriver Type & Standard Bore Long Valve _____	29
High Pressure Ford Banded Transmitter _____	32	Valve Core Torque Tool _____	28
HUF Tire Pressure Monitoring System (TPMS) Transmitters _____	19		
Mitsubishi TPMS Reset Tool _____	9		

VT56 Diagnostic TPMS Tool

ATEQ

The **VT56** is a fully updateable, universal TPMS tool. Designed to activate all TPMS sensors and store the sensor data.

Using the OBDII connector this data can then be transferred to the vehicle to reset the ECU when a sensor is replaced or wheel positions are changed.

All popular programmable sensors can be programmed with the VT56.

VT56 OBDII Kit includes:

- VT56 Diagnostic Tool
- OBDII Interface Connector
- Docking Station with Thermal Printer (Optional)
- OBDII to VT56 Ethernet Cable
- USB PC Cable
- Power Adaptor
- Update Software
- Quickstart User Manual
- ATEQ Hard Kit Carry Case



Part# TS56-1000



**TRIGGERS
ALL KNOWN
SENSORS**

VT56 Features

- Full Color 4" Screen
- Icon Driven Intuitive Learning
- Part Number Lookup
- OBD II for ECU Reset
- Dated History File
- Programs all Popular Programmable Sensors
- OBD II Position
- Key Fob Tester
- RF Signal Tester
- Help Screens
- WIFI Connection to PC
- WIFI Updates
- Barcode Scanner for Vehicle Identification
- Bluetooth Connection for Printing
- Docking Cradle with Thermal Printer
- Update via USB, WIFI & SD Card
- TPMS DTC Retriever
- US / European / Asian Vehicles
- Full Relearn Procedures



Scan VIN



Trigger Sensors



Relearn TPMS



Flashlight on OBDII Module



ASCOTTM
SUPPLY CORPORATION



TPMS CATALOG 2014

Ask Your Sales Representative For Your Copy of the **Complete Ascot Buyer's Guide!**

Your ASCOT TPMS One Stop Shop Distributor:
Attention Service Manager:



©Ascot Supply Corporation
TPMS0414



Ascot Supply Corporation is not responsible for
inadvertent typographical errors or omissions.